
| Building No. 3230 | Street Williams Road | | Zip 95008 | Date of Inspection 02/14/13 | Page 1 of 9 |
|---|--|---|--------------------------------|---|------------------------------|
| Silver Creek Termite Contro | P.O. Box 8361 San Jose, CA 95 Phone: (408) 224 | I-4688 Fax: (408) 224-4577 | | | Report # 3131 |
| Ordered by: Claremont Pro Janee Medved 225 N. Santa C Los Gatos, CA W: 408-354-96 | operties Cruz Avenue | Property Owner and/or Party of Interest: | Report | | |
| General Desc | REPORT X LIMITED R ription: y, single family, stucco, | - | | REINSPECTION Fion Tag Posted: | REPORT 🗌 |
| compositio | n roof, crawl space, atta | ched garage, occupied | Other 1 | ags Posted: | |
| Subterranea If any of th | an Termites 💢 Drywood ne above boxes are checked, it indica | shown on the diagram in accordance with the Struces not on the diagram were not inspected. Diagram Termites Termites Fungus / Dryrot tes that there were visible problems in accessible awwood Termites 3 - Fungus/Dryrot 4 - Other | Other Findir areas. Read th | ngs 💢 Further I be report for details on c | nspection 💢 hecked items. |

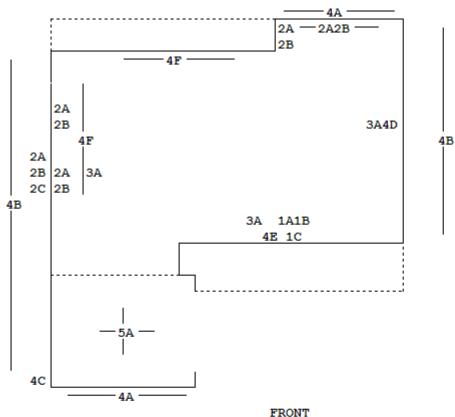

4B

NOT TO SCALE

Inspected by: Goran Subotin State License No. OPR 11955 Signature 🔄 You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies

| Building No. | Street | City | Zip | Date of Inspection | Report # | Page |
|--------------|---------------|----------|-------|--------------------|----------|--------|
| 3230 | Williams Road | Campbell | 95008 | 02/14/13 | 3131 | 2 of 9 |
| | | | | | | |

STANDARD PRACTICES, POLICIES AND DISCLAIMERS

PLEASE READ THIS COMPLETE REPORT, FROM BEGINNING TO END. WE HAVE COMPILED THIS REPORT USING GENERALLY ACCEPTED STANDARDS OF PRACTICE BASED ON THE CALIFORNIA PEST CONTROL BOARD ACT RULES AND REGULATIONS.

THE PEST CONTROL INDUSTRY RECOGNIZES A STRUCTURE TO HAVE CERTAIN AREAS BOTH INACCESSIBLE AND NOT INSPECTED. THESE AREAS INCLUDE BUT ARE NOT LIMITED TO: INACCESSIBLE AND/OR INSULATED ATTICS OR PORTIONS THEREOF, ATTICS WITH LESS THAN 18 INCHES CLEAR CRAWL SPACE, INSULATED SUBFLOOR STRUCTURE; THE INTERIOR HOLLOW WALLS, COMMON WALLS, THE CRAWL SPACE UNDERNEATH A DECK LESS THAN 12 INCHES; COVERED CEILINGS, AREAS/PLUMBING/UTILITIES ABOVE DROPPED AND/OR FINISHED CEILINGS AND BEHIND CLOSED WALLS, OPEN BEAM CEILINGS; SPACES BETWEEN A FLOOR OR PORCH DECK, AND THE CEILING BELOW; AREAS WHERE THERE IS NO ACCESS WITHOUT DEFACING OR TEARING LUMBER, MASONRY OR FINISHED WORK; AREAS UNDERNEATH, BEHIND OR BELOW APPLIANCES OR BENEATH FLOOR COVERINGS, FURNISHING AND/OR STORED ITEMS, LOCKED AREAS, AND AREAS REQUIRING AN EXTENSION LADDER, I.E. SECOND STORY EAVES; AREAS WHERE ENCUMBRANCES, STORED ITEMS, CONDITIONS AND/OR LOCKS MAKE INSPECTION IMPRACTICAL; CONCEALED EAVES;SOFFITED EAVES/AREAS; EAVES OVER PATIO(S); INTERIOR OF ENCLOSED ABUTMENTS OR HOLLOW STUCCO WALLS; AREAS UNDER WATER HEATER PEDESTALS; ENCLOSED AREAS UNDER DECKS, STAIRS, PATIOS, ETC.

MOLDS, SOMETIMES CALLED MILDEW, ARE NOT WOOD-DESTROYING ORGANISMS AND IS OUTSIDE THE SCOPE OF THIS INSPECTION. BRANCH 3 LICENSEES DO NOT HAVE THE DUTY UNDER THE STRUCTURAL PEST CONTROL ACT AND RELATED REGULATIONS TO CLASSIFY MOLDS. OUR COMPANY DOES NOT TAKE ANY RESPONSIBILITY FOR MOLD-RELATED ISSUES. IF YOU WISH YOUR PROPERTY TO BE INSPECTED FOR MOLD OR MOLD-LIKE CONDITIONS, PLEASE CONTACT A MOLD PROFESSIONAL.

NOTICE: THE STRUCTURAL PEST CONTROL BOARD ENCOURAGES COMPETITIVE BUSINESS PRACTICES AMONG REGISTERED COMPANIES. REPORTS ON THIS STRUCTURE PREPARED BY VARIOUS REGISTERED COMPANIES SHOULD LIST THE SAME FINDINGS (i.e. TERMITE INFESTATIONS, TERMITE DAMAGE, FUNGUS DAMAGE, etc.) HOWEVER, RECOMMENDATIONS TO CORRECT THESE FINDINGS MAY VARY FROM COMPANY TO COMPANY. YOU HAVE THE RIGHT TO SEEK A SECOND OPINION FROM ANOTHER COMPANY.

NOTICE: THE CHARGE FOR SERVICE THIS COMPANY SUBCONTRACTS TO ANOTHER PERSON OR ENTITY MAY INCLUDE THE COMPANY'S CHARGES FOR ARRANGING AND ADMINISTERING SUCH SERVICES THAT ARE IN ADDITION TO THE DIRECT COSTS ASSOCIATED WITH PAYING THE SUBCONTRACTOR.

THIS COMPANY DOES NOT INSPECT ROOFS AS IT IS BEYOND THE SCOPE OF OUR LICENSE. THE EXTERIOR SURFACE OF THE ROOF WAS NOT INSPECTED. IF YOU WANT THE WATER TIGHTNESS OF THE ROOF DETERMINED, YOU SHOULD CONTACT A ROOFING CONTRACTOR WHO IS LICENSED BY THE CONTRACTORS' STATE LICENSE BOARD.

WE CANNOT GUARANTEE WORK DONE BY THE OWNERS OR THE OWNERS AGENT. WE MAKE NO GUARANTEE AGAINST FUTURE INFECTIONS, ADVERSE CONDITIONS OR CONDITIONS PRESENT BUT NOT EVIDENT AT THE TIME OF OUR INSPECTION.

SHOULD FURTHER INSPECTION ITEMS NOTED IN THIS REPORT NOT BE PERFORMED, OUR COMPANY WILL ASSUME NO LIABILITY FOR ANY INFESTATIONS OR INFECTION(S) WHICH MAY BE CONCEALED IN THESE AREAS.

NOTE: OUR BID FOR TILE/VINYL IS BASED ON STANDARD GRADE TILE/VINYL. ALL UPGRADES

| Building No. | Street | City | Zip | Date of Inspection | Report # | Page |
|--------------|---------------|----------|-------|--------------------|----------|--------|
| 3230 | Williams Road | Campbell | 95008 | 02/14/13 | 3131 | 3 of 9 |
| | | | | | | |

WILL BE AT ADDITIONAL COST.

MINIMUM CHARGE FOR REPAIRS PERFORMED BY THIS COMPANY IS \$150.00.

MINIMUM CHARGE FOR CLEARANCE OF WORK PERFORMED BY OTHERS IS \$175.

NOTE: IF LOCAL BUILDING CODES REQUIRE PERMITS OR ADDITIONAL WORK WHICH IS NOT

OUTLINED IN THIS REPORT, A CHANGE WORK ORDER WILL BE ISSUED. THE CHANGE ORDER WILL INCLUDE THE CITY REQUIREMENTS AND AN ADDITIONAL COST ESTIMATE

TO PERFORM THE WORK.

THIS COMPANY DOES NOT DO SLAB INSPECTIONS AS IT IS BEYOND THE SCOPE OF OUR LICENSE. FLOOR COVERING MAY CONCEAL CRACKS IN THE SLAB THAT WILL ALLOW INFESTATIONS TO ENTER. INFESTATIONS MAY BE CONCEALED BY PLASTER, SHEET ROCK, OR OTHER WALL COVERINGS. IF WOOD DESTROYING PESTS OR ORGANISMS HAVE CAUSED DAMAGE DIRECTLY RESULTING FROM THE CONDITION AT THE FOUNDATION AND IT IS OBSERVED AT THE TIME OF INSPECTION, THEN OUR REPORT WILL INDICATE THIS OTHERWISE IT IS RECOMMENDED THAT A FOUNDATION PROFESSIONAL BE CONTACTED.

THIS COMPANY SHALL EXERCISE DUE CARE DURING INSPECTIONS AND TREATMENTS BUT ASSUMES NO LIABILITY FOR ANY DAMAGE TO TILES, SLATES, SHINGLES OR OTHER ROOFING MATERIALS, INCLUDING BUT NOT LIMITED TO PATIO COVERS, ALUMINUM AWNINGS, SOLAR HEATING, PLANTS, SHRUBBERY OR PAINT DURING ANY TYPE OF TREATMENT.

UPON COMPLETION OF OUR WOOD REPAIRS IN AREAS AT THE ROOF LINE AND/OR ASSOCIATED WITH THE ROOF STRUCTURE (I.E. EAVES, RAFTER TAILS, FASCIA BOARDS, BARGE RAFTERS, ETC.), THE ROOF COVERING AND/OR THE GUTTERS COULD BE DAMAGED OR IT MAY HAVE BEEN REMOVED IN ORDER TO EFFECT REPAIRS. IT WILL BE NECESSARY FOR THE OWNER, UPON COMPLETION OF OUR WOOD REPAIRS, TO HAVE A ROOFING CONTRACTOR AND/OR SHEET METAL CONTRACTOR, OR SOMEONE IN THAT LINE OF WORK, REPAIR THE ROOF COVERING AND/OR GUTTERS AS NECESSARY. ANY GUARANTEE AGAINST LEAKAGE THROUGH THE ROOF COVERING SHOULD BE SECURED FROM WHOEVER DOES THE ROOF COVERING REPAIR. OUR BID DOES NOT INCLUDE ANY ROOF COVERING AND/OR GUTTER REPAIR COSTS.

GUTTER(S) AND/OR DOWNSPOUTS MAY NEED TO BE REMOVED AS PART OF OUR REPAIRS. WE ARE NOT RESPONSIBLE FOR REINSTALLING GUTTER AND/OR DOWNSPOUTS. CLIENT WILL NEED TO EMPLOY SOMEONE IN THIS LINE OF WORK.

IN ORDER TO PERFORM CORRECTIVE MEASURES, IT MAY BE NECESSARY TO DRILL INTO CONCEALED AREAS AND/OR CUT OR REMOVE PLANTS. THE TERMITE EXTERMINATOR WILL NOT BE LIABLE FOR PLUMBING, HEATING, ELECTRICAL, GAS LINE(S) AND EQUIPMENT IN OR UNDER A SLAB, NOR FOR PLANTS WHICH MAY BE DAMAGED DURING TREATMENTS AND/OR REPAIRS.

RE-INSPECTIONS AND WORK DONE BY OTHERS:

IF REQUESTED BY THE PERSON WHO ORDERED AN ORIGINAL REPORT, A RE-INSPECTION OF THE STRUCTURE WILL BE PERFORMED IF AN ESTIMATE OR BID FOR MAKING REPAIRS WAS GIVEN WITH THE ORIGINAL REPORT, OR THEREAFTER. THIS COMPANY WILL RE-INSPECT REPAIRS DONE BY OTHERS WITHIN FOUR MONTHS OF THE ORIGINAL INSPECTION. A CHARGE, IF ANY, CAN BE NO GREATER THAN THE ORIGINAL INSPECTION FEE FOR EACH RE-INSPECTION. THE RE-INSPECTION MUST BE DONE WITHIN TEN(10) WORKING DAYS OF REQUEST. A RE-INSPECTION IS A VISUAL INSPECTION ONLY. INSPECTION(S) OF WORK IN PROGRESS WILL BE NECESSARY. A

| Building No. | Street | City | Zip | Date of Inspection | Report # | Page |
|--------------|---------------|----------|-------|--------------------|----------|--------|
| 3230 | Williams Road | Campbell | 95008 | 02/14/13 | 3131 | 4 of 9 |
| | | | | | | |

FEE WILL APPLY FOR EACH RE-INSPECTION/VISIT TO THE PROPERTY. ANY DAMAGED MATERIAL SHOULD BE REMOVED AND AREAS LEFT OPEN. THE RE-INSPECTION SHOULD BE SCHEDULED AND PERFORMED BEFORE ANY REPAIRS ARE COMPLETED AND AREAS OTHERWISE INACCESSIBLE ARE CLOSED/COVERED IN ORDER TO ENSURE THERE IS NO HIDDEN DAMAGE AND DAMAGE DOES NOT EXTEND IN TO INACCESSIBLE AREAS. ANY GUARANTEES MUST BE RECEIVED FROM PARTIES PERFORMING REPAIRS.

WE CANNOT PROVIDE WARRANTIES, GUARANTEES OR CLEARANCE ON TREATMENTS PERFORMED BY OTHERS, INFORMATION CONCERNING WARRANTIES, GUARANTEES OR CLEARANCE SHOULD BE SOUGHT FROM THE COMPANY THAT PERFORMED THE TREATMENT(S).

IF DURING THE PERFORMANCE OF ANY REPAIRS, RE-INSPECTIONS BY THIS COMPANY OR AT ANY OTHER TIME, INACCESSIBLE AREAS BECOME ACCESSIBLE AND IF INFESTATIONS AND/OR DAMAGE IS FOUND TO EXTEND INTO ANY INACCESSIBLE AREAS THAT WERE NOT EVIDENT AT THE TIME OF THE ORIGINAL INSPECTION, WE WILL ISSUE A SUPPLEMENTAL REPORT LISITING ADDITIONAL FINDINGS, RECOMMENDATIONS, AND COST(S) TO REPAIR.

GUARANTEE POLICY:

THIS GUARANTEE EXCLUDES STRUCTURE WITH SUB SLAB HEATING/AIR CONDITIONING SYSTEMS, PLENUM CONSTRUCTION WITH AIR CONDITIONING AND HEATING DUST IN USE, A WELL OR CISTERN WITHIN FIFTY FEET AND AREAS THAT ARE INACCESSIBLE FOR TREATMENT. ADDITIONAL EXCLUSIONS INCLUDE STRUCTURES WITH DAMAGE TO OR FROM EXCESSIVE MOISTURE, INADEQUATE CONSTRUCTION, AREAS OF INACCESSIBILITY, DETERIORATING MATERIALS, MASONRY FAILURE, GRADE ALTERATION, PIPES AND CONDUITS BENEATH CONCRETE SLAB, FURNISHINGS OR CONTENTS/STORED ITEMS, ETC. NO GUARANTEE WILL BE ISSUED FOR ANY WORK THAT IS A SECONDARY RECOMMENDATION OR WORK COMPLETED BY OTHERS. A THIRTY(30) DAY GUARANTEE APPLIES TO PLUMBING, GROUTING, CAULKING AND RESETTING OF COMMODES, SINKS AND/OR ENCLOSURES. ALL OTHER WORK PERFORMED BY THIS COMPANY SHALL BE GUARANTEED FOR THE DURATION OF ONE YEAR FROM THE TIME THE WORK WAS COMPLETED.

OUR COMPANY ASSUMES NO LIABILITY FOR, NOR DO WE GUARANTEE, WORK DONE BY OTHERS. ALL GUARANTEES, WARRANTIES, AND PERMITS SHOULD BE OBTAINED FROM THE PARTIES PERFORMING REPAIRS.

THE OWNER OF THIS STRUCTURE HAS CERTAIN OBLIGATIONS REGARDING MAINTENANCE AND PERTAINING TO THE DETERRENCE OF WOOD DESTROYING ORGANISMS. MAINTENANCE PROCEDURES INCLUDE BUT ARE NOT LIMITED TO; REASONABLE CLEANING, UPKEEP OF ROOFS, GUTTERS, AND DOWNSPOUTS,; PAINTING AND SEALING EXPOSED SURFACES; CAULKING DOORS AND WINDOWS; GROUTING ABOUT COMMODES, TUB AND SHOWER ENCLOSURES; STORING ITEMS, MATERIALS ONE FOOT AWAY FROM THE STRUCTURE AND FOUNDATION; PROVIDING ADEQUATE VENTILATION, MAINTAINING PROPER DRAINAGE AWAY FROM THE STRUCTURE (INCLUDING IRRIGATION SYSTEMS); KEEPING SOIL LEVELS BELOW THE TOP OF THE FOUNDATION(S) AND PROHIBITING EARTH CONTACT WITH WOOD SURFACES AND COMPONENTS OF THE STRUCTURE(S).

WORK COMPLETED BY THIS COMPANY DOES NOT INCLUDE FINISH PAINTING, TEXTURING AND/OR SANDING. OWNER IS RESPONSIBLE FOR THESE ITEMS.

SECTION REPORTING:

A SEPARATE REPORT INCLUDES SECTION I AND/OR II CONDITIONS EVIDENT ON THE DATE OF THIS INSPECTION. SECTION I CONTAINS ITEMS WHERE THERE IS EVIDENCE OF ACTIVE INFESTATION, INFECTION AND/OR

| Building No. | Street | City | Zip | Date of Inspection | Report # | Page |
|--------------|---------------|----------|-------|--------------------|----------|--------|
| 3230 | Williams Road | Campbell | 95008 | 02/14/13 | 3131 | 5 of 9 |
| | | | | | | |

CONDITIONS THAT HAVE RESULTED IN OR ARE FROM INFESTATION OR INFECTION. SECTION II ITEMS ARE CONDITIONS DEEMED LIKELY TO LEAD TO INFESTATION BUT WHERE NO VISIBLE EVIDENCE OF SUCH WAS FOUND OR OBSERVED. FURTHER INSPECTION ITEMS ARE DEFINED AS RECOMMENDATIONS TO INSPECT AREA(S) WHICH DURING THE ORIGINAL INSPECTION DID NOT ALLOW THE INSPECTOR ACCESS TO COMPLETE THE INSPECTION AND CANNOT BE DEFINED AS SECTION I OR II.

SECTION I:

(1) SUBTERRANEAN TERMITES

1A. FINDING: Evidence of subterranean termites was found, noted as 1A on the diagram.

RECOMMENDATION: Perform a guaranteed soil treatment for the control of subterranean termites using a registered

termiticide. This treatment may include, but is not limited to the following methods of treatment: Treat the subarea soil adjacent to the foundation walls (only when the infestations originate at these areas). Treat the subarea soil adjacent to the piers and/or plumbing lines. Treat the exterior soil adjacent to all accessible exterior foundation walls using drill and treat, trench and treat and/or rod and treat application methods. Drilling concrete, brick, veneers and others areas such as slab room(s), walkways, and porches. After the treatment all holes will be patched. Carpets may be

pulled back as needed; owner is responsible for re-installing carpet. (SECTION I ITEM)

In the performance of the above recommendation, we propose to use the chemical Termidor (Fipronil).

NOTE: The soil treatments will be performed in compliance with the Termidor SC Post Construction

Exterior Perimeter/Localized Interior (EP/LI) Label Instructions.

NOTE: : The treatment outlined in the item above will guarantee the entire structure against infestations

by subterranean termites for a period of two years from completion.

NOTE: We will be unable to guarantee an exact match at the areas that are drilled and then patched.

This will include painted surfaces, aggregate, brick, tile, grout, etc.

NOTE: Silver Creek Termite Control, Inc. assumes no liability for any damage to any plumbing lines, gas

lines or electrical lines which could be concealed below the slabs and other surfaces to be drilled. Although Silver Creek Termite Control, Inc. uses caution, we assume no liability for broken and/or chipped bricks, tiles, etc. due to drilling. Please remove stored items (if applicable) 3 feet away

from interior walls in garage prior to treatment.

1B. FINDING: Evidence in the form of SHELTER TUBES for subterranean termites was observed and noted as

1B on the diagram.

RECOMMENDATION: REMOVE all shelter tubes in these areas. (SECTION I ITEM)

1C. FINDING: There is cellulose debris in earth contact in the substructure area. There is evidence of infestation

by SUBTERRANEAN TERMITES in this debris, noted as 1C on the diagram.

RECOMMENDATION: Remove cellulose debris of a size that can be raked from the substructure area. See additional

findings for treatment for subterranean termites. (SECTION I ITEM)

| Building No. | Street | City | Zip | Date of Inspection | Report # | Page |
|--------------|---------------|----------|-------|--------------------|----------|--------|
| 3230 | Williams Road | Campbell | 95008 | 02/14/13 | 3131 | 6 of 9 |
| | | | | | | |

(2) DRYWOOD TERMITES

2A. FINDING: Evidence of drywood termites was observed at the areas noted as 2A on the diagram.

RECOMMENDATION: Tarp, seal and FUMIGATE with the lethal gas, Vikane or other similar chemical. SECTION I ITEM.

NOTE: While care and caution will be exercised by fumigation crews, no responsibility is taken for

possible damage to roof. TV antennae, shrubbery and plants around building. Occupants should make arrangements to be away from the property for a period of approximately 48 hours. If customer has to cancel fumigation, we must be given a one (1) week advance notice or a

cancellation fee of \$100.00 will be charged.

NOTE: IT SHOULD BE NOTED THAT THE PRICE QUOTED IS FOR FUMIGATION AND PREP WORK

PERFORMED BY FUMIGATION COMPANY. ANY PREP WORK ASSIGNED TO THE OWNER

WILL BE OWNER'S RESPONSIBILITY AND AT OWNER'S EXPENSE.

NOTE: PLEASE NOTE THE PRICE FOR FUMIGATION IS NOT ALWAYS INCLUDED IN THE TOTAL

PRICE FOR REPAIRS. ONCE THE PROPERTY IS MEASURED WE WILL SEND AN UPDATED

AUTHORIZATION WITH A PRICE FOR FUMIGATION. (SECTION I ITEM)

2B. FINDING: Evidence of drywood termites, in the form of drywood PELLETS, was observed, noted as 2B on

the diagram.

RECOMMENDATION: MASK and/or remove all pellets that are accessible. (SECTION I ITEM)

2C. FINDING: Drywood termite damage was observed at the door threshold, noted as 2C on the diagram.

RECOMMENDATION: REMOVE and REPLACE the damaged wood members. If possible, we will chisel or cut out

damaged area and fill with either a plastic or wood filler. We will then sand and primer paint.

SECTION LITEM.

NOTE: If damage extends into inaccessible areas, we will issue a supplemental report with our findings,

recommendations and costs for repairs.

(3) FUNGUS/DRYROT

3A. FINDING: There was a SURFACE FUNGUS condition observed at the subfloor as viewed from crawl space.

noted as 3A on the diagram.

RECOMMENDATION: SCRAPE or wire brush this area and then treat with a registered fungicide. (SECTION I ITEM)

SECTION II:

(4) OTHER FINDINGS

4A. FINDING: Vegetation was too close to, touching, or growing at the siding and/or roof. Such conditions can

create mini-environments with high moisture content, which can promote moisture damage to the affected structure or systems or promote infestation by wood-destroying pests and organisms.

RECOMMENDATION: Owner to have proper tradesperson remove or trim back vegetation. (SECTION II ITEM)

4B. FINDING: Exterior stucco extends below exterior grade. This condition could conceal and contribute to

termite infestation and/or fungus infection. No evidence of infestation or infection was found at this

time.

RECOMMENDATION: Periodic monitoring and inspection. (SECTION II ITEM)

| Building No. | Street | City | Zip | Date of Inspection | Report # | Page |
|--------------|---------------|----------|-------|--------------------|----------|--------|
| 3230 | Williams Road | Campbell | 95008 | 02/14/13 | 3131 | 7 of 9 |
| | | | | | | |

4C. FINDING: No metal flashing was observed at the fence to house transition. This condition is considered to

be conducive to infestation or infection.

RECOMMENDATION: Owner to have proper tradesperson repair as necessary. (SECTION II ITEM)

4D. FINDING: Water is leaking glass shower door knob in the hallway bathroom.

RECOMMENDATION: Owner to RESEAL THIS DOOR KNOB in the most practical way. (SECTION II ITEM)

4E. FINDING: CAULKING/GROUT was loose, deteriorated and/or missing at the sink in the kitchen.

RECOMMENDATION: REMOVE OLD LOOSE CAULKING/GROUT and clean all existing caulking/grout. Re-caulk/grout

as necessary. (SECTION II ITEM)

4F. FINDING: Damp soil was observed in the crawl space, noted as 4F on the diagram.

RECOMMENDATION: Recommend periodic inspection or owner should consult with appropriate drainage specialist to

determine cause and possible corrective measures if client deems necessary. SECTION II ITEM.

FURTHER INSPECTION:

(5) FURTHER INSPECTION

5A. FINDING: We made a limited inspection of the garage area(s) noted as 5A due to stored items, cabinets,

shelves, appliances, vehicles, etc.

RECOMMENDATION: The owner should move the stored items at which time we will return, inspect and make any

additional recommendations. Our charge at the time of the further inspection will be \$75 and does

not include trip fees or fees for any additional work required. UNKNOWN, FURTHER

INSPECTION ITEM.

AREAS NOT INSPECTED, PLEASE READ (OCCUPIED STRUCTURE)

This is a report of an inspection for wood destroying pests to a furnished, occupied structure. Some areas of the structure are inaccessible for inspection due to furnishings, appliances, floor coverings, and stored personal property. We did not inspect areas immediately under furnishings, appliances, or carpets. We did not inspect inside finished walls or ceilings. Inspection of these areas are not practical. Our inspection does not include inspection of the electrical, plumbing, heating or mechanical systems of the structure. We did not inspect the wooden roof covering. Our inspection will not detect building code violations. If any information is desired about any of these areas, a company who makes home and roof inspections should be engaged. It is possible for wood destroying organisms, infestations and infections to be concealed and not evident at the time of our inspection.

The attic was visually inspected from the access opening only. Areas of the attic were not fully inspected as a result.

Insulation prevented a complete inspection of the attic space. We make no exceptions. This company makes no recommendations for this area and will not be held responsible for any damage that may be concealed by the insulation. If requested, this company will return to remove the insulation and inspect the concealed areas for an extra charge.

If the client has concerns, recommend removing insulation at which time we will inspect and issue findings and recommendations.

INACCESSIBLE AREAS, PLEASE READ

It is common in occupied homes for there to be toiletries, etc., found UNDERNEATH KITCHEN and BATHROOM SINKS. This makes total inspection of these areas impossible. We have made a visual inspection. If at a later date items are moved and any infestations or infections are found, this company will issue a report for an additional fee, with additional findings, recommendations and costs. (THESE AREAS ARE CLASSIFIED AS INACCESSIBLE FOR TOTAL INSPECTION.)

Our company has always strived to provide its customers with the safest and most efficient methods of pest control. Knowing

| Building No. | Street | City | Zip | Date of Inspection | Report # | Page |
|--------------|---------------|----------|-------|--------------------|----------|--------|
| 3230 | Williams Road | Campbell | 95008 | 02/14/13 | 3131 | 8 of 9 |
| | | | | | | |

that we deal with toxic materials, we keep ourselves educated so we can provide our customers with the best possible service results, and so we can use pesticides in the safest possible manner for our customers and ourselves.

In accordance with our sense of responsibility for the safety of our customers and employees, we ask that you read the following.

State Law requires that you be given the following information:

CAUTION -- PESTICIDES ARE TOXIC CHEMICALS

Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Food and Agriculture and the United States Environmental Protection Agency. Registration is granted when the state finds that based on existing scientific evidence there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized.

If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center (telephone number listed below) and our company immediately.

For further information, contact any of the following:

Silver Creek Termite Control - (408) 224-4688

_ TRI-DIE PT230; Pyrethrins, Piperonyl Butoxide-Technical, Silica Gel

For Health Questions -- the County Health Department Alameda County (415) 540-3063; Contra Costa County (415) 646-2286; San Francisco County (415) 554-2500; San Joaquin County (209) 468-3420; San Mateo County (415) 363-4305; Santa Clara County (408) 792-5586.

For Application information - the County Agricultural Commissioner: Alameda County (415) 670-5156; Contra Costa County (415) 646-5250; San Francisco County (415) 285-5010; San Joaquin County (415) 468-3300; San Mateo County (415) 363-4700; Santa Clara County (408) 918-4600.

For Regulatory Information - the Structural Pest Control Board: (916) 263-2544, 1418 Howe Avenue, Suite 18, Sacramento, CA 95825-3280.

Pesticides that may be used on your property during the course of our work is listed below. The active ingredients are also listed.

| Dampwood Termites - |
|--|
| TRIBUTE; Cyano (3-phenoxyphenyl) methyl 4-choloro-alpha (1-methylethyl) benzeneacetate. Contains 2 pounds of |
| fenvalerate per undiluted gallon. |
| Drywood Termites (Fumigation) - |
| VIKANE; Sulfuryl Flouride with Chloropicrin as the warning agent. |
| Drywood Termites (Local Treatment) - |
| CY-KICK; Cyfluthrin |
| TERMIDOR SC; Fipronil |
| TIM-BOR; Disodium Octaborate Tetrahydrate |
| DRIONE; Pyrethrins, Piperonyl Butoxide-Technical, Amorphous Silica Gel and Petroleum Distillate. |
| TRIBUTE; Cyano (3-phenoxyphenyl) methyl 4-choloro-alpha (1-methylethyl) benzeneacetate. Contains 2 pounds of |
| fenvalerate per undiluted gallon. |

| Building No. | Street | City | Zip | Date of Inspection | Report # | Page |
|--------------|-----------------------------|---------------------------------|-----------------|--------------------|----------|--------|
| 3230 | Williams Road | Campbell | 95008 | 02/14/13 | 3131 | 9 of 9 |
| Fungus an | d/or Dryrot - | | | | | |
| • | • | enate, Copper salts of Naphthe | enic Acids | | | |
| TIM-BO | R; Disodium Octoborate T | etrahydrate | | | | |
| Subterrane | ean Termites - | • | | | | |
| PREMIS | SE; Imidacloprid | | | | | |
| TERMI | OOR SC; Fipronil | | | | | |
| TRIBUT | E; Cyano (3-phenoxyphei | nyl) methyl 4-chloro-alpha-(1-m | ethylethy) beni | zeneacetate. | | |
| Contains 2 | pounds of fenvalerate per | rundiluted gallon. | | | | |
| ADVAN | CE TBC II; Diflubenzuron | | | | | |
| Wood Dest | troying Beetles (Fumigatio | n) - | | | | |
| VIKANE | ; Sulfuryl Flouride with Ch | loropicrin as the warning agen | t | | | |
| Wood Dest | troying Beetles (Local Trea | atment) - | | | | |
| TRI-DIE | PT230; Pyrethrins, Piper | onyl Butoxide-Technical, Silica | Gel | | | |
| CY KIC | K; Cyfluthrin | | | | | |
| Carpenter | Bees (Local Treatment)- | | | | | |

__ CY KICK; Cyfluthrin

WORK AUTHORIZATION CONTRACT

| Building No. | Street | City | Zip | Date of Inspection | Page No. |
|--------------|---------------|----------|-------|--------------------|----------|
| 3230 | Williams Road | Campbell | 95008 | 02/14/13 | 1 |



Silver Creek Termite Control, Inc.

P.O. Box 8361 San Jose, CA 95155 Phone: (408) 224-4688 Fax: (408) 224-4577

Registration # PR4922

For Report #3131

ITEMIZED COST BREAKDOWN (Refer to items on the report)

Primary Work Bid Secondary Work Bid

SECTION 1: 1A: \$875.00, 1B: \$75.00, 1C: \$50.00, 2A: \$1769.00, NONE

2B: \$175.00, 2C: \$325.00, 3A: \$375.00

*** TOTAL: \$3644.00

SECTION 2: 4A: OWNER, 4B: OWNER, 4C: OWNER, 4D: NONE

OWNER, 4E: OWNER, 4F: OWNER

*** TOTAL: \$0.00

FURTHER INSPECTION: 5A: \$75.00 NONE

*** TOTAL: \$75.00

THIS IS A BINDING CONTRACT between SILVER CREEK TERMITE CONTROL, INC. and the owner and /or their agent with Claremont Properties, and incorporates our termite report # 3131 dated 02/14/13 for real property located at 3230 Williams Road Campbell CA 95008. Items on the report may contain provisions for additional costs over and above the original estimate. Please read the report carefully and completely.

CONDITIONS:

- 1. This offer is limited to 4 months from the date of the report.
- 2. If further inspection is recommended, or if additional work is required, we will provide prices or recommendations for correction. Interested parties will be notified prior to any work being done.
- 3. Notice to owner of Mechanic's Lien as required by the Structural Pest Control Board: Under the California Mechanics Lien Law, any structural pest control operator who contracts to do work for you, any contractor, subcontractor, laborer, supplier or other person who helps to improve your property, but is not paid for his work or supplies, has a right to enforce a claim against your property. This means that after a court hearing, your property could be sold by a court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you have paid your contractor in full if the subcontractor, laborers or suppliers remain unpaid. To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". General contractors and laborers for wages do not have to provide this notice. A Preliminary Notice is not a lien against your property. Its purpose is to notify you of persons who may have a right to file a lien against your property if they are not paid.
- 4. We will use due caution and diligence in their operations and care will always be taken to minimize any damage, but assumes no responsibility for matching existing colors and styles, or for incidental damage to roof coverings, TV antennas, solar panels, rain gutters, plant life, paint or wall coverings. There may be health related issues associated with the structural repairs reflected in the inspection report referenced by this work authorization contract. These health issues include but are not limited to the possible release of mold spores during the course of repairs. We are not qualified to and do not render any opinion concerning such health issues or any special precautions. We recommend that the client vacate the property for 4 to 6 hours for all local treatments. Any questions concerning health issues or any special precautions to be taken prior to or during the course of such repairs should be directed to a Certified Industrial Hygienist before any such repairs are undertaken. By executing this work authorization contract, customer acknowledges that he or she has been advised of the foregoing and has had the opportunity to consult with a qualified professional.
- 5. This report is limited to the accessible areas of the structure shown on the diagram. Please refer to the report for areas not inspected and further information.

| | | WORK A | UTHORIZATIO | N CONTRACT | | |
|--|---------------------------------|--|--|--|---|-----------------------------------|
| Building N | No. Street | | City | Zip | Date of Inspection | Page No. |
| 3230 | Williams Road | | Campbell | 95008 | 02/14/13 | 2 |
| | AA | Silver Creek Term | ite Control, Inc. | | | |
| 20.000 | | P.O. Box 8361 | | | | |
| | 2 | San Jose, CA 9515 | 55 | | | |
| | | Phone: (408) 224-4 | 1688 | | | |
| Silver Creek Termite Control | | Fax: (408) 224-457 | 7 | | | |
| and the same of th | | Registration # PR | 4922 | | For R | eport # 3131 |
| | | e agree to pay the sum completion unless pric | - | | Work Completed. A | ccounts are past |
| SILVER CI escrow im days of co | REEK TERMITE Compound or escrow | id out of escrow impou ONTROL, INC. with all e company. We understa we will pay the amoun | escrow billing informa and that we are respor | tion, and to notify us o sible for payment, and | f any changes assoc if escrow does not c | iated with the close within 30 |
| treated), lo areas trea | ocal treatment for | ermites (two years in a wood boring beetles (o t (three years). Warrant ., INC. | ne year only in areas | treated), local treatmen | t for carpenter ants (| (one year only in |
| 9. We auth | norize this compai | ny to perform items | | | | |
| \$ | | | | tor | a contract price of | |
| NAME OF | PERSON TO CON | TACT FOR ACCESS: _ | | PHONE # | | |
| SIGNED_ | | | DATE | FAX # | | |
| | | | EMAIL ADDRESS _ | | _ | |
| | | | EAY CONTR | ACT TO: (408) 224-4577 | , | |
| OWNER O | OR OWNER'S AGE | NT | TAX CONTI | ACT TO: (400) 224-4371 | | |
| | _ | nt orders work on the or crow company it will be | | | | if payment is |
| IS PROPE | RTY OCCUPIED O | R VACANT? (Please ci | rcle one) | | | |
| IF PROPE | RTY IS VACANT, F | PLEASE PROVIDE COM | BO OR LOCATION OF | KEY FOR ACCESS _ | | |
| PREFERR | ED DATE OF SER | VICE | PREFERRED DAT | E OF COMPLETION | | |

NOTE: We will make every effort to accomodate your requested schedule. Typically it takes approximately one to two weeks to schedule work (depending on the size of the job). Execptions can be made, but this is a good rule of thumb. Please take this into consideration when planning the work that needs to be completed.

****PLEASE PROVIDE ALL EMAIL ADDRESSES TO RECEIVE NOTICE OF COMPLETION AND INVOICE****