

(3) Observed cracks and separation of wheel skirt. Recommend repair by a qualified RV technician to prevent detachment while in transit.



3.1.C Paint and/or Decals

Comments: Acceptable

3.2.C Windows

Comments: Acceptable

3.3.C Cargo/Access Doors

Comments: Poor

(1) Observed significant water damage and high moisture content on lower framing of front access door. Floor laminate is warped and wall covering missing. Wood is wet to the touch indicating recent wetting. Recommend repair by a qualified RV technician.







(2) Observed deteriorated seals on rear cargo door and evidence of water intrusion inside cargo area. Recommend repair by a qualified RV technician to prevent future water intrusion.

NOTE: Door seal material missing or degraded on all access doors and entrance door.

