

Windshield Type:

Glass with No Frame

Items

3.0 Windshield Condition

Comments: Acceptable

Observed inconsistent sealant application along windshield. No evidence of leakage noted.



Curbside Top Corner Windshield Sealant



Streetside Bottom Corner Sealant

3.1 Windshield Wiper Condition and Operation

Comments: Acceptable

3.2 Rear View Mirrors and Operation

Comments: Acceptable

3.3 Headlight Operation

Comments: Acceptable

4(A) . Front Cap / Wall

Styles & Materials

Exterior Wall Surface Type:

Full Body Paint

Any Damage or Discoloration or Delamination?:

No

Windows:

Glass with No Frame

Access Doors:


Generator Slide Tray

Items


4.0.A Sidewall Condition

Comments: Fair

Observed loose support fasteners between front cap and windshield wiper fairing. Recommend repair by a qualified RV Technician.

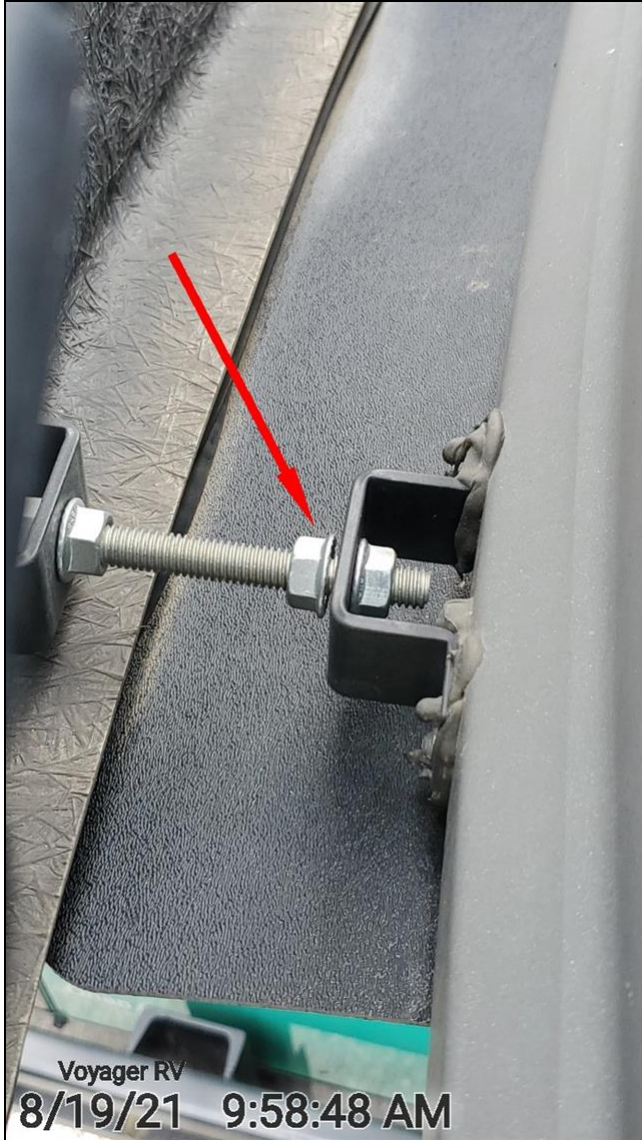

Streetside Support Hardware

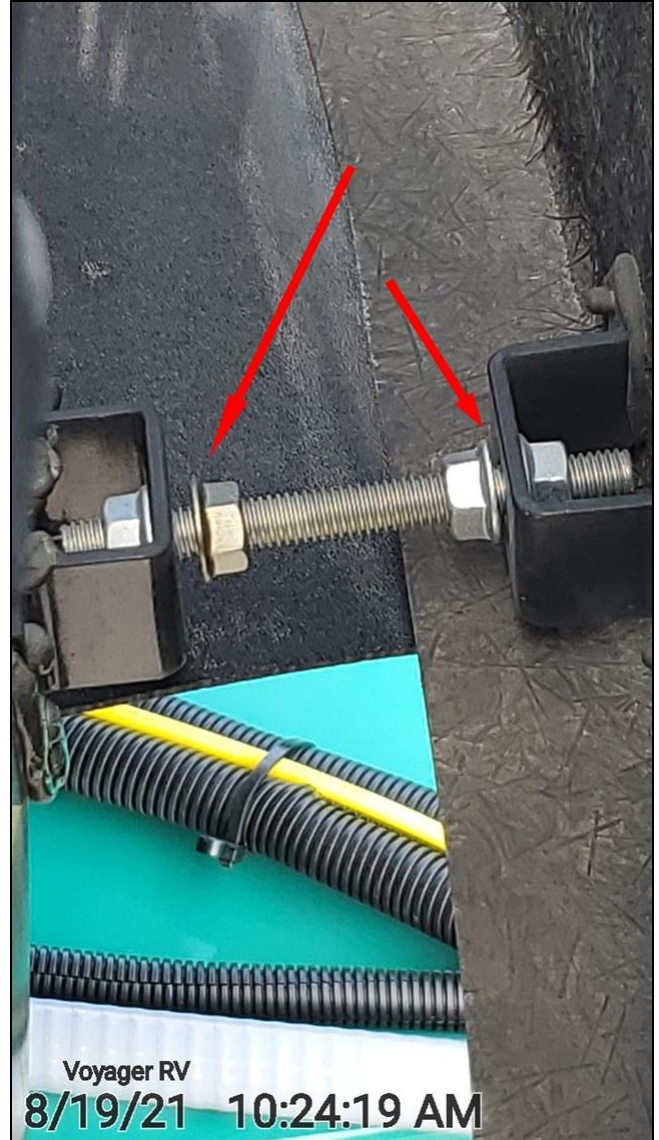

Curbside Support Hardware

4.1.A Paint and Decals

Comments: Acceptable

4.2.A Windows

Comments: Acceptable

4.3.A Cargo/Access Doors

Comments: Fair

Observed contact damage between trim fastener and front cap inside generator slide area below streetside windshield corner. Recommend repair by a qualified Fiberglass Technician to prevent further deterioration.