


## WC "GROUP GRIPPER" OR FULL LENGTH "GROUP GRIPPER" KIT

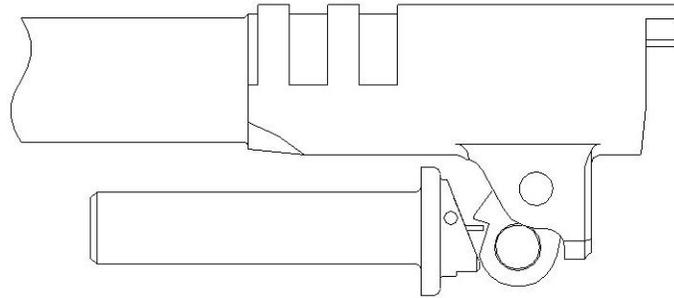

### INSTRUCTIONS:


Replace "COLT" link with "GROUP GRIPPER" link making sure notch on link is facing muzzle end.

IF AFTER INSTALLATION of your Wilson Combat Dwyer "GROUP GRIPPER" kit, you experience failure of your slide from completely going into battery, the following steps should be taken:

First, double check to make sure you have properly installed the kit as per instructions. Next, make sure you have a strong enough recoil spring (it has to be strong enough to overpower the spring in the "GROUP GRIPPER"). If after the first two steps have been completed and you are still having failure to lock up, you will have to remove a small amount of metal off the notch portion of the link (see picture below). Use caution and only remove approximately .002" at a time, then recheck for fit.



Small amount off these two surfaces.

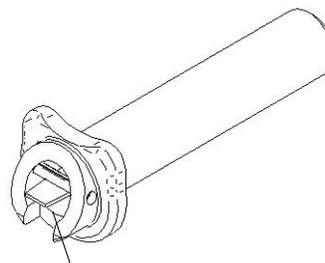

OFF inside radius

If you have a commander, after first checking to see if it will go into battery after relieving metal off the link, you might be required to remove some metal off the back of the group gripper itself (see drawing). Again, use caution to only remove very little metal.