



# Inspection Report

---

sample sample

---

**Property Address:**  
333 Wild Raspberry Lane  
Etowah NC



**Hubert Lowe Home Inspections**

**Hubert Lowe North Carolina # 1602  
4 Deerwood Cir  
Oak Island NC 28465  
Cell 910-279-4728  
Office 910-278-1542**

*Hubert Lowe*



---

## Table of Contents

---

[Cover Page](#)

[Table of Contents](#)

[Intro Page](#)

[1 Structural Components](#)

[2 Exterior](#)

[3 Roofing](#)

[4 Plumbing](#)

[5 Electrical System](#)

[6 Heating](#)

[7 Air Conditioning](#)

[8 Interiors](#)

[9 Insulation and Ventilation](#)

[10 Built-In Kitchen Appliances](#)

[Repair](#)

[Investigate](#)

[Invoice](#)

[Back Page](#)

[Inspection Agreement](#)

<b>Date:</b> 12/19/2007	<b>Time:</b>	<b>Report ID:</b> Sam 1
<b>Property:</b> 333 Wild Raspberry Lane Etowah NC	<b>Customer:</b> sample sample	<b>Real Estate Professional:</b>

### Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

**Inspected (IN)** = I visually observed the item, component or unit *and if no other comments were made* then it appeared to be functioning as intended allowing for normal wear and tear.

**Not Inspected (NI)** = I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

**Not Present (NP)** = This item, component or unit is not in this home or building. Not Present items will be noted only in the Report and will NOT be in the Summary. Please read the entire report and consider items or components that are not present.

**Repair** = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

**Investigate** = refers to a system or component that needs additional investigation by a specialist to determine if repairs are needed.

**In Attendance:**  
Customer and their agent

**Type of building:**  
Single Family (1 story)

**Approximate age of building:**  
Over 25 Years

**Temperature:**  
Over 65

**Weather:**  
Clear

**Ground/Soil surface condition:**  
Dry

**Rain in last 3 days:**  
No

**Water Test:**  
No

**Radon Test:**  
No

# 1. Structural Components

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.



		IN	NI	NP
1.0	<b>FOUNDATIONS, BASEMENTS AND CRAWLSPACES (Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components.)</b>	X		
1.1	<b>WALLS (Structural)</b>	X		
1.2	<b>COLUMNS OR PIERS</b>	X		
1.3	<b>FLOORS (Structural)</b>	X		
1.4	<b>CEILINGS (structural)</b>	X		
1.5	<b>ROOF STRUCTURE AND ATTIC</b>	X		

IN NI NP

IN NI NP

## Styles & Materials

**Foundation:**  
Masonry block

**Method used to observe**

**Crawlspace:**  
Crawled

**Floor Structure:**  
2 X 8  
2 X 10  
Wood joists

**Wall Structure:**  
Wood  
Masonry

**Columns or Piers:**  
Masonry block  
Supporting walls

**Ceiling Structure:**  
2X4

**Roof Structure:**  
Engineered wood trusses  
2 X 4 Rafters  
Plywood

**Roof-Type:**  
Gable


**Method used to observe attic:**  
Walked

**Attic info:**  
Scuttle hole

IN=Inspected, NI=Not Inspected, NP=Not Present

**1.0 (1)** White efflorescence (powder substance) on block wall indicates moisture is in contact with the masonry. This does not necessarily indicate that intrusion will occur. I recommend checking the gutters and the downspout drain lines for proper operation. Also, a water proofing paint could be applied to the interior side of the block if necessary. Efflorescence is found on many homes without water intrusion occurring inside the home. But, it should alert you to the possibility that future steps may be needed.

**(2)** Water signs on cedar wall and trim. Also a mold like substance on carpet at lower level and under stairs. I did not inspect or test for mold and I am unable to determine if water intrusion occurs.

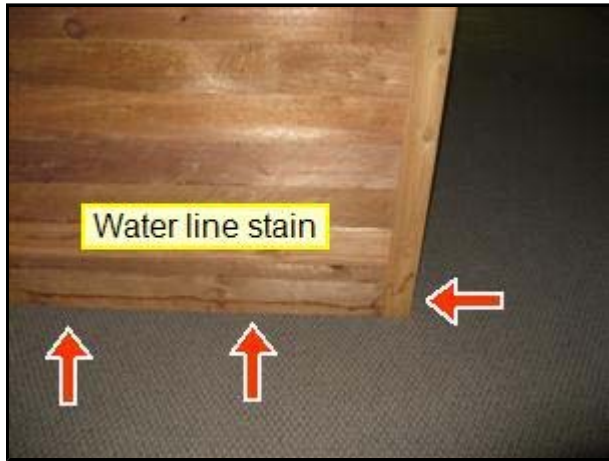

1.0 Picture 1



1.0 Picture 2



1.0 Picture 3




1.0 Picture 4

🔍 (3) Visible signs of water intrusion in the crawlspace (along front of home) are present from dampness along the block wall. I am unable to determine the extent of intrusion or how often it occurs. Cross ventilation may help as the crawls has no ventilation. I recommend further investigation or correction by a qualified licensed contractor or water infiltration specialist. Refer to the diagram as a guide if a drainage system is needed.



1.0 Picture 5 crawlspace under kitchen

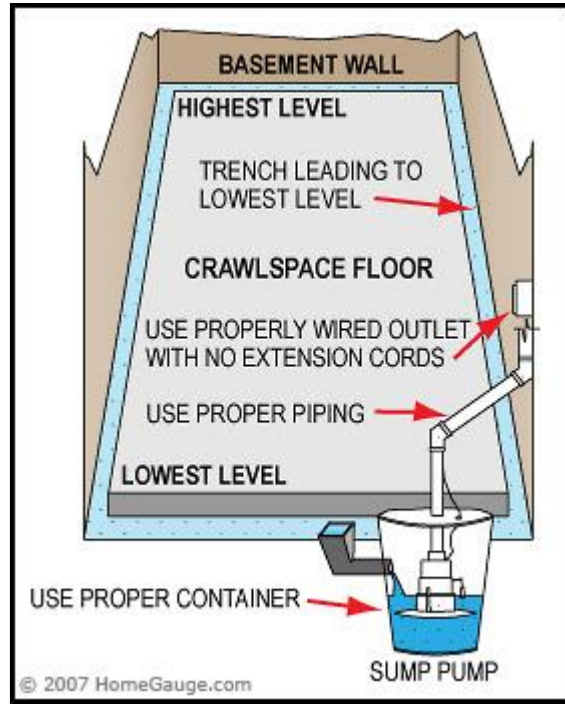


1.0 Picture 6

🔍 **1.1** There is a horizontal crack(s) in the foundation wall at the left side (facing front). These cracks do not appear significant to require repairs at this time. This is my opinion and you should seek a second opinion by a qualified person.



1.1 Picture 1

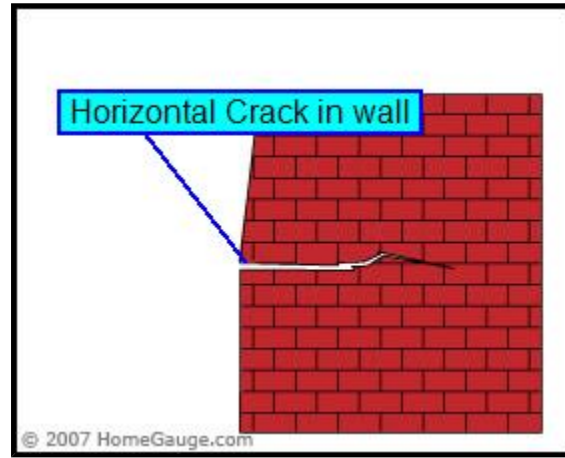

1.1 Picture 2

🔍 **1.5** Leak signs in attic perhaps or likely from the *old roof* as this newer roof appears in tact. I am unable to determine if leak exists due to no recent rain.



1.5 Picture 1



1.5 Picture 2

---

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.



## 2. Exterior



The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

IN NI NP

2.0	WALL CLADDING FLASHING AND TRIM	X		
2.1	DOORS (Exterior)	X		
2.2	WINDOWS	X		
2.3	DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/ COVER AND APPLICABLE RAILINGS	X		
2.4	VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (With respect to their effect on the condition of the building)	X		
2.5	EAVES, SOFFITS AND FASCIAS	X		
2.6	OTHER	X		
2.7	GARAGE DOOR OPERATORS (Report whether or not doors will reverse when met with resistance)	X		

IN NI NP

### Styles & Materials

#### Siding Style:

RB&B (Reverse board and batten)

#### Siding Material:

Wood

#### Exterior Entry

##### Doors:

Wood

##### Appurtenance:

Deck with steps  
Covered porch

##### Driveway:

Concrete

##### Garage Door

##### Type:

Two automatic

##### Garage Door

##### Material:

Compressed board  
Wood

IN=Inspected, NI=Not Inspected, NP=Not Present

2.0 Periodical maintenance caulking needed and recommended to keep water from weeping under siding at concrete shelf. FYI



2.0 Picture 1

**2.1** Patio doors at rear of home are cloudy or seal is broken. Glass panes that have lost their seal (cloudy) can usually be replaced without replacing the entire unit. A qualified contractor should inspect and repair as needed.



2.1 Picture 1


**2.2** The trim stop for fixed pane is weathered and indicates that water may be getting below trim. I recommend a paintable sealant be applied and paint trim.



2.2 Picture 1


**2.3** (1) The step tread on steps on the deck at the rear of home are deteriorated. A repair or replacement is needed. A skilled masonry contractor should perform the work.

A handrail may be needed

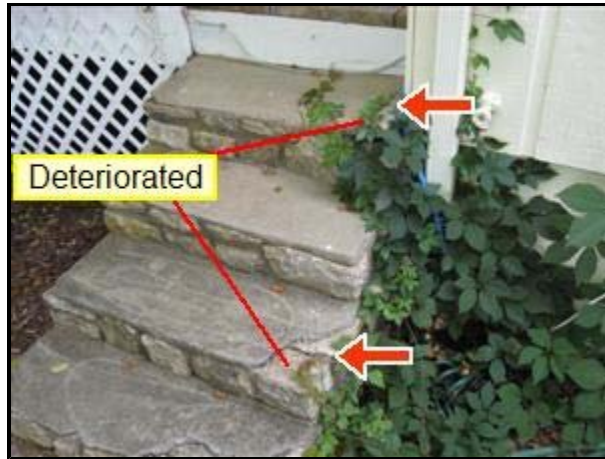

2.3 Picture 1

🔨 (2) The 2x6 decking on the deck at the rear of home has several boards that are deteriorated. A general replacement is likely. A qualified contractor should determine whether a repair or replacement is needed.

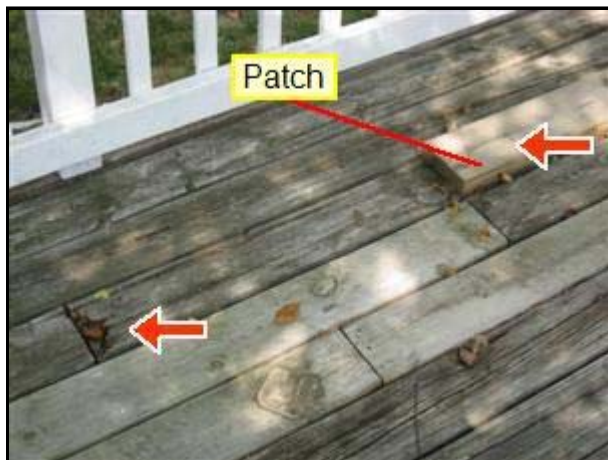

2.3 Picture 2



2.3 Picture 3

🔨 **2.4** The concrete drive at the front of home is pitted in areas and has settlement cracks. Further deterioration can occur if not repaired. A qualified contractor should inspect and repair as needed.



2.4 Picture 1

🔍 **2.6** (1) Old propane tank in ground and is discontinued. I did not determine if gas remains in discontinued tank? I recommend further investigation by a qualified person.



2.6 Picture 1

🔍 (2) There is an odd configuration in ground under addition in crawlspace. This may be an old well? I am unable to determine. I recommend a qualified well drilling company or plumber investigate further to determine if any further action is needed to correct.



2.6 Picture 2 in crawlspace under new addition

🔧 **2.7** The automatic openers for two-door garage at the front of home will not reverse when met with resistance. Doors that will not reverse when met with resistance can kill a child or pet. A qualified contractor should inspect and repair as needed. The sensors are in place for garage door(s) and will reverse the door.

---

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

### 3. Roofing

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.



		IN	NI	NP
3.0	ROOF COVERINGS	X		
3.1	FLASHINGS	X		
3.2	SKYLIGHTS, CHIMNEYS AND ROOF PENETRATIONS	X		
3.3	ROOF DRAINAGE SYSTEMS	X		

IN NI NP

#### Styles & Materials

#### Roof Covering:

Architectural

#### Viewed roof covering from:

Walked roof

#### Sky Light(s):

One

#### Chimney (exterior):

Brick

IN=Inspected, NI=Not Inspected, NP=Not Present

3.0 (1) The tree limbs that are in contact with roof or hanging near roof should be trimmed.



3.0 Picture 1 Rear of home



3.0 Picture 2

(2) Shingles loose under eave at front of home, needs adhesive.



3.0 Picture 3

**3.3** The gutter needs cleaning of debris at the virtually all areas where gutters are installed. Gutters that drain poorly or clogged can lead to many costly problems such as deterioration of fascia, soffit or roof edge. It can also cause gutters to pull loose and lead to possible water intrusion. A qualified person should repair or replace as needed.



3.3 Picture 1

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

## 4. Plumbing

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.



IN NI NP

### Styles & Materials

**Water Source:**

Well

**Water Filters:**

Sediment filter  
(We do not inspect filtration systems)

**Plumbing Water Supply (into home):**

PVC

**Plumbing Water Distribution (inside home):**

Copper  
PEX

**Washer Drain**

**Size:**  
2" Diameter

**Plumbing**

**Waste:**

PVC  
Cast iron

**Water Heater Power Source:**

Electric

**Water Heater Capacity:**

40 Gallon (1-2 people)

**Manufacturer:**

A.O. SMITH

		IN	NI	NP
4.0	PLUMBING DRAIN, WASTE AND VENT SYSTEMS	X		
4.1	PLUMBING WATER SUPPLY AND DISTRIBUTION SYSTEMS AND FIXTURES	X		
4.2	HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS	X		
4.3	MAIN WATER SHUT-OFF DEVICE (Describe location)	X		
4.4	FUEL STORAGE AND DISTRIBUTION SYSTEMS (Interior fuel storage, piping, venting, supports, leaks)	X		
4.5	MAIN FUEL SHUT OFF (Describe Location)	X		
4.6	SUMP PUMP			X

IN NI NP

IN=Inspected, NI=Not Inspected, NP=Not Present

**4.0 (1)** The basket strainer had leaked and corrected itself for the time being at the Kitchen sink. Repairs are needed. A qualified person should repair as necessary.



4.0 Picture 1 Right sink basin

🔧 (2) The tub drain drains slowly under the hall bath. Repairs are needed. A qualified person should repair as necessary.

🔧 **4.1** (1) The control knob leaks at the hall bath. Repairs are needed. A qualified licensed plumber should repair or correct as needed.



4.1 Picture 1 hall bath

🔍 (2) Brown deposits are on the plumbing fixtures which indicates a filter may be needed. Filter in place and appears dirty but I am unable to determine if you need a different or additional filter. I did not test water for bacteria or other. I recommend contacting a water filtration company.





4.1 Picture 2

🔧 (3) I recommend the well head lid be insulated better before winter. FYI




4.1 Picture 3 Well head

🔧 **4.2** The wiring for the water heater missing romex connector. Electrical issues are considered a hazard until repaired. I recommend a licensed electrician correct as necessary.



4.2 Picture 1

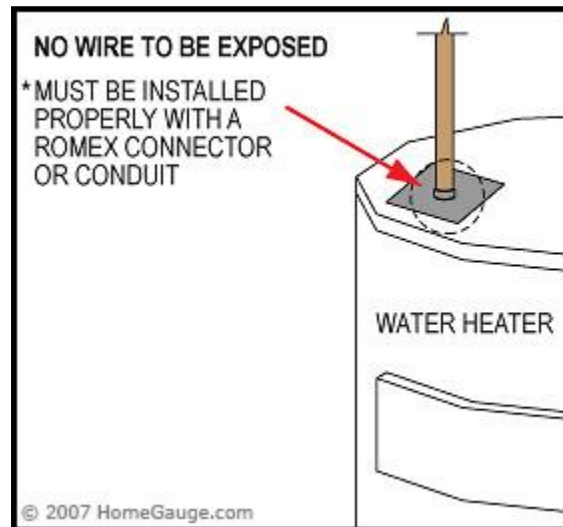

4.2 Picture 2

**4.3** The main shut off is the yellow knob located in the basement at the pressure tank. This is for your information.



4.3 Picture 1 In basement

**4.5** The main fuel shut off is at gas meter outside

---

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

## 5. Electrical System

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.



IN NI NP

		IN	NI	NP
5.0	<b>SERVICE ENTRANCE CONDUCTORS</b>	X		
5.1	<b>SERVICE AND GROUNDING EQUIPMENT, MAIN OVERCURRENT DEVICE, MAIN AND DISTRIBUTION PANELS</b>	X		
5.2	<b>BRANCH CIRCUIT CONDUCTORS, OVERCURRENT DEVICES AND COMPATIBILITY OF THEIR AMPERAGE AND VOLTAGE</b>	X		
5.3	<b>CONNECTED DEVICES AND FIXTURES (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls)</b>	X		
5.4	<b>POLARITY AND GROUNDING OF RECEPTACLES WITHIN 6 FEET OF INTERIOR PLUMBING FIXTURES, AND ALL RECEPTACLES IN GARAGE, CARPORT, EXTERIOR WALLS OF INSPECTED STRUCTURE</b>	X		
5.5	<b>OPERATION OF GFCI (GROUND FAULT CIRCUIT INTERRUPTERS)</b>	X		
5.6	<b>LOCATION OF MAIN AND DISTRIBUTION PANELS</b>	X		
5.7	<b>SMOKE DETECTORS</b>	X		
5.8	<b>CARBON MONOXIDE DETECTORS</b>			X

IN NI NP

### Styles & Materials

#### Electrical Service

##### Conductors:

Below ground

##### Panel capacity:

200 AMP

##### Panel Type:

Circuit breakers

##### Electric Panel

##### Manufacturer:

GENERAL ELECTRIC

##### Branch wire 15

##### and 20 AMP:

Copper


##### Wiring

##### Methods:

Romex

IN=Inspected, NI=Not Inspected, NP=Not Present

**5.3** (1) The wall switch is broken (unsafe) at the upstairs closet for air handler. At least two outlets are broken at LR and entry way. Electrical issues are considered a hazard until repaired. A qualified licensed electrician should perform repairs that involve wiring.

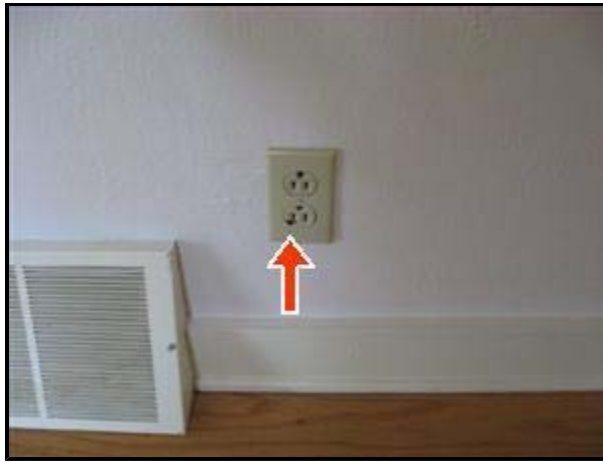

5.3 Picture 1

🔧 (2) Several loose wire ends needs placing inside a box with a cover-plate in the basement at the pressure tank of well. I recommend repair as needed.



5.3 Picture 2



5.3 Picture 3

🔍 (3) Wall switch on ceiling in Garage, purpose unknown



5.3 Picture 4

**5.6** The main panel box is located at the garage.

---

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

## 6. Heating

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.



		IN	NI	NP
6.0	HEATING EQUIPMENT	X		
6.1	NORMAL OPERATING CONTROLS	X		
6.2	AUTOMATIC SAFETY CONTROLS	X		
6.3	DISTRIBUTION SYSTEMS (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)	X		
6.4	PRESENCE OF INSTALLED HEAT SOURCE IN EACH ROOM	X		
6.5	CHIMNEYS, FLUES AND VENTS (for fireplaces, gas water heaters or heat systems)	X		
6.6	SOLID FUEL HEATING DEVICES (Fireplaces, Woodstove)	X		
6.7	GAS/LP FIRELOGS AND FIREPLACES			X

IN NI NP

### Styles & Materials

#### Heat Type:

Heat Pump Forced Air (also provides cool air)

#### Energy Source:

Electric

#### Number of Heat Systems (excluding wood):

Two

#### Ductwork:

Insulated

#### Filter Type:

Disposable

#### Types of

#### Fireplaces:

Conventional

#### Operable

#### Fireplaces:

One


#### Number of

#### Woodstoves:

None

IN NI NP

IN=Inspected, NI=Not Inspected, NP=Not Present


 **6.3** (1) The washable filter is collapsed and needs replacing at upstairs. The filter needs replacing with a rigid frame to prevent filter from falling out of alignment. ( Picture 1 ) The filter in basement ( Picture 2 ) needs replacement and in crawlspace which is difficult to access due to the crawlspace ( Picture 3 ). A qualified person should repair or replace as needed



6.3 Picture 1



6.3 Picture 2

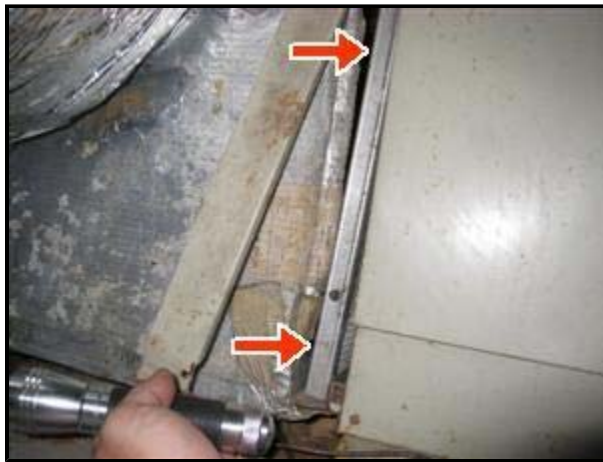

6.3 Picture 3

🔧 (2) The supply duct pipe or main plenum is failing in the crawlspace. Energy loss is occurring in crawlspace and immediate correction is needed. A licensed HVAC contractor should service or repair unit.




6.3 Picture 4 crawlspace new addition




6.3 Picture 5

**6.5** An active birds nest is currently in chimney. It is recommended to install a cap or bonnet on chimney this fall.

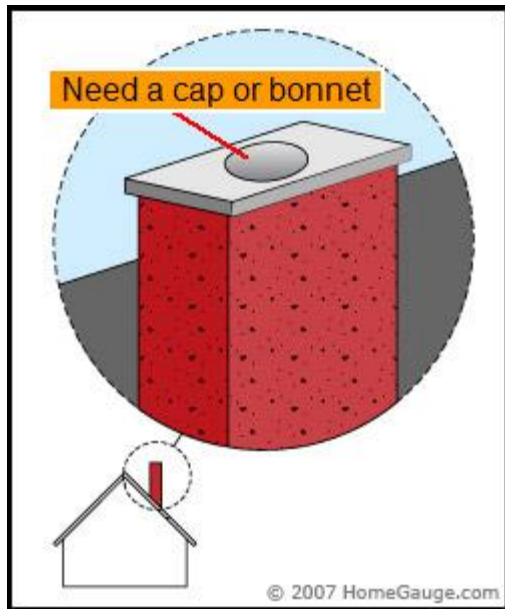

6.5 Picture 1

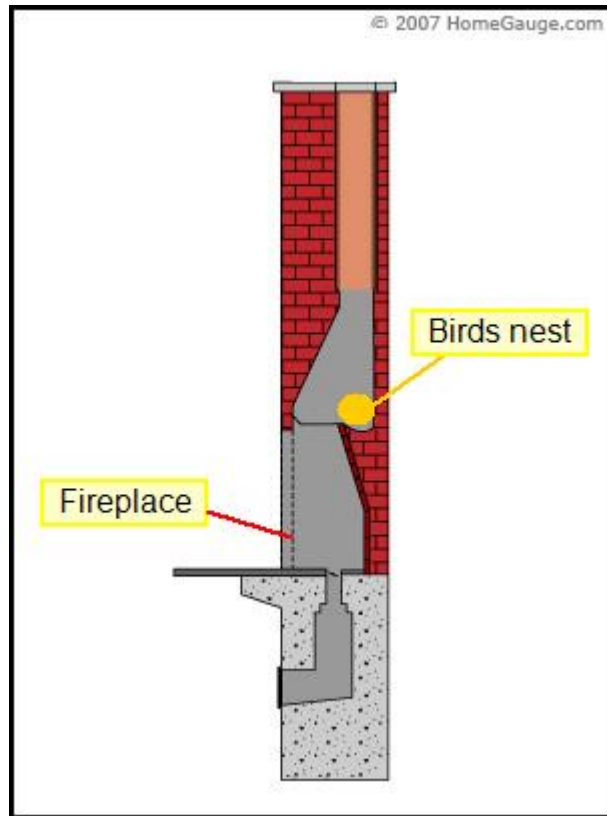

6.5 Picture 2

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.



## 7. Air Conditioning

IN NI NP

### Styles & Materials



		IN	NI	NP
7.0	COOLING AND AIR HANDLER EQUIPMENT	X		
7.1	DISTRIBUTION SYSTEMS (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)	X		
7.2	PRESENCE OF INSTALLED COOLING SOURCE IN EACH ROOM	X		
7.3	NORMAL OPERATING CONTROLS	X		

IN NI NP

### Cooling Equipment Type:

Heat Pump Forced Air (also provides warm air)

### Cooling Equipment Energy Source:

Electricity

### Number of AC Only Units:

Two

IN=Inspected, NI=Not Inspected, NP=Not Present

## 8. Interiors

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.



Dining Room



Kitchen



Living Room



master bath



hall bath

		IN	NI	NP
8.0	CEILINGS	X		
8.1	WALLS	X		
8.2	FLOORS	X		
8.3	STEPS, STAIRWAYS, BALCONIES AND RAILINGS	X		
8.4	COUNTERS AND A REPRESENTATIVE NUMBER OF CABINETS	X		
8.5	DOORS (REPRESENTATIVE NUMBER)	X		
8.6	WINDOWS (REPRESENTATIVE NUMBER)	X		

IN NI NP

**Styles & Materials**

**Ceiling Materials:**  
Sheetrock

**Wall Material:**  
Sheetrock

**Floor Covering (s):**  
Carpet  
Hardwood T&G  
Tile  
Vinyl


**Interior Doors:**  
Hollow core

**Window Types:**  
Double-hung  
Casement

**Cabinetry:**  
Wood  
Veneer


**Countertop:**  
Composite

IN=Inspected, NI=Not Inspected, NP=Not Present

 **8.1** The tissue holder on the wall is damaged at the master bath. I recommend repair as necessary.



8.1 Picture 1

 **8.2** (1) The Baseboard is missing at the upstairs (right of hall bath). Repairs are needed. A qualified contractor should inspect and repair as needed.




8.2 Picture 1

🔧 (2) Tile at shower pan and wall surround are loose and missing mortar or grout and sealer at the upstairs bath. Repairs are needed to prevent water damage to shower/bath. A qualified person should repair or replace as needed.



8.2 Picture 2 Upstairs bath

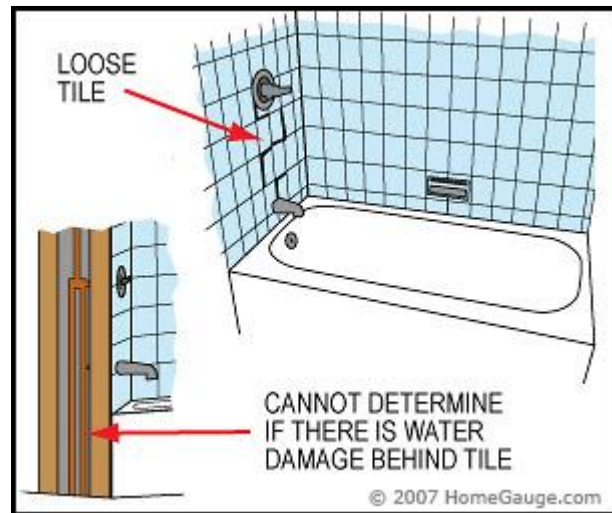

8.2 Picture 3

🔧 **8.6** Four windows will not operate properly and may involve repair to linkage of crank handles and one cloudy (lost seal) at the upstairs Bedroom (right of hall bath) and room left of hall bath and at washer dryer off kitchen. A qualified contractor should inspect and repair as needed.

---

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

## 9. Insulation and Ventilation

The home inspector shall observe: Insulation and vapor retarders in unfinished spaces; Ventilation of attics and foundation areas; Kitchen, bathroom, and laundry venting systems; and the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. The home inspector shall describe: Insulation in unfinished spaces; and Absence of insulation in unfinished space at conditioned surfaces. The home inspector shall: Move insulation where readily visible evidence indicates the need to do so; and Move insulation where chimneys penetrate roofs, where plumbing drain/waste pipes penetrate floors, adjacent to earth filled stoops or porches, and at exterior doors. The home inspector is not required to report on: Concealed insulation and vapor retarders; or Venting equipment that is integral with household appliances.



		IN	NI	NP
9.0	INSULATION IN ATTIC	X		
9.1	INSULATION UNDER FLOOR SYSTEM	X		
9.2	VAPOR RETARDERS (ON GROUND IN CRAWLSPACE OR BASEMENT)	X		
9.3	VENTILATION OF ATTIC AND FOUNDATION AREAS	X		
9.4	VENTING SYSTEMS (Kitchens, baths and laundry)	X		
9.5	VENTILATION FANS AND THERMOSTATIC CONTROLS (ATTIC)	X		

IN NI NP

IN NI NP

### Styles & Materials

#### Attic Insulation:

Fiberglass  
R-19

#### Ventilation:

Gable vents  
Soffit Vents

#### Exhaust Fans:

Fan

#### Dryer Power

#### Source:

220 Electric

#### Dryer Vent:

Flexible Vinyl


#### Floor System

#### Insulation:

Unfaced  
R-19


IN=Inspected, NI=Not Inspected, NP=Not Present

### 9.3 See Foundation notes

 **9.4** The Exhaust fan does not vent to outside at the hall bath and master bath. Vent pipes should terminate outside and not in the attic. Many homes have their vent pipe poised at the roof vent such as yours. It is up to you to determine whether or not this is a concern or needs further consideration from a general contractor. A qualified contractor should inspect and repair as needed.



9.4 Picture 1

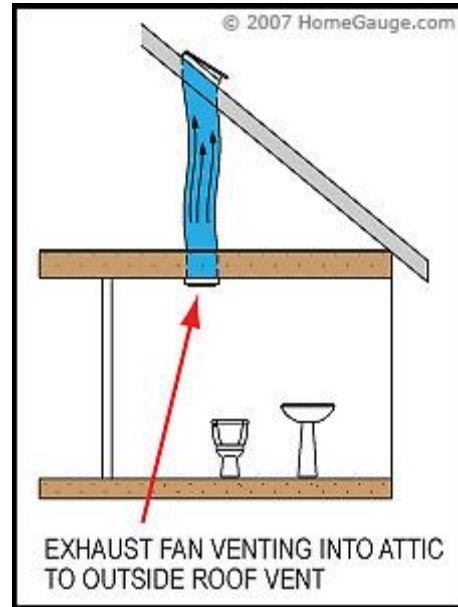

9.4 Picture 2

🔧 9.5 Wall switch for room fan in wall has been removed. It is inoperable.



9.5 Picture 1



9.5 Picture 2

The insulation and ventilation of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Venting of exhaust fans or clothes dryer cannot be fully inspected and bends or obstructions can occur without being accessible or visible (behind wall and ceiling coverings). Only insulation that is visible was inspected. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

## 10. Built-In Kitchen Appliances

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.



		IN	NI	NP
10.0	DISHWASHER	X		
10.1	RANGES/OVENS/COOKTOPS	X		
10.2	RANGE HOOD	X		
10.3	TRASH COMPACTOR			X
10.4	FOOD WASTE DISPOSER	X		
10.5	MICROWAVE COOKING EQUIPMENT	X		

IN NI NP

IN NI NP

### Styles & Materials

#### Dishwasher

##### Brand:

KENMORE

##### Disposer Brand:

IN SINK ERATOR

#### Exhaust/Range hood:

JENN AIR

#### Range/Oven:

JENN AIR

#### Built in

#### Microwave:

KENMORE

IN=Inspected, NI=Not Inspected, NP=Not Present

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Prepared Using HomeGauge <http://www.homegauge.com> SHGI (c) 2000-2008 : Licensed To Hubert Lowe Home Inspections

---

## Repair

---



### Hubert Lowe Home Inspections

4 Deerwood Cir  
Oak Island NC 28465  
Cell 910-279-4728  
Office 910-278-1542

**Customer**  
sample sample

**Address**  
333 Wild Raspberry Lane  
Etowah NC

The following items or discoveries indicate that these systems or components do not function as intended or adversely affects the habitability of the dwelling; or warrants further investigation by a specialist, or requires subsequent observation. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. As used in the Summary, "Repair" refers to a system or component that is not functioning as intended and is in need of Repair or Replacement; and "Investigate" refers to a system or component that needs additional investigation by a specialist to determine if repairs are needed. ***This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.***


---

## 2. Exterior

---


### 2.1 DOORS (Exterior)

#### Inspected

-  Patio doors at rear of home are cloudy or seal is broken. Glass panes that have lost their seal (cloudy) can usually be replaced without replacing the entire unit. A qualified contractor should inspect and repair as needed.

### 2.2 WINDOWS

#### Inspected

-  The trim stop for fixed pane is weathered and indicates that water may be getting below trim. I recommend a paintable sealant be applied and paint trim.

### 2.3 DECKS, BALCONIES, STOOPS, STEPS, AREAWAYS, PORCHES, PATIO/ COVER AND APPLICABLE RAILINGS

#### Inspected






---

## 2. Exterior

---


(1) The step tread on steps on the deck at the rear of home are deteriorated. A repair or replacement is needed. A skilled masonry contractor should perform the work.

A handrail may be needed

 (2) The 2x6 decking on the deck at the rear of home has several boards that are deteriorated. A general replacement is likely. A qualified contractor should determine whether a repair or replacement is needed.


### 2.4 VEGETATION, GRADING, DRAINAGE, DRIVEWAYS, PATIO FLOOR, WALKWAYS AND RETAINING WALLS (With respect to their effect on the condition of the building)

**Inspected**

 The concrete drive at the front of home is pitted in areas and has settlement cracks. Further deterioration can occur if not repaired. A qualified contractor should inspect and repair as needed.

### 2.7 GARAGE DOOR OPERATORS (Report whether or not doors will reverse when met with resistance)

**Inspected**

 The automatic openers for two-door garage at the front of home will not reverse when met with resistance. Doors that will not reverse when met with resistance can kill a child or pet. A qualified contractor should inspect and repair as needed. The sensors are in place for garage door(s) and will reverse the door.


---


## 3. Roofing

---

### 3.0 ROOF COVERINGS


**Inspected**

 (1) The tree limbs that are in contact with roof or hanging near roof should be trimmed.

 (2) Shingles loose under eave at front of home, needs adhesive.

### 3.3 ROOF DRAINAGE SYSTEMS

**Inspected**

 The gutter needs cleaning of debris at the virtually all areas where gutters are installed. Gutters that drain poorly or clogged can lead to many costly problems such as deterioration of fascia, soffit or roof edge. It can also cause gutters to pull loose and lead to possible water intrusion. A qualified person should repair or replace as needed.


---

## 4. Plumbing

---

### 4.0 PLUMBING DRAIN, WASTE AND VENT SYSTEMS

**Inspected**

 (1) The basket strainer had leaked and corrected itself for the time being at the Kitchen sink. Repairs are needed. A qualified person should repair as necessary.

 (2) The tub drain drains slowly under the hall bath. Repairs are needed. A qualified person should repair as necessary.



---

## 4. Plumbing

---


### 4.1 PLUMBING WATER SUPPLY AND DISTRIBUTION SYSTEMS AND FIXTURES

#### Inspected

-  (1) The control knob leaks at the hall bath. Repairs are needed. A qualified licensed plumber should repair or correct as needed.
-  (3) I recommend the well head lid be insulated better before winter. FYI

### 4.2 HOT WATER SYSTEMS, CONTROLS, CHIMNEYS, FLUES AND VENTS

#### Inspected

-  The wiring for the water heater missing romex connector. Electrical issues are considered a hazard until repaired. I recommend a licensed electrician correct as necessary.



---

## 5. Electrical System

---

### 5.3 CONNECTED DEVICES AND FIXTURES (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls)

#### Inspected

-  (1) The wall switch is broken (unsafe) at the upstairs closet for air handler. At least two outlets are broken at LR and entry way. Electrical issues are considered a hazard until repaired. A qualified licensed electrician should perform repairs that involve wiring.
-  (2) Several loose wire ends needs placing inside a box with a cover-plate in the basement at the pressure tank of well. I recommend repair as needed.



---

## 6. Heating

---

### 6.3 DISTRIBUTION SYSTEMS (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)

#### Inspected

-  (1) The washable filter is collapsed and needs replacing at upstairs. The filter needs replacing with a rigid frame to prevent filter from falling out of alignment. ( Picture 1 ) The filter in basement ( Picture 2 ) needs replacement and in crawlspace which is difficult to access due to the crawlspace ( Picture 3 ). A qualified person should repair or replace as needed
-  (2) The supply duct pipe or main plenum is failing in the crawlspace. Energy loss is occurring in crawlspace and immediate correction is needed. A licensed HVAC contractor should service or repair unit.

---

## 8. Interiors

---


### 8.1 WALLS

---

## 8. Interiors



---

### Inspected

-  The tissue holder on the wall is damaged at the master bath. I recommend repair as necessary.


### 8.2 FLOORS

#### Inspected

-  (1) The Baseboard is missing at the upstairs (right of hall bath). Repairs are needed. A qualified contractor should inspect and repair as needed.
-  (2) Tile at shower pan and wall surround are loose and missing mortar or grout and sealer at the upstairs bath. Repairs are needed to prevent water damage to shower/bath. A qualified person should repair or replace as needed.

### 8.6 WINDOWS (REPRESENTATIVE NUMBER)

#### Inspected

-  Four windows will not operate properly and may involve repair to linkage of crank handles and one cloudy (lost seal) at the upstairs Bedroom (right of hall bath) and room left of hall bath and at washer dryer off kitchen. A qualified contractor should inspect and repair as needed.


---

## 9. Insulation and Ventilation

---


### 9.4 VENTING SYSTEMS (Kitchens, baths and laundry)

#### Inspected

-  The Exhaust fan does not vent to outside at the hall bath and master bath. Vent pipes should terminate outside and not in the attic. Many homes have their vent pipe poised at the roof vent such as yours. It is up to you to determine whether or not this is a concern or needs further consideration from a general contractor. A qualified contractor should inspect and repair as needed.

### 9.5 VENTILATION FANS AND THERMOSTATIC CONTROLS (ATTIC)

#### Inspected

-  Wall switch for room fan in wall has been removed. It is inoperable.

---

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since

this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

*Prepared Using HomeGauge <http://www.homegauge.com> SHGI (c) 2000-2008 : Licensed To Hubert Lowe Home Inspectioms*

---

# Investigate

---



## Hubert Lowe Home Inspections

**4 Deerwood Cir  
Oak Island NC 28465  
Cell 910-279-4728  
Office 910-278-1542**

**Customer**  
sample sample

**Address**  
333 Wild Raspberry Lane  
Etowah NC




---

## 1. Structural Components

---


### 1.0 FOUNDATIONS, BASEMENTS AND CRAWLSPACES (Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components.)

#### Inspected

-  (1) White efflorescence (powder substance) on block wall indicates moisture is in contact with the masonry. This does not necessarily indicate that intrusion will occur. I recommend checking the gutters and the downspout drain lines for proper operation. Also, a water proofing paint could be applied to the interior side of the block if necessary. Efflorescence is found on many homes without water intrusion occurring inside the home. But, it should alert you to the possibility that future steps may be needed.
-  (2) Water signs on cedar wall and trim. Also a mold like substance on carpet at lower level and under stairs. I did not inspect or test for mold and I am unable to determine if water intrusion occurs.
-  (3) Visible signs of water intrusion in the crawlspace (along front of home) are present from dampness along the block wall. I am unable to determine the extent of intrusion or how often it occurs. Cross ventilation may help as the crawls has no ventilation. I recommend further investigation or correction by a qualified licensed contractor or water infiltration specialist. Refer to the diagram as a guide if a drainage system is needed.

### 1.1 WALLS (Structural)

#### Inspected

-  There is a horizontal crack(s) in the foundation wall at the left side (facing front). These cracks do not appear significant to

---

## 1. Structural Components

---

require repairs at this time. This is my opinion and you should seek a second opinion by a qualified person.

### 1.5 ROOF STRUCTURE AND ATTIC

#### Inspected

- 🔍 Leak signs in attic perhaps or likely from the *old roof* as this newer roof appears in tact. I am unable to determine if leak exists due to no recent rain.

---

## 2. Exterior

---

### 2.6 OTHER

#### Inspected

- 🔍 (1) Old propane tank in ground and is discontinued. I did not determine if gas remains in discontinued tank? I recommend further investigation by a qualified person.
- 🔍 (2) There is an odd configuration in ground under addition in crawlspace. This may be an old well? I am unable to determine. I recommend a qualified well drilling company or plumber investigate further to determine if any further action is needed to correct.

---

## 4. Plumbing

---

### 4.1 PLUMBING WATER SUPPLY AND DISTRIBUTION SYSTEMS AND FIXTURES

#### Inspected

- 🔍 (2) Brown deposits are on the plumbing fixtures which indicates a filter may be needed. Filter in place and appears dirty but I am unable to determine if you need a different or additional filter. I did not test water for bacteria or other. I recommend contacting a water filtration company.

---

## 5. Electrical System

---

### 5.3 CONNECTED DEVICES AND FIXTURES (Observed from a representative number operation of ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls)

#### Inspected

- 🔍 (3) Wall switch on ceiling in Garage, purpose unknown



# INVOICE

**Hubert Lowe Home Inspections**  
**4 Deerwood Cir**  
**Oak Island NC 28465**  
**Cell 910-279-4728**  
**Office 910-278-1542**  
**Inspected By: Hubert Lowe**

**Inspection Date: 12/19/2007**  
**Report ID: Sam 1**

<b>Customer Info:</b>	<b>Inspection Property:</b>
sample sample  <b>Customer's Real Estate Professional:</b>	333 Wild Raspberry Lane Etowah NC

## Inspection Fee:

<b>Service</b>	<b>Price</b>	<b>Amount</b>	<b>Sub-Total</b>
Full Inspection with a 90 day Home Warranty	325.00	1	325.00

**Tax \$0.00**  
**Total Price \$325.00**

**Payment Method:** At Closing  
**Payment Status:** Invoice Sent  
**Note:**



---

## Hubert Lowe Home Inspections

---

**Hubert Lowe**

**4 Deerwood Cir  
Oak Island NC 28465  
Cell 910-279-4728  
Office 910-278-1542**





**Hubert Lowe Home Inspection**  
4 DEER WOOD CIR  
OAK ISLAND, NC 28465  
910-278-1542 / 910-279-4728  
Real Estate Inspection Contract

Client(s) Name: sample sample

333 Wild Raspberry Lane

Address:

Etowah, NC

Client's Phone

Date of Inspection: 12/19/2007

**Hubert Lowe Home Inspection**, is hereby employed by **Client(s)** to perform a limited visual inspection of apparent conditions in readily accessible areas existing at the time of inspection. Generally accepted professional inspection standards and methods shall be used. **This home inspection is being performed in accordance with the standards of practice of the North Carolina Home Inspector Licensing Board and a copy of these guidelines is available from said Board.** Absolutely no warranties or guarantees are given or implied for any latent or concealed defects. Additionally, any repairs after the inspection may reveal defects that are not accessible at the time of inspection. Hubert Lowe Home Inspection. is not liable for any defects or deficiencies which cannot be reasonably discovered during the limited visual inspection. As part of your home inspection the inspector will inspect and report on the following areas unless that area has been marked for exclusion from our services:

1. **STRUCTURAL COMPONENTS** - including foundation, floors, walls, columns, ceilings, and roofs. **Excluding:**
2. **EXTERIOR OF STRUCTURE** - including wall claddings, entryway doors, decks, steps, eaves, driveways and a representative number of windows. **Excluding:**
3. **ROOFING** - including roof coverings, roof drainage systems, flashing, skylights, and chimneys. **Excluding:**
4. **PLUMBING** - including interior water supply and distribution system, interior drain waste and vent system, hot water system, fuel storage and distribution system, and sump pump. **Excluding:**

5. **ELECTRICAL** - including service entrance conductors, service equipment, main distribution panels, voltage ratings, a representative number of installed ceiling fans, lighting fixtures, switches and receptacles, ground fault circuit interrupters, and smoke detectors.  
**Excluding:**
6. **SYSTEM HEATING** - including permanently installed heating system and its controls, chimneys, heat distribution system, including fans, pumps and ducts, and automatic safety controls. **Excluding:**
7. **CENTRAL AIR CONDITIONING** - including normal operating control of the central air conditioning system and the distribution system.  
**Excluding:**
8. **INTERIOR** - including walls, ceilings, floors, steps, a representative number of cabinets and a representative number of doors and windows.  
**Excluding:**
9. **INSULATION AND VENTILATION** - including insulation vapor barriers, ventilation of attic and foundation, kitchen, bathroom and laundry venting systems, and the operation of any readily accessible attic ventilation fan when temperature permits. **Excluding:**
10. **BUILT-IN KITCHEN APPLIANCES** - including the observation and operation of dishwasher, range, trash compactor, garbage disposal, ventilation equipment, permanently installed oven and microwave oven. **Excluding:**

The price for this inspection with the exclusions identified above shall be \$275 without a warranty \$325 with a warranty PAYMENT is due upon full completion of this inspection.

**EXCLUSIONS AND LIMITATIONS:** The parties acknowledge and agree that this inspection is limited to visual observation of apparent conditions existing at the time of the inspection only. This inspection is not intended to provide the purchaser with information regarding the advisability of this purchase, the market value of the property, the compliance or non-compliance with codes, ordinances and statutes, the suitability of this property for specialized use, the life expectancy of any component or system in the property, the presence or absence of pests or insects, or cosmetic or underground items or items that are not permanently installed. Reference is specifically made to the standards of practice and code of ethics of the North Carolina Home Inspector Licensing Board for a comprehensive listing of those items which are not required and unless

specifically included, will not be part of this inspection.

This inspection report does not address and is not intended to address the possible presence of any danger from any potentially harmful substance and environmental hazards, including but not limited to radon gas, lead paint, asbestos, urea formaldehyde (UFFI), toxic or chemical analysis, airborne hazards, polluted water, or underground oil tanks. Further, Hubert Lowe Home Inspection, is not responsible for any misleading information provided by seller or for any matter concealed or hidden from the inspector.

**ARBITRATION:** Should the client believe that Hubert Lowe Home Inspection, be liable for any issues arising out of this inspection, then client shall communicate said issues in writing to Hubert Lowe Home Inspection, within ten (10) days of the date of inspection. If the issues cannot be resolved between the parties, both parties agree to submit the dispute to binding arbitration in accordance with the rules of the American Arbitration Association. Arbitration is to be conducted by an arbitrator who is a full-time building inspector with a minimum of six (6) years experience as a building inspector. The inspection will be judged in accordance with the North Carolina Standards of Practice and Code of Ethics.

## **ACKNOWLEDGMENT**

This inspection is performed for the sole, confidential and exclusive use and possession of the Client. Neither the contents of this report nor any representation made herein are assignable without the express written permission of Hubert Lowe Home Inspection, and any reliance thereon by any party other than the Client named above is prohibited.

This inspection and report are not intended to be used as a guaranty or warranty, expressed or implied, regarding the adequacy, performance or condition of any inspected structure, item or system and any visual problems observed should be verified with the appropriate contractor, electrician, plumber, or skilled professional for cost estimates and code compliance

**LIMIT OF LIABILITY:** It is understood and agreed that should Hubert Lowe Home Inspection and/or its agents or employees be found liable for any loss or damages resulting from a failure to perform any of its obligations, including but not limited to negligence, breach of contract or otherwise, then the liability of Hubert Lowe Home Inspection, and/or its agents or employees shall be limited to a sum equal to the amount of the fee paid by the client for this inspection and report.

**AGREEMENT:** This contract represents the entire agreement between Hubert Lowe Home Inspection. and the Client. Hubert Lowe Home Inspection is not responsible for the repair, replacement or alteration of any item within or upon the inspected property. The Client acknowledges that they have read and understood the extent and limitations of this inspection and agree to all of the limitations, terms and exclusions contained within this contract.