
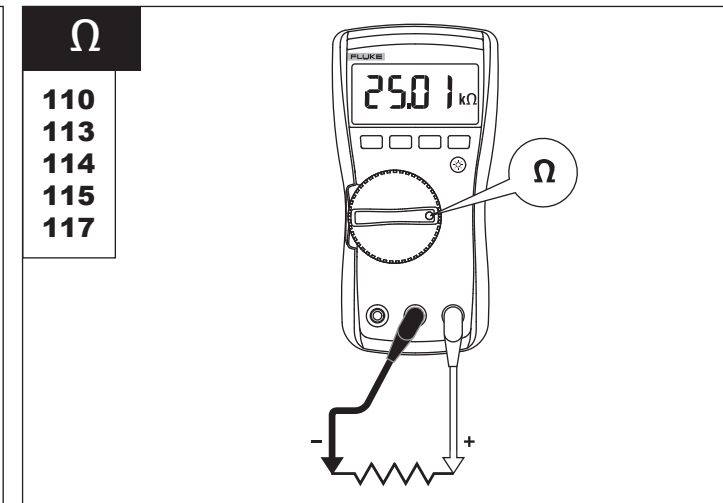
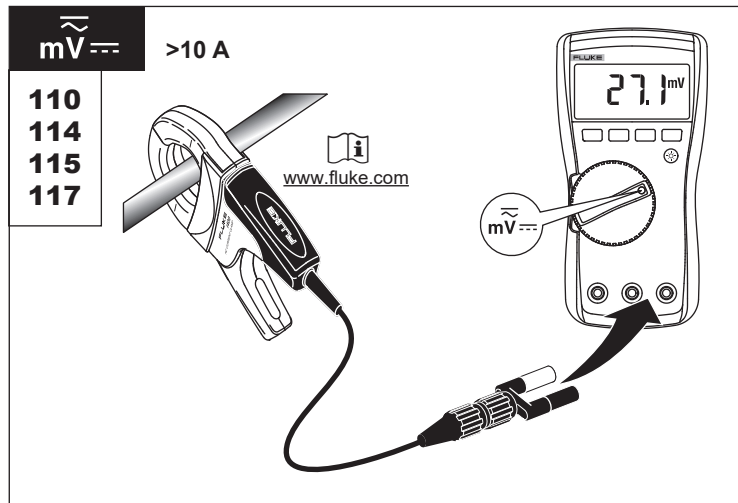
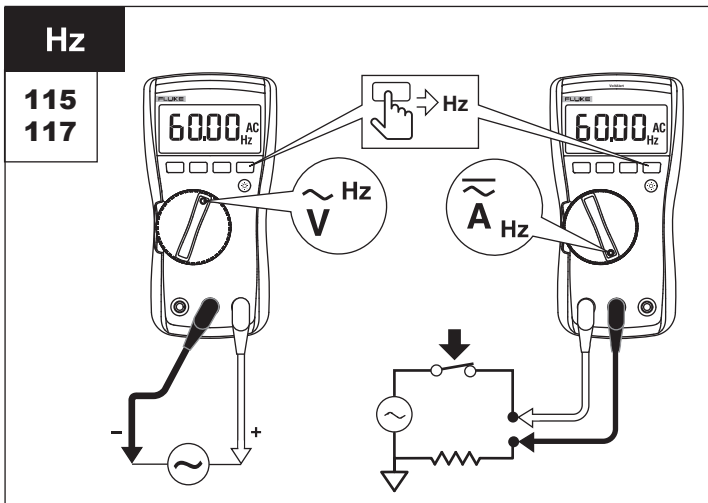
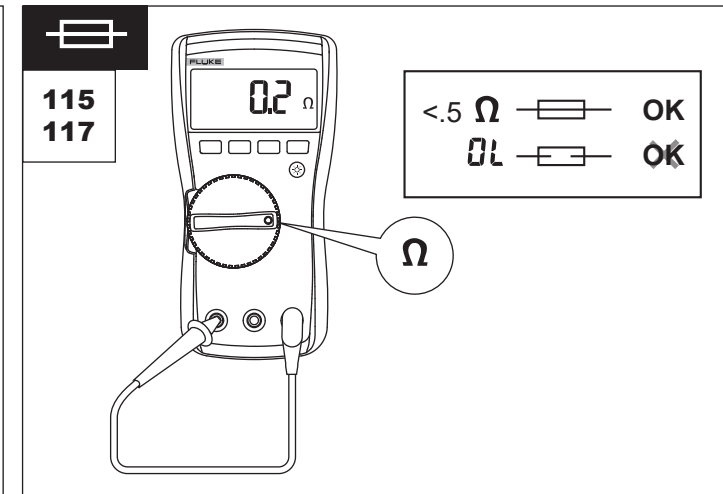
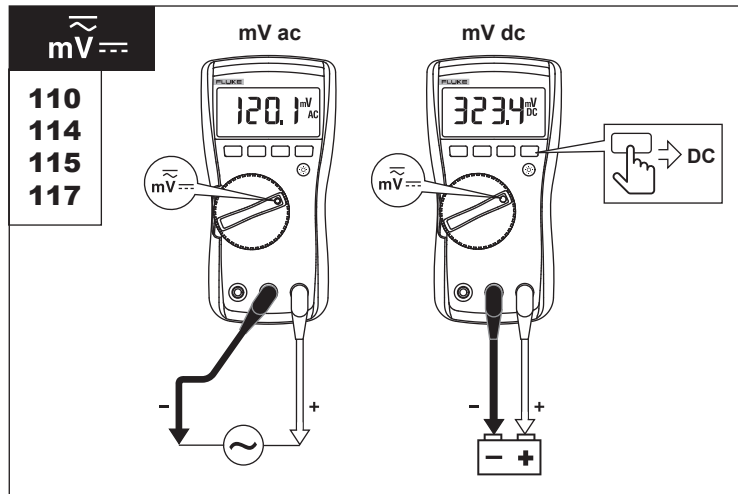
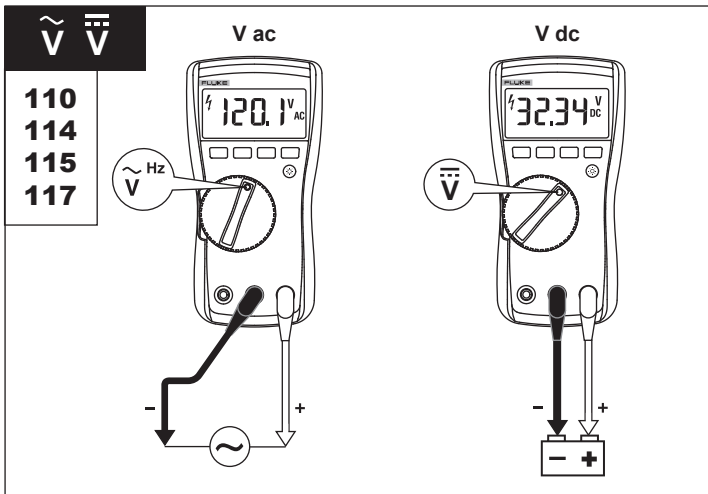


110/113/114/115/117 True-rms Multimeter

  www.fluke.com

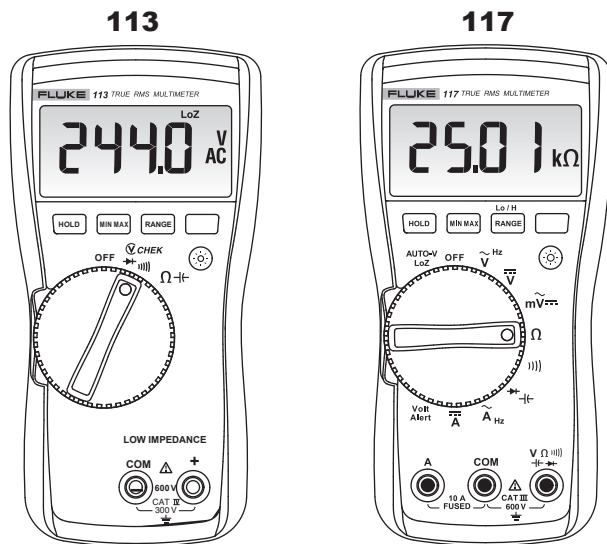

113
115
117

✓

✗

110
113
114
115
117

✓

✗

VoltAlert

117

VoltAlert

RANGE → Lo

115
117

~ A Hz
- A

1

2

3

~ A Hz

- A

110
113
114
115
117

Fuse

CHEK

113

AUTO-V LoZ

114
117

AC = ~
DC = -

CHEK

AUTO-V LoZ

6 V 60 V 600 V

RANGE