



MUV MARKETPLACE SDN BHD (253263-U)

Lot 3, Jalan 6/3, Kawasan Perindustrian Seri Kembangan, 43300 Seri Kembangan, Selangor.
Tel: 03-8947 6888 Fax No: 03-8947 6880

Auction No.

VEHICLE INSPECTION REPORT

Registration Number	VAL8830	Vehicle Location	Seri Kembangan
Vehicle Model	Serena 2.0L CVT H/STAR S-HYBRID	Colour	Purple
Engine Type	Electric/Hybrid	Year Made	2013
Engine Capacity (C.C.)	1997	Mileage (KM)	124114
Gearbox Type	Automatic	Inspection Date	21/01/2020
Type of Usage	Individual Private	Body Type	MPV
Engine Number	MR20474421B	Chassis Number	HFC26166820
Key Set	1		

INSPECTION SUMMARY


Inspection area	Rating	Page	Inspection area	Rating	Page
Exterior	C	2	Gearbox	B	5
Structure	C	3	Undercarriage	B	5
Interior	B	4	Electrical	A	5
Engine	B	4	Flooded Rating	N/A	-

VEHICLE HISTORY


Comments:

Front Moderate Repaired. Rear Minor Repaired.

Structure (Bottom View)

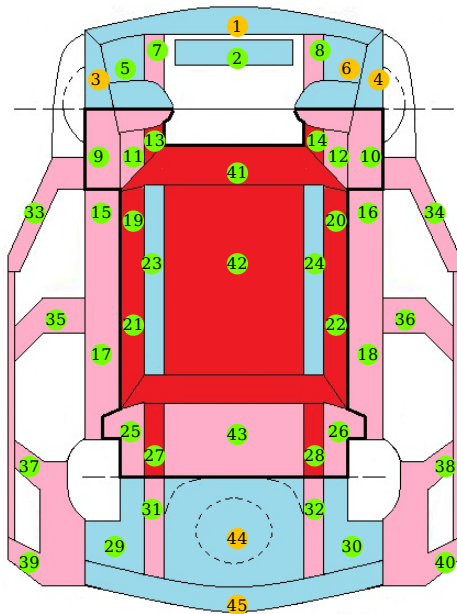

Exterior (Top View)

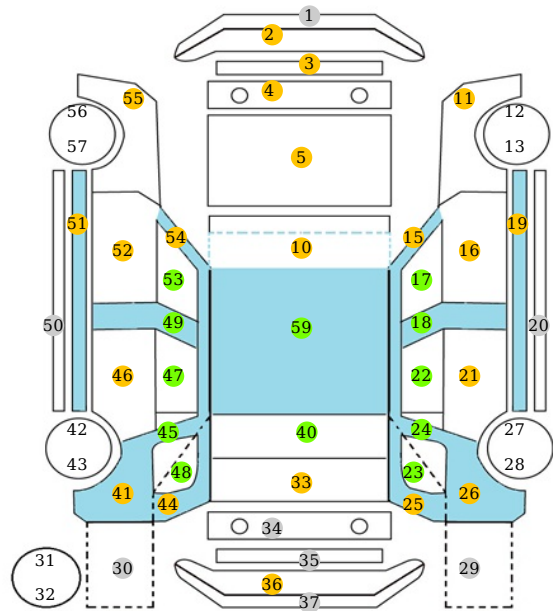

Legend: ● NA ● Defect ● Normal

Disclaimer: Our inspection report are based on what is seen and heard by our inspectors at the time of inspection. We do not guarantee or warranty any physical deterioration or mechanical/technical failures or defects which arise after the date of inspection. No judgement is made to the internal components of engine, transmission, driveline, electrical or any other systems that require dismantling to diagnose. Our inspection report does not cover the authentication of the components or specification of the vehicle. The mileage is reported as per the readings on the odometer and MUV provides no guarantee to the actual mileage of the vehicle.

EXTERIOR

1	Front Skirt	N/A	32	Spare Tyre Brand, Size and Year Make	
2	Front Bumper	Scratched (3cm - 6cm), Replaced	33	Rear Trunk	Dented (below 3cm), Scratched (above 6cm), Repaired
3	Front Reinforcement	Replaced	34	Rear Lighting Panel	N/A
4	Front Grille	Replaced	35	Rear Reinforcement	N/A
5	Front Bonnet	Scratched (below 3cm), Repaired	36	Rear Bumper	Scratched (3cm - 6cm), Replaced
6	Headlamp (Right)	Scratched	37	Rear Skirt	N/A
7	Hazard/Signal Lamp (Right)	Normal	38	Rear Combination Lamp (Right)	Scratched
8	Headlamp (Left)	Scratched	39	Rear Combination Lamp (Left)	Scratched
9	Hazard/Signal Lamp (Left)	Normal	40	Rear Windscreen	Normal
10	Front Windscreen	Broken / Cracked	41	Rear Left Fender	Re-sprayed, Dented (below 3cm)
11	Front Right Fender	Scratched (below 3cm), Replaced	42	Rear Left Tyre Tread	2.6 mm
12	Front Right Tyre Tread	2.5 mm	43	Rear Left Tyre Brand, Size and Year Make	Bridgestone, 195/60R16, 0617
13	Front Right Tyre Brand, Size and Year Make	Bridgestone, 195/60R16	44	Left D-pillar	Re-sprayed, Scratched (below 3cm)
14	Side Mirror (Right)	Scratched	45	Left C-pillar	Normal
15	Right A-pillar	Re-sprayed	46	Rear Left Door	Re-sprayed
16	Front Right Door	Re-sprayed, Dented (below 3cm)	47	Rear Left Door Window	Normal
17	Front Right Door Window	Normal	48	Left Quarter Glass	Normal
18	Right B-pillar	Normal	49	Left B-pillar	Normal
19	Right Side Sill	Scratched (3cm - 6cm)	50	Left Side Skirt	N/A
20	Right Side Skirt	N/A	51	Left Side Sill	Dented (above 6cm), Scratched (above 6cm)
21	Rear Right Door	Scratched (below 3cm), Dented (3cm - 6cm)	52	Front Left Door	Repaired
22	Rear Right Door Window	Normal	53	Front Left Door Window	Normal
23	Right Quarter Glass	Normal	54	Left A-pillar	Scratched (below 3cm)
24	Right C-pillar	Normal	55	Front Left Fender	Scratched (below 3cm), Repaired
25	Right D-pillar	Scratched (below 3cm)	56	Front Left Tyre Tread	2.4 mm
26	Rear Right Fender	Re-sprayed	57	Front Left Tyre Brand, Size and Year Make	Bridgestone, 195/60R16, 1117
27	Rear Right Tyre Tread	2.8 mm	58	Side Mirror (Left)	Scratched
28	Rear Right Tyre Brand, Size and Year Make	Bridgestone, 195/60R16, 0617	59	Roof Top	Normal
29	Rear Right Cargo Panel	N/A	60	Antenna	N/A
30	Rear Left Cargo Panel	N/A	61	Vehicle Paint Condition	

31 Spare Tyre Tread

0 mm

Additional comments:

Front and rear bumper not align. Wheel scratches and repaired. Door moulding loose and repaired. Spare tire not available.

Exterior rating

C

STRUCTURE

1	Upper Radiator Support	Replaced	24	Right Center Rail	Normal
2	Radiator Support	Normal	25	Left Rear Wheel House - inner part	Normal
3	Left Inner Fender - front part	Dented (below 3cm)	26	Right Rear Wheel House - inner part	Normal
4	Right Inner Fender - front part	Rusted & Corrosion, Replaced	27	Left Rear Rail - inner part	Normal
5	Left Apron - front part	Normal	28	Right Rear Rail - inner part	Normal
6	Right Apron - front part	Dented (3cm - 6cm), Repaired, Rusted & Corrosion	29	Left Rear Wheel House - outer part	Normal
7	Left Front Rail - front part	Normal	30	Right Rear Wheel House - outer part	Normal
8	Right Front Rail - front part	Normal	31	Left Rear Rail - outer part	Normal
9	Left Inner Fender - rear part	Normal	32	Right Rear Rail - outer part	Normal
10	Right Inner Fender - rear part	Normal	33	Inner Left A-pillar	Normal
11	Left Apron - rear part	Normal	34	Inner Right A-pillar	Normal
12	Right Apron - rear part	Normal	35	Inner Left B-pillar	Normal
13	Left Front Rail - rear part	Normal	36	Inner Right B-pillar	Normal
14	Right Front Rail - rear part	Normal	37	Inner Left C-pillar	Normal
15	Left Front Inner Rocker - front part	Normal	38	Inner Right C-pillar	Normal
16	Right Front Inner Rocker - front part	Normal	39	Inner Left D-pillar	Normal
17	Left Rear Inner Rocker - rear part	Normal	40	Inner Right D-pillar	Normal
18	Right Rear Inner Rocker - rear part	Normal	41	Front Firewall	Normal
19	Left Front Side Floor Plan	Normal	42	Center Floor Plan	Normal
20	Right Front Side Floor Plan	Normal	43	Rear Floor Plan - inner part	Normal
21	Left Rear Side Floor Plan	Normal	44	Rear Floor Plan - outer part	Dented (below 3cm)
22	Right Rear Side Floor Plan	Normal	45	Rear Panel	Dented (3cm - 6cm), Repaired
23	Left Center Rail	Normal			

Additional comments:

Structure rating

C

INTERIOR

1	Dashboard	Normal	18	Seat Belt (Rear Left)	Normal
2	Audio System	Normal	19	Seat Adjustment (Right)	Manual
3	Navigation	Normal	20	Seat Adjustment (Left)	Manual
4	Speaker (Right)	Normal	21	Seat (Front Right)	Leather,Worn Out
5	Speaker (Left)	Normal	22	Seat (Front Left)	Leather
6	Front Console Box	Scratched	23	Seat (Rear Right)	Leather
7	Floor Console Box	Scratched	24	Seat (Rear Left)	Leather
8	Armrest	Normal	25	Steering Wheel	Worn Out
9	Door Panels (Front)	Scratched	26	Gear Knob / Lever	Normal
10	Door Panels (Rear)	Scratched	27	Central Door Lock (Front Right)	Normal
11	Headrest (Front Right)	Normal	28	Central Door Lock (Front Left)	Normal
12	Headrest (Front Left)	Normal	29	Central Door Lock (Rear Right)	Normal
13	Headrest (Rear Right)	Normal	30	Central Door Lock (Rear Left)	Normal
14	Headrest (Rear Left)	Normal	31	Tonneau Cover	N/A
15	Seat Belt (Front Right)	Normal	32	Sunroof / Moonroof / Convertible Top / Hard Top	N/A
16	Seat Belt (Rear Right)	Normal	33	Immobilizer	Normal
17	Seat Belt (Front Left)	Normal			

Additional comments:

Interior trim and luggage trim scratches and loose. Rear boot trim scratches. Interior dirty. Floor mats and carpet worn out. Roof lining stain mark and worn out.

Interior rating

B

ENGINE

1	Engine Oil	Normal	7	Engine Belting	Worn Out
2	Engine Cooling System	Normal	8	Engine Starting	Normal
3	Battery	Normal	9	Engine Idle Condition	Vibrate
4	Engine Mounting	Cracked	10	Engine Acceleration	Normal
5	A/C System	Normal	11	Engine Running / Temperature	Normal
6	Turbo / Supercharger System	N/A			

Additional comments:

-

Engine rating

B

GEARBOX

1	Gear Oil	Normal	5	Gearbox Shifting (M/T)	N/A
2	Clutch Fluid (Manual Gearbox)	N/A	6	Clutch Operation (M/T)	N/A
3	Gearbox Mounting	Cracked	7	Paddle Shifter / Sport Mode	Normal
4	Gearbox Shifting (A/T)	Normal	8	4WD Operation	N/A

Additional comments:

Gearbox rating

B

UNDERCARRIAGE

1	Shock Absorber /Absorber Mounting (Front)	Normal	6	Steering Rack / Hose	Normal
2	Shock Absorber /Absorber Mounting (Rear)	Normal	7	Transfer Case / Axle Oil	N/A
3	Catalytic Converter	Normal	8	Drive Axle	Normal
4	Exhaust Muffler/Resonator	Normal	9	Fuel Tank	Normal
5	Exhaust Pipe	Normal	10	Brake Operation	Spongy / Judder

Additional comments:

Chassis rating

B

ELECTRICAL

1	Power Windows (Front Right)	Normal	9	Boot	Electric
2	Power Windows (Rear Right)	Normal	10	Parking Sensor	Normal
3	Power Windows (Rear Left)	Normal	11	Camera - Front & Rear	Normal
4	Power Windows (Front Left)	Normal	12	Meters & Gauges	Normal
5	A/C System	Normal	13	Warning light (Gearbox)	N/A
6	Washer	Normal	14	Warning light (Chassis)	Normal
7	Wiper	Normal	15	Warning light (Engine)	Normal
8	Sliding Door	Electric, Left Sliding Door, Right Sliding Door			

Additional comments:

Electrical rating

A

Test drive comments:

