





Raccordi a tasca da saldare - Socket weldings fittings




Mezzi manicotti
Half couplings

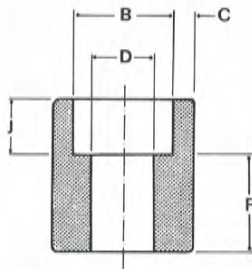


Manicotti
Couplings

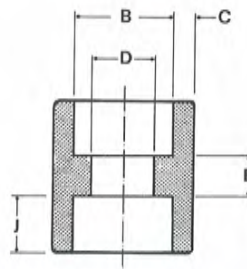

Tappi femmina
Caps

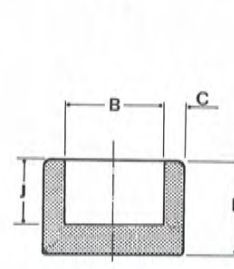

Manicotti ridotti
Reducing couplings

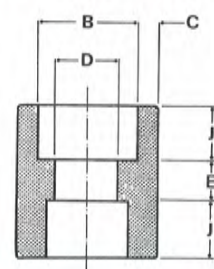

Ø NOMINALE PIPE SIZE		1/8	1/4	3/8	1/2	3/4	1	1 1/4	1 1/2	2	2 1/2	3	4
DIAM. TASCA SOCKET BORE	B MAX.	10.90	14.35	17.80	21.95	27.30	34.05	42.80	48.90	61.35	74.20	90.15	115.80
	MIN.	10.65	14.10	17.55	21.70	27.05	33.80	42.55	48.65	61.10	73.80	89.80	115.45
PROF. TASCA DEPTH SOCKET	J MIN.	10	10	10	10	13	13	13	13	16	16	16	19
3000 LBS	C MAX.	3.20	3.80	4.00	4.65	4.90	5.70	6.05	6.35	6.95	8.75	9.50	10.7
	MIN.	3.20	3.30	3.50	4.10	4.25	5.00	5.30	5.55	6.05	7.65	8.30	9.35
	D MAX.	7.6	10.0	13.3	16.6	21.7	27.4	35.8	41.7	53.5	64.2	79.5	103.8
	MIN.	6.1	8.5	11.8	15.0	20.2	25.9	34.3	40.1	51.7	61.2	76.4	100.7
	E MAX.	8	8	9	13	13	17	17	17	23	24	24	24
MIN.	5	5	5	6	6	9	9	9	15	14	14	14	
F MAX.	17	17	19	24	25	31	32	34	43	45	47	50	
MIN.	15	15	16	21	22	27	28	30	39	40	42	45	
L NOM.		18	18	19	23	26	28	30	32	39	39	45	48
6000 LBS	C MAX.	3.95	4.60	5.05	5.95	6.95	7.90	7.90	8.90	10.90	—	—	—
	MIN.	3.45	4.00	4.35	5.20	6.05	6.95	6.95	7.80	9.50	—	—	—
	D MAX.	4.8	7.1	9.9	12.5	16.3	21.5	30.2	34.7	43.6	—	—	—
	MIN.	3.2	5.6	8.4	11.0	14.8	19.9	28.7	33.2	42.1	—	—	—
	E MAX.	8	8	9	13	13	17	17	17	23	24	24	24
MIN.	5	5	5	6	6	9	9	9	15	14	14	14	
F MAX.	17	17	19	24	25	31	32	34	43	45	47	50	
MIN.	15	15	16	21	22	27	28	30	39	40	42	45	
L NOM.		18	18	19	23	26	28	30	32	39	39	45	48