

Americans with Disabilities Act (ADA)

TRANSITION PLAN

Madison County Council of Governments | Town of Fortville, Indiana

2012 AMERICANS WITH DISABILITIES ACT (ADA)

TRANSITION PLAN

This publication has been prepared in partnership with the Town of Fortville. For clarification or any additional information, please contact the following:

Jerrold Bridges, AICP

Executive Director Madison County Council of Governments 16 East 9th Street, Room 100 Anderson, Indiana 46016 (765) 641.9482

ADA Coordinator

Town of Fortville 714 East Broadway Fortville, Indiana 46040 (317) 485.4044

All information contained herein is expressly the property of the Town of Fortville and the Madison County Council of Governments. Should any or all of this publication be duplicated elsewhere, we request appropriate attribution for such usage.

Prepared by:



Madison County Council of Governments

16 East 9th Street, Room 100 Anderson, Indiana 46016 www.mccog.net

TABLE OF CONTENTS

01

Executive Summary

03

Introduction

03.Legislative Mandate 05.Undue Burden

07

Requirements & Responsibilities

07.Title I Requirements 07.Title II Requirements 12.Public Right-of-Way 13.Public Facilities

15

Methodology

15.Database Methodology

16. Public Facilities

17.Sidewalks

19. Curb Ramps (ADA Ramps)

20.Accessible Pedestrian Signals

21

Self-Evaluation

21. Public Facilities

25. Transition Plan

30.Sidewalks

30. Curb Ramps (ADA Ramps)

32. Accessible Pedestrian Signals

35

Monitoring & Updates

35.Transition Plan Mangement 36.Coordination with Public Improvements & Capital Expansions 37.GIS Data Entry

39

Appendix

39. Definitions

42. Grievance Procedure & Ordinance

47. Program Contacts / ADA Coordinator

48. Public Facilities (Self-Evaluation of Facilities)

66.Inspection Forms


EXECUTIVE SUMMARY

The Americans with Disabilities Act was passed in 1990 as a step toward the disestablishment of discrimination against individuals with disabilities. ADA Title II requires communities to establish self-evaluations and/or transition plans, as determined by community employee size, for updating public facilities. Title II covers programs, activities, and services of government entities with a specific focus on protecting citizens from discrimination on the basis of disability. The goal of this act is to afford every individual the opportunity to benefit from businesses and services and to afford businesses and services the opportunity to benefit from the patronage of all Americans.

Regulations state that structural architectural and communication barriers must be removed in public areas of existing facilities when their removal is readily achievable – in other words, easily accomplished and able to be carried out without unfair difficulty or expense. Public buildings, public parks, sidewalks, curb ramps, and pedestrian signals were assessed in order to

understand what modifications are required. Utilizing ESRI ArcGIS for mobile data collection, each public facility in Fortville was assessed individually. By linking the collection process with ArcGIS, the community has the opportunity to reference and update areas of assessment to monitor facility modifications.

The Town of Fortville has a total of six (6) public facilities, 100,938 feet of sidewalk, 57 curb ramps, and one (1) signalized intersections that were analyzed for this Transition Plan. Chapter Four of this document provides a detailed look into the self-evaluation process and results for each of these facilities. In addition to the information provided in Chapter Four, the Appendix provides a prioritized breakdown of modifications that need to take place for the six (6) public facilities in Fortville. Modification priorities are based on a three (3) tier system of "Low," "Moderate," and "High" - with "High" representing the highest level of priority. The majority of modifications are suggested to be completed within five (5) years.

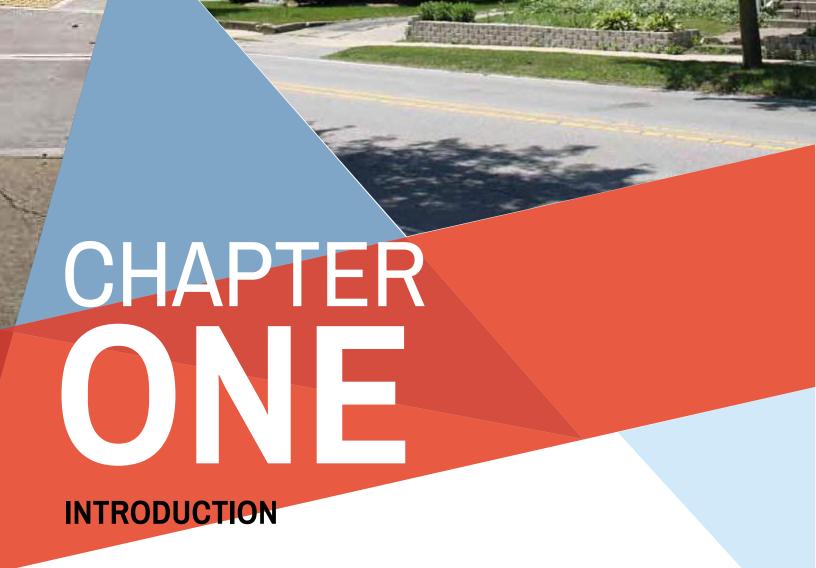

This document outlines the requirements for developing a Transition Plan and describes the process of self-evaluation and the requirements for by which policies, programs and facilities were evaluated for compliance with the Americans with Disabilities Act (ADA); it also provides documentation of that evaluation and provides recommendations for meeting compliance requirements. The Town of Fortville elected officials and staff believe the ability to accommodate disabled persons is essential to good customer service, effective governance and the quality of life that Town of Fortville residents seek to enjoy.

This Transition Plan is being prepared as partial fulfillment of the requirements set forth in Title I and II of ADA; ADA, 28 CFR. Part 35 Sec. 35.105 and Sec. 35.150. This plan will assist the Town of Fortville; it's fiscal council, departments, program directors

and employees in identifying policies, program and physical barriers to accessibility and in developing recommendations to removing the barriers. This plan and certain documents incorporated by reference establish the ADA Self Evaluation and Transition Plan for the Town of Fortville.

Legislative Mandate

ADA is companion legislation to two previous federal statutes and regulations: the Architectural Barriers Acts of 1968 and Section 504 of the Rehabilitation Act of 1973.

The Architectural Barriers Act of 1968 is a Federal law that requires facilities designed, built, altered or leased with Federal funds to be accessible. The Architectural

3

Barriers Act marks one of the first efforts to ensure access to the built environment.

Section 504 of the Rehabilitation Act of 1973 is a Federal law that protects qualified individuals from discrimination based on their disability. The nondiscrimination requirements of the law apply to employers and organizations that receive financial assistance from any Federal department or agency. The development of a Transition Plan is a requirement of the Rehabilitation Act of 1973.

Subsequent to the enactment of the Rehabilitation Act, the federal government enacted the Americans with Disabilities Act (ADA) on July 26, 1990.

- 1. Title I of ADA prohibits discrimination of the basis of a disability for employment.
- 2. Title II of ADA prohibits discrimination by all public entities in access to all programs and services offered by the entity.
- 3. Title III of ADA requires any place of public accommodation be accessible to persons with disabilities.
- 4. Title IV of ADA requires telecommunication companies to ensure functionally equivalent services for consumers with disabilities.
- 5. Title V of ADA covers several technical provisions.

The Town of Fortville is required to observe all requirements of Title I of the ADA in its employment practices; Title II in its policies, programs, and services; any parts of Title IV and V that apply to the Town of Fortville, its programs, services, or facilities; and all requirements for accessibility set forth in the ADA Accessibility Guidelines (ADAAG).

Title II of ADA extended this coverage of Section 504 of the Rehabilitation Act of 1973 to all state and local

government entities, regardless of whether they receive federal funding or not. Specifically, Title II requires local governments to:

- 1. Operate their programs so that, when viewed in their entirety, the programs are accessible to and useable by individuals with disabilities (28 C.F.R. Sec. 35.150).
- 2. Allow persons with a disability to participate in a service, program or activity simply because the person has a disability (28 C.F.R. Sec. 35.130 (a).
- 3. Make reasonable modifications in policies, practices and procedures that deny equal access to individuals with disabilities unless a fundamental alteration in the program would result (28 C.F.R. Sec. 35.130 (b) (7).
- 4. Provide services or benefits to individuals with disabilities through programs that are separate or different unless the separate or different measures are necessary to ensure that benefits and services are equally effective (28 C.F.R. Sec. 35.130(b) (iv) & (d).
- 5. Take appropriate steps to ensure that communications with applicants, participants and members of the public with disabilities are as effective as communications with others (29 C.F.R. Sec. 35.160 (a).
- 6. Designate at least one responsible employee to coordinate ADA compliance (28 CFR § 35.107(a). This person is often referred to as the "ADA Coordinator." The public entity must provide the ADA coordinator's name, office address, and telephone number to all interested individuals (28 CFR § 35.107(a).
- 7. Provide notice of ADA requirements. All public entities, regardless of size, must provide information about the rights and protections of Title II to applicants, participants, beneficiaries,


employees, and other interested persons (28 CFR § 35,106). The notice must include the identification of the employee serving as the ADA coordinator and must provide this information on an ongoing basis (28 CFR § 104.8(a).

8. Establish a grievance procedure. Public entities must adopt and publish grievance procedures providing for prompt and equitable resolution of complaints (28 CFR § 35.107(b). This requirement provides for a timely resolution of all problems or conflicts related to ADA compliance before they escalate to litigation and/or the federal complaint process.

When addressing accessibility needs and requirements, it is important to note that ADA and Title II do not supersede or preempt state or local laws that may offer equivalent or greater protections.

Undue Burden

ADA does not require the Town of Fortville to undertake any action that would result in a fundamental alteration in the intent of its program or activity, would create a hazardous condition, or would represent an undue financial and administrative burden. This determination can only be made by the ADA Coordinator and must be accompanied by a statement citing the reasons for reaching the conclusion. The determination that undue burdens would result must be based on an evaluation of all resources available for use in the programs.

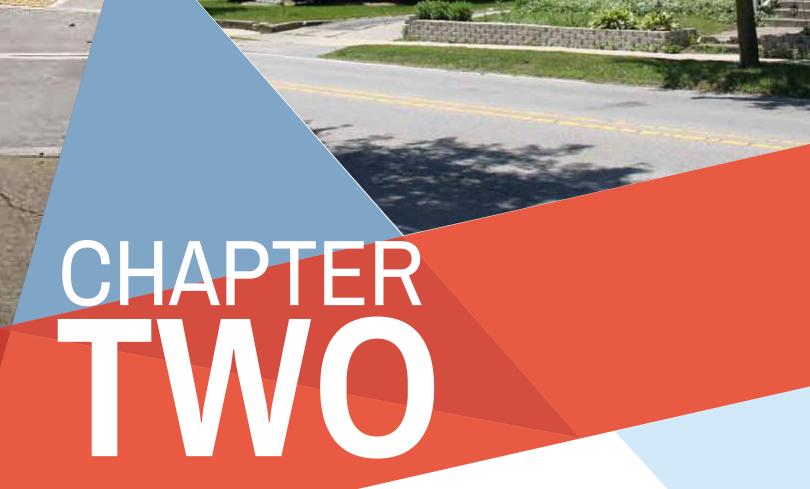

PLAN REQUIREMENTS & RESPONSIBILITIES

Title I Requirements

Title I of ADA prohibits discrimination for employment on the basis of a disability. The Town of Fortville has included the following language in their Employment Manual:

Employment

The Town of Fortville does not discriminate on the basis of disability in its hiring or employment practices and complies with all regulations as outlined by the U.S. Equal Employment Opportunity Commission under Title I of ADA.

Title II Requirements

The ADA requires that public entities modify their policies, practices, and procedures in order to provide an equal opportunity for persons with a disability. Title II specifically requires public entities to identify and evaluate all programs, activities, and services and review all policies, practices, and procedures that govern administration of the programs, activities, and services for all government entities employing more than fifty people. These administrative requirements include:

- 1. Completion of a self-evaluation of programs and facilities;
- 2. Adoption of a set of grievance procedures,
- **3**. Designation of a person who is responsible for overseeing Title II compliance; and

4. Development of a Transition Plan if the self-evaluation identifies any modifications necessary for compliance.

Policies, Practices and Procedures

A public entity shall operate each service, program or activity, when viewed in its entirety, so that it is accessible to and usable by individuals with disabilities. Examples of this may include:

- 1. Assisting in filling out forms.
- 2. Explaining materials or procedures in simpler language so that individuals with cognitive, learning or some psychiatric disabilities can easily understand them.
- 3. Scheduling appointments so a person does not have to wait in a long line or in a crowded and room.
- 4. Allowing a person with a psychiatric disability to apply for services over the phone instead of coming into the office.

The ADA does not require public entities to make all of its existing facilities accessible, nor does it require a public entity to take any action that would fundamentally alter the nature of a service, program, or activity. Also, it does not require implementation of modifications that would result in undue financial and administrative burdens. In such cases where documentation is provided, in keeping with strict procedures outlined in the ADA, there are various methods that may be appropriate for providing program accessibility in lieu of making actual physical changes. These options should be explored in keeping with the 'spirit of the law'.

The first step in determining what policies, practices or procedures are non-compliant is to develop an understanding of the specific public programs and activities occurring at existing facilities within the community. This section describes the programs and activities generally occurring at Town of Fortville facilities.

The following departments Policies and Programs were reviewed:

- 1. Town Council
- 2. Board of Public Works
- 3. Town Clerk-Treasurer
- 4. Police Department
- 5. Fire Department
- 6. Planning Department
- 7. Recreation Services

Each section includes a description of programs and services, locations of operations, practices that facilitate the participation of persons with disabilities in programs and services. Each department is evaluated based upon these criteria, each with recommendations based upon findings for each:

- 1. Customer service
- 2. Notice requirements
- 3. Printed information
- 4. Website
- 5. Communications devices
- 6. Training and staffing
- 7. Program eligibility requirements and admission
- 8. Public meetings
- 9. Emergency evacuation procedures
- 10. Special events and private events on public properties

- 11. Maintenance of accessible programs and ongoing accessibility improvements
- 12. Automated electronic equipment
- 13. Auxiliary aides

Town Council

Town Council members serve as both executive and legislative branches for small communities incorporated within the state. Elected councils work in conjunction with an elected Clerk, who manages the day-to-day business of the municipal government. As an elected official, the Clerk operates independently of the Council, but the Council has final say on budget which Clerks depend upon to operate. The Council can authorize the hiring of other staff to run the operations of government, including law enforcement officers, utility workers, park and recreation employees, and town managers.

- 1. Divisions: administration, staffing, finance (in conjunction with Clerk-Treasurer).
- 2. Programs and Services: approving/rejecting resolutions, approving/rejecting ordinances, appropriating the town budget, supervising employees, executive branch duties, legislative duties, public meetings.

Board of Public Works

The Board of Public Works strives to maintain the infrastructure of the community in a state of quality operation for a safe and healthy environment for all, as well as being accountable to the citizens for financial affairs pertaining to the community under the Board's authority. The Board of Public Works plays a significant role in maintaining the integrity and efficiency of the community.

1. Divisions: street department, utility office, water pollution control, water department,

- engineering department, accounting, maintenance, stormwater, utilities.
- 2. Programs and Services: construction and maintenance of streets, sidewalks, storm drains, traffic signs, landscaping, and water systems, waste water collection and treatment.

Clerk-Treasurer

The Clerk-Treasurer serves as the official record-keeper of the community's legislative body and maintains custody of the official records of the Council. The Clerk is responsible for the certification of ordinances to the appropriate bodies and the certification of current and past Municipal Code sections for court-related testimony. The Clerk-Treasurer keeps the official seal, administers oaths, and takes depositions as necessary.

- 1. Divisions: administration, human resources, and finance (with general services and debt services).
- 2. Programs and Services: budget, agendas and noticing, accounts receivable and account payable, CIP, certification of ordinances, certification of current and past code sections for court-related testimony, and records management.

Police Department

The Police Department is responsible for maintaining social order within the community and providing a safe social environment for the community with carefully prescribed ethical and constitutional restrictions. The department protects the rights of all persons within its jurisdiction to be free from criminal attack, to be secure in their possessions, and to live in peace. The department serves the people by performing the law enforcement function, and it is to these people that the department is ultimately responsible.

9

- 1. Divisions: police administration, police patrol, police communications.
- 2. Programs and Services: house checks, community outreach, community service, booking and holding, interviewing, DUI checks, holiday outreach.

Fire Department

The Fire Department's responsibility is to teach and inform our citizens on fire prevention, to reduce the frequency and severity of fires, respond to water accidents, and hazardous materials incidents within the community. This goal is sought to be accomplished through communication and coordination with mutual aid agencies.

- 1. Divisions: administration, fire and rescue, paramedic, hazardous materials, and arson.
- 2. Programs and Services: fire suppression, emergency medical services (EMS), fire safety education, fire investigations, fire safety inspections, hazardous materials response, and rescue.

Planning Department

The Planning Department formulates community plans and policies on land use, transportation, and historic preservation as a guide for continued growth, protection of quality of life, and economic well-being.

- 1. Divisions: transportation and planning, GIS mapping, downtown development, staffing, administration, code enforcement, current planning, and advance planning.
- 2. Programs and Services: permit processing, business license processing, and economic development.

Parks and Recreation Department

Parks and Recreation Department maintains the Town's public green space. They have an array of facilities with something for everyone. There are natural park areas as well as more active park areas, such as a skate park. Park land has been set aside for sports, recreation, leisure, and reflection. Parks and Recreation has facilities for many uses, located throughout the Town.

- 1. Divisions: administration, staffing, programs, maintenance.
- 2. Programs and Services: facility rentals, special events, and sporting and theatrical events.

Policies, Practices and Procedures offered by the Town of Fortville must be accessible. Accessibility includes advertisement, eligibility, participation, access, transportation, policies, and communication. If a barrier removal is judged unduly burdensome, the Town of Fortville must consider other options for providing access that would ensure that individuals with disabilities receive the benefits and services of the program or activity. In choosing a method of providing program access, the Town of Fortville will give priority to the one that result in the most integrated setting appropriate to encourage interaction among all users, including ones with disabilities. In complying with the requirements of ADA, the Town of Fortville provides equality of opportunity, but does not guarantee equality of results.

It should be noted that this section is not intended to be a self-evaluation. A complete self-evaluation is included in Chapter 4. There should be a priority for removing barriers to provide programmatic access for the public. All facilities of a public entity that provide programs, activities, and services can be ranked based on the following criteria. Each of these criteria has equal importance with no single criteria having priority over another:

- 1. Level of use by the public: facilities that receive a high level of public use
- 2. Social need: facilities that meet social needs such as senior centers, cooling centers, etc.
- 3. Citizen rights: facilities where services are provided to exercise citizen rights such as voting centers, access to elected offices, etc.
- 4. Citizen responsibilities: facilities where fees are paid, where permits, licenses, and services are obtained, and where there is access to services, such as building permits
- 5. Program uniqueness: some programs are unique to a building, facility, or park and cannot occur at another location
- 6. Geographic distribution: by selecting a range of facilities that are distributed throughout the community, it can ensure maximum access for all residents
- 7. Identified complaints: efforts should focus on identified accessibility complaints

Modifications to Policies, Practices and Procedures

The Town of Fortville will make all reasonable modifications to policies and programs to ensure that people with disabilities have an equal opportunity to enjoy all of its programs, services and activities. Anyone who requires an auxiliary aid or service for effective communication, or a modification of policies or procedures to participate in a program, service, or activity of the Town of Fortville should contact the ADA Coordinator. Anyone wishing a modification is requested to contact the ADA Coordinator no later than 48 hours before the scheduled event. ADA does not require the Town of Fortville to take any action that would fundamentally alter the nature of its programs or services, or impose an undue financial or administrative

burden. Complaints that a program, service, or activity of the Town of Fortville is not accessible to persons with disabilities should follow the grievance procedures outlined in (APPENDIX: GRIEVANCE PROCEDURE & ORDINANCE).

The Town of Fortville will not place a surcharge on a particular individual with a disability or any group of individuals with disabilities to cover the cost of providing auxiliary aids/services or reasonable modifications of policy, such as retrieving items from locations that are open to the public but are not accessible to persons who use wheelchairs.

Non-Discrimination Notice

In accordance with the requirements of Title II of the ADA, the Town of Fortville will not discriminate against qualified individuals with disabilities on the basis of the disability in its programs, activities or services.

Communication

According to Section 35.160(a) of the ADA, "a public entity shall take appropriate steps to ensure that communications with applicants, participants, and members of the public with disabilities are as effective as communications with others." This means that the Town of Fortville is required to provide equally effective communication to individuals with disabilities. Equally effective communication can be provided by offering alternative formats, auxiliary aid(s) and/or services upon request. For example, interpreters are hired as requested for the hearing impaired and text materials that are accessible by screen readers are made available to users.

ADA Coordinator

Designation of an ADA Coordinator applies to all state or local government entities with fifty or more employees. The entity is required to appoint a responsible person to coordinate the administrative requirements of the ADA and to respond to complaints filed by the public.

The name and contact information for the responsible person is required to be publicly advertised. Having an ADA Coordinator also benefits state and local government entities. It provides a specific contact person with knowledge and information about the ADA so that questions by staff can be answered efficiently and consistently. In addition, she or he coordinates compliance measures and can be instrumental in ensuring that compliance plans move forward.

The Town of Fortville employee who currently holds the position is listed in (APPENDIX: PROGRAM CONTACTS/ADA COORDINATOR).

Grievance Procedures

Under the Americans with Disabilities Act users of Town of Fortville facilities and services have the right to file a grievance if they believe the Town of Fortville has not provided reasonable accommodation.

The Grievance Procedures adopted by the Town of Fortville can be found in (APPENDIX: GRIEVANCE PROCEDURE & ORDINANCE) of this Transition Plan or on the Town of Fortville website at (www. fortvilleindiana.org). Under the Grievance Procedures, a formal complaint must be filed within 90 calendar days of the alleged occurrence. The Town of Fortville will act or respond only to complaints made through the grievance process identified in (APPENDIX: GRIEVANCE PROCEDURE & ORDINANCE).

Public Right of Way

The Department of Justice's Title II Technical Assistance Manual points out that a public entity's programs related to streets, sidewalks, and curb ramps may be prioritized with respect to relative importance and frequency of usage. It further describes that program accessibility would not require all streets, sidewalks, and curb ramps to be fully accessible as required by current codes. A determination of what public rights-

of-way are programmatically required to be accessible may vary from jurisdiction to jurisdiction. The activity of using the public right-of-way may be considered a program in three different ways:


- 1. Streets, sidewalks and curb ramps may be part of a continuous path of travel between activities or programs, at various public and private facilities located on adjacent properties, such as public offices, schools, parks and recreational facilities, public service agencies, hospitals and health clinics, police facilities, and public housing uses.
- 2. Streets, sidewalks, and curb ramps may themselves represent a program of public pedestrian activities that are essential to the usage and enjoyment of a County's built environment.
- 3. Accessible Pedestrian Signals (APS) required in the public right-of-way for people with disabilities. Access to traffic and signal information is an important feature of accessible sidewalks and street crossings forpedestrians who have vision impairments. While most intersections pose little difficulty for independent travelerswho are blind or have low vision, there are some situations inwhich the information provided by an accessible pedestriansignal is necessary for independent and safe crossing. PROWAG (Proposed Accessibility Guidelines for Pedestrian Facilities in the Public Right-of-Way) incorporate the 2009 Manual on Uniform Traffic Control Devices (MUTCD) specifications regarding APS standards by reference. The APS needs to be both audible and vibrating surfaces.

Sidewalk and curbs constructed as part of planned development, sidewalk and curbs replaced by or for the Town of Fortville, or sidewalk and curbs replaced by or for a property owner through the Town of Fortville shall be constructed in accordance with the most current PROWAG regulations and standards.

Public Facilities

The Town of Fortville owns numerous buildings throughout the Town of Fortville. The Town of Fortville has identified 6 facilitiess that are routinely accessed by the public. These buildings are in varying states of compliance. The buildings have been divided into two categories; Priority One and Priority Two. Priority One buildings are those buildings that have employee use and a high potential for public use. Priority Two buildings are those buildings that employees use and have moderate potential for public use. A complete Self-Evaluation of all Town of Fortville facilities has been completed and is included in Chapter 4.

All Town of Fortville owned buildings that are constructed, remodeled or updated shall be constructed in accordance with the most current ADAAG (Accessibility Guidelines for Buildings and Facilities) regulations and standards.

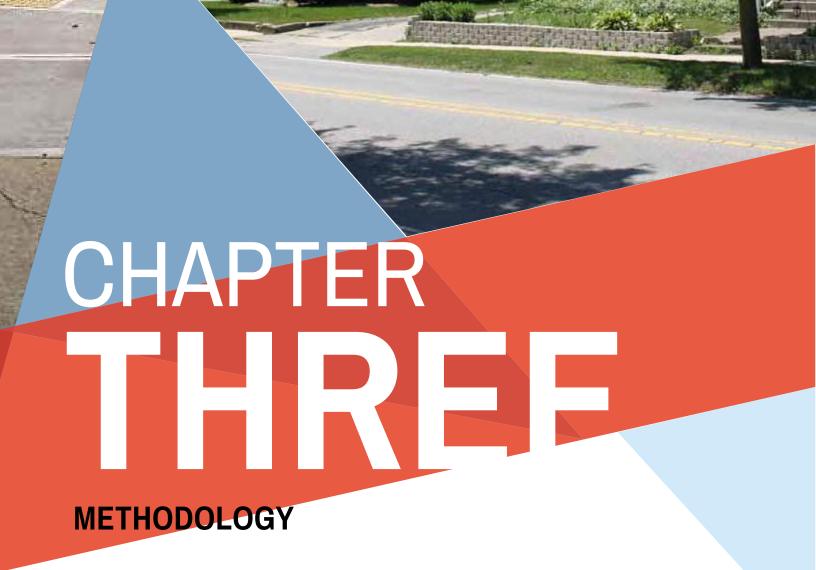

Database Methodology

According to the Americans with Disabilities Act, towns and cities are required to perform a self-evaluation to determine their level of compliance to ADA federal regulations by December 31, 2012. While first person observation is the most effective method for data collection, it is an intensive, time-consuming process. In an attempt to increase efficiency while maintaining efficacy, the process was stream-lined through the creation of an ESRI ArcGIS database that allows instantaneous updating during on-site observation through the use of an iPad.

By linking the database to ArcGIS, data collection and data entry become a single step which allows more time for data analysis. However, the initial data collection phase still requires first hand observation and measurement recordings of public facilities. The database was developed based on the specific requirements of the Americans with Disabilities Act Accessibility Guidelines (ADAAG), as well as the more stringent, Proposed Right-of-Way Accessibility Guidelines (PROWAG). Each public facility must adhere to the same ADA requirements, but within each public facility are various locations that must be thoroughly examined, including, but not limited to, parking lots, on-street parking spaces, sidewalks, ramps, entrances, doors, floors, and restrooms.

The database therefore, is organized based on the path that is taken in order to fully access the facility – from parking to actually taking part in a program within the facility. While some regulations require specific measurements, simply providing some necessities such as accessible entrances satisfies a number of

requirements. Each requirement then was distributed into a specific category to be assessed based on the primary focus. For example, the ramp category includes questions such as 'is a wheelchair ramp necessary for access' and measurements such as 'what is the ramp slope.'

Beyond data collection, the analysis focuses on examining the data to determine the precise requirements that are not being met so funds can be allocated as necessary to upgrade each facility. The master database allowed analysis for every possible result. Further, future data collection can utilize the same database to build from existing conditions and illustrate improvement over time. By updating the database as facilities change over time, the data remains dynamic. Standards for accessibility continue to evolve, as evident in the differences between the PROWAG and ADAAG, and this database format aims to provide a way the data can be easily accessed and updated.

Public Facilities

Included in the required self-evaluation is the assessment of public facilities within the town. For the purposes of this evaluation, the term public facility can be used for either a public building or a public park. The public facilities within Fortville were assessed utilizing first-person observation and iPad mobile data collection as previously explained.

Prior to facility visits and first person observation, surveyors were familiarized with ADA regulations and trained in the use of data collection equipment. Actual data collection consisted of two to four observers surveying each public facility. However, with the number of requirements that must be assessed, to best increase data collection efficiency and result efficacy, each surveyor specialized in the examination of two or three specific categories such as parking lots and onstreet parking spaces.

Facility design is characterized by the elements that affect usability and accessibility:

- Parking (lot and on-street)
- Accessible entrance
- Entrance
- Access to services
- Floors
- Doors
- Visual characteristics
- Seats, tables, and counters
- Lavatories (drinking fountains and sinks)
- Restrooms

Parking

Each facility is required to have designated handicapped parking; either in a main parking lot or on-street parking. Requirements include at least one van accessible parking space per facility and at least one accessible parking space per 25 total parking spaces.

Accessible Entrance

The term accessible entrance refers to the path from an accessible parking space to the facility entrance. The entrance must be accessible by a sturdy pathway at least four feet wide with curb cuts at least 32 inches wide.

Entrance

Each facility is required to have at least one entrance that is fully compliant. Although the main entrance is recommended for compliance, the accessible entrance can be independent.

Access to Services

The entrance must provide a direct path to the main floor, lobby, or elevator, as well as all public spaces. This direct path provides the necessary access to the various services provided within the facility. Within buildings, access to services refers to hallway connectivity, while access to services in parks refers to the availability of paths linking to the various park amenities.

Floors

The floor assessment includes examining stairwells, thresholds, carpets, and the height of reach for items such as elevator and automated entrance buttons. Each of these components establishes the basic understanding of pathway obstructions that impede mobility within the public facility.

Doors

Doors throughout public facilities are an obstacle that must not inhibit access to services and programs. They must provide adequate clearance and the ability to open with little effort. It is important to note that doors are a hindrance to several types of disabilities and are required to meet high standards.

Visual Characteristics

Signage placed throughout a facility is required to be readable from a distance, as well as offering the opportunity to read braille. Signage within a facility provides direction and is necessary for permitting direct access.

Seats, Tables, and Counters

Seats, tables, and counters must allow movement between aisles and the opportunity to interact with public offices/employees. It is especially necessary for seats, tables, and counters to provide equal access during public meetings, since all residents must have an equal say in the public process.

Lavatories

Lavatories include both sinks and drinking fountains. Although the specific measurement requirements vary slightly, sinks and drinking fountains provide a similar service. It is necessary that each be provided equally within a public facility to avoid discrimination. Assessment areas include the sink height and depth, apron height, and knee clearance.

Restrooms

If publicrestrooms are available, at least one must be ADA compliant to allow equal opportunities within the facility. The restroom assesses aspects such as the stall widths, signage, entrance, and maneuverability.

Sidewalks

The ADA Accessibility Guidelines for Buildings and Facilities (ADAAG) is the national standards for pedestrian access and travel. ADAAG provides the minimum standards for all public and private facilities. Sidewalk design is characterized by the elements that affect usability and accessibility:

- Grade
- Cross-Slope
- Width
- Passing Space
- Vertical Clearance
- Changes in Level
- Grates and Gaps
- Obstacles
- Surface

Grade

Grade is the slope parallel to the direction of travel. The grade is calculated by dividing the vertical change in elevation by the horizontal distance covered. In the pedestrian environment, maximum grade should be measured over 24-inch intervals. These intervals represent the approximate length of a wheelchair wheelbase or a single walking pace. Steep sections should be detected and reduced as much as possible.

Cross-Slope

Cross-slope is measured perpendicular to the direction of travel. Most sidewalks are built with some degree of cross-slope to prevent water from collecting on the path by allowing the water to drain into the street.

Width

Sidewalk widths affect pedestrian usability and determine the types of access and other pedestrian elements that can be installed. Although most guidelines require sidewalk design width to be at least five feet wide, larger design widths can accommodate more pedestrians and improve access, especially if the sidewalks contain trash receptacles, street trees, street furniture, and the like.

Passing Space

Passing space is a section of path wide enough to allow two wheelchair users to pass one another or travel abreast. The passing space provided should also be designed to allow one wheelchair user to turn in a complete circle. If turning or maneuvering is necessary, a turning space of five square feet shall be provided.

Vertical Clearance

Vertical clearance is the minimum unobstructed vertical passage space required along a sidewalk. The AADAG states that circulation spaces such as corridors should have at least 80 inches of headroom.

Changes in Level

In the sidewalk environment, curbs without curb ramps, cracks, and dislocations in the surface material are common examples of changes in level. Changes in level can cause ambulatory pedestrians to trip or can catch the casters of a wheelchair, causing the chair to come to an abrupt stop. People who are blind or have poor vision might not anticipate changes in level.

Grates and Gaps

A grate is a framework of latticed or parallel bars that prevents large objects from falling through a drainage inlet but still allows water and some debris to fall through. A gap is a single channel embedded in the travel surface of a path. The ADAAG specifies that grates located in walking surfaces should have spaces no greater than 0.5 inches wide in one direction. It also states that gratings with elongated openings should be oriented so that the long dimension is perpendicular to the dominant direction of travel.

Obstacles

Obstacles in the pedestrian environment can limit the vertical passage space, interfere with the circulation route, or reduce the clearance width of the sidewalk. Some of the more common objects that can make a sidewalk difficult to traverse include: fire hydrants, mailboxes, parking meters, planters, signs and poles, street furniture, and trash receptacles.

Surface

The surface is the material on which a person walks or wheels in the pedestrian environment. Firm and stable surfaces, such as concrete, resist deformation especially by indentation or the movement of objects. A broom finish is used on many concrete sidewalks to provide sufficient slip resistance for pedestrians.

Curb Ramps (ADA Ramps)

Curb ramps are most commonly found at intersections, but they may also be used at midblock crossings and medians. Curb ramps should be designed to minimize the grade, cross-slope, and changes in level experienced by users. Each type of curb ramp contains some or all of the following elements:

Landing

The landing is the level area of sidewalk at the top of a curb ramp facing the ramp path. Curb ramps without landings force wheelchair users entering the ramp from the street to travel on the ramp flares. The landing should be a surface at least three feet wide. The ADAAG recommends a four foot landing for perpendicular curb ramps and a five foot landing for parallel curb ramps.

Approach

The approach is the section of the accessible route flanking the landing of a curb ramp.

Flare

The flare is the sloped transition between the curb ramp and the sidewalk. The path along the flare has a significant cross-slope and is not considered an accessible path of travel.

Ramp

The ramp is the sloped transition between the street and the sidewalk where the grade is constant and the cross-slope is at a minimum – preferably less than 2 percent.

Gutter

The gutter is a trough or dip used for drainage purposes that runs along the edge of the street and the curb or curb ramp. According to the ADAAG, the slope of the road or gutter surface immediately adjacent to the curb ramp should not exceed five percent, and the transition between ramp and gutter should be smooth.

Curb ramps can be configured in a variety of patterns depending on the location, type of street and existing design constraints. The four most common configurations are as follows:

Perpendicular

These ramps are often installed in pairs at a corner. For new construction, two perpendicular curb ramps with level landings should be provided at street crossings. The path of travel along a perpendicular curb ramp is oriented at a 90-degree angle to the curb face.

Diagonal

Diagonal curb ramps are single curb ramps installed at the apex of a corner. They force pedestrians ascending the ramp to proceed into the intersection before turning to the left or right to cross the street. In many situations, diagonal curb ramps are less costly to install, but they create potential safety and mobility problems for pedestrians

Parallel

The path of travel along a parallel curb ramp is a continuation of the sidewalk, as parallel curb ramps provide an accessible transition to the street on narrow sidewalks. The landing on parallel curb ramps should be sloped no more than 2 percent toward the gutter.

Built-Up

Built-Up curb ramps are oriented in the same direction as perpendicular curb ramps, but project out form the curb. They are most often installed in parking lots, and should not extend into a vehicular traffic lane or bike lane.


Accessible Pedestrian Signals

Each signalized intersection in the Town of Fortville was visited and the intersection's pedestrian amenities such as sidewalks, curb ramps, crosswalks, and pedestrian signals were recorded in GIS. If pedestrian signals were in place, additional data specific to the pedestrian signals was collected. The height of pedestrian signal pushbuttons was measured using a tape measure. The length of time given for pedestrians to cross the street was either displayed on the pedestrian signals or was measured by the data collector.

To determine whether or not the time allotted for pedestrians to cross the street was adequate, the width of the roadway was measured in feet using a distance measuring tool in Pictometry, a computer-based orthophotography program. The length of time pedestrians were allotted to cross the street was divided by the width of the roadway where the pedestrian

crossings were located. The Americans with Disabilities Act suggests that pedestrian walking speed should be assumed at 3.5 feet per second. If the signalized time required the pedestrian to walk at a pace of 3.1 to 3.9 feet per second, it was suggested that the pedestrian signal time be increased slightly. If the signalized time required the pedestrian to walk at a pace of 4.0 feet per second or more, ADA requires that the pedestrian signal time be increased significantly.

At all signalized intersections not located in rural areas, it is recommended that sidewalks, curb ramps, and crosswalks be installed if they are not already in place. At all actuated or semi-actuated intersections, it is suggested that pedestrian signals with pushbuttons be installed if not already in place. Pushbuttons are not recommended for installation at intersections that are timed due to the disruption of traffic flow.

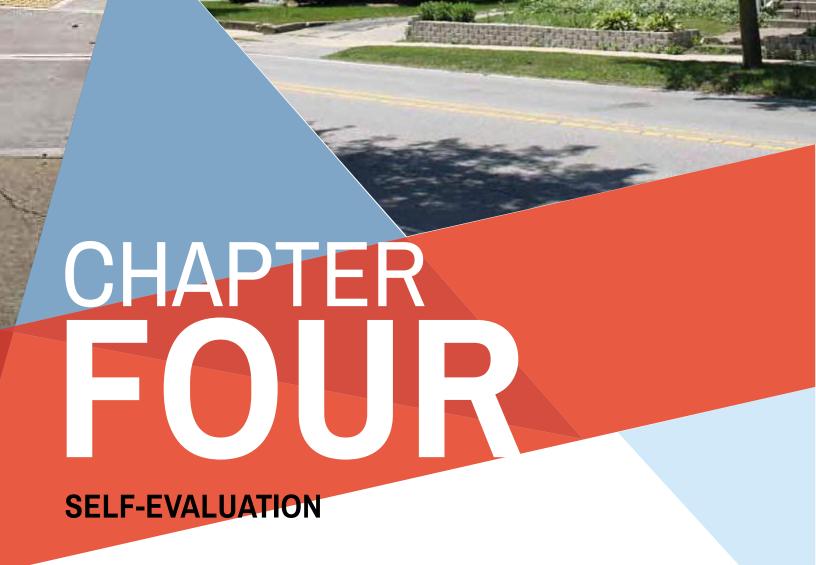

Public Facilities

In order to perform the required self-evaluation for the town of Fortville's public facilities in regards to adherence to the Americans with Disabilities Act, a collection database was developed. While first person observation is the most effective method for data collection, it is a time consuming and involved process. In order to stream-line the process to increase efficiency while maintaining efficacy, a database was developed based on the federal requirements for public facility upgrades to provide better governmental access to the entire population.

A preliminary checklist was first created from the specific requirements for public facilities outlined in the Americans with Disabilities Act, to provide a starting point for the collection database.

The self-evaluation consisted of visiting six public facilities within Fortville: the Municipal building, Community Center, Water Treatment Plant, Memorial Park and Shelter house within Memorial Park, and Landmark Park. Aspects of each facility were observed, tested, and measured to ensure compliance with ADA Standards. All data was collected using iPads in conjunction with ESRI Arc GIS.

The purpose of the public facility inventory was to show the existing conditions of facilities in Fortville, as well as, compare existing conditions with ADA standards.

Suggested Facility Priority

(See 'Overview Map' on page 26)

- 1. Municipal Building
- 2. Fortville Memorial Park
- 3. Community Center
- 4. Shelter House
- 5. Landmark Park
- 6. Water Treatment Plant

The list outlines the suggested priority for each facility. Each facility is organized by its priority level before the modification priority within the facility is outlined. It is important to understand that the facility priority will determine the timeline for modifications; the higher the facility priority, the more resources should be used to upgrade it, and the less time allotted for the facility to be upgraded. Facility priority is based on the amount of services provided, public access, and public population at each facility.

Further, the specific modifications that must be made within each facility are generally described below and detailed in the appendix. The time line for modifications within each facility is a suggested time line and should correlate with the overall facility time line.

Municipal Building

(Map on page 27)

The Fortville Municipal Building is located at 714 East Broadway, Fortville, Indiana. The Municipal Building in Fortville houses the Town Council, Police Department, Fire Department, Utility Office, Clerk Treasurer, and Town Court.

This facility contains a majority of the public services for Fortville. Although there are numerous modifications, there are few modifications that are time or cost intensive. For example, a majority of the modifications are reductions in door thresholds and weights, and the replacement of door handles. These modifications are relatively inexpensive and require very little time for completion. As noted in the appendix, a few doors require the door opening direction to be switched. Although this is not a major renovation, it is a modification that could take longer for completion and thus is allotted a longer time for complete modification.

There are three high priority renovations that are more costly and will take three to five years. The drinking fountain for the facility does not currently meet standards and is unable to meet the standards for rim and apron height simultaneously. The drinking fountain must be entirely replaced to achieve the ADA standards. Further, the restrooms do not meet ADA standards. Ideally, both restrooms would achieve ADA compliance, but the data suggests that the men's restroom will be more difficult to upgrade for compliance due to the width of the path to fixtures. One recommended option, if upgrading both restrooms at the same time proves unviable, is to mark both restrooms as unisex and renovate at least one of the two for compliance. This will sufficiently provide access until such a time that the second restroom could also be renovated and each could once again be marked for each respective sex.

Due to the importance of this facility for government and public interaction and the amount of services offered, it is recommended that this facility be considered the highest priority for compliance upgrades.

Fortville Memorial Park

(Map on page 28)

The Fortville Memorial Park is located along West Church Street, west of McCarty Street and north of West Staat Street in Fortville, Indiana.

Fortville's Memorial Park is the largest park in the Town, with numerous amenities. Due to the number of amenities that it offers, it is recommended for high priority within the town. There are several modifications

that must be made for the facility to attain ADA compliance. Memorial Park is deficient in access to services due to the lack of paths to various facilities and equipment throughout the park. Further, although some shelters have tables that allow for wheelchair seating, a majority of the shelters do not. The inclusion of handicap accessible picnic tables is not time intensive, but is allotted two to three years for completion due to the cost of purchasing new tables.

A majority of the time and costs for modifications within Memorial Park center on the restrooms and drinking fountains. Depending on whether or not the drinking fountain at the far west of the park can be adjusted to be operable with a closed fist, it will need to be replaced. This would cause a much higher cost and more time for completion. The drinking fountain can be upgraded within either a short or long time period, depending on how it can be modified. Further, the restrooms are currently marked as not accessible. To cut costs, it is recommended to designate the restrooms as unisex and modify only one of either the men's or women's restrooms in each area. Another important reason for this facility being a high priority is the proximity to other public resources. Memorial Park also surrounds the Shelter House, Community Center, and Water Treatment Plant.

Community Center

(Map on page 28)

The Fortville Community Center is located at 400 West Church Street, Fortville, Indiana; adjacent to the Fortville Memorial Park.

The Community Center is an important asset for public use; it provides multiple rooms for rent, a gymnasium, and houses the Fortville Head Start program for children agethree to five. The facility requires few modifications, with none being high priority. The most cost and time intensive modifications for the facility include the installation of a tactile strip at the base of the ramp from the accessible parking to the

entrance and the modification of two indoor counters. However, the counter spaces in the entry and kitchen are not necessarily utilized for service purposes that would require modifications beyond programmatic adjustments.

Other modifications include reducing door weight/ resistance(s), raising the drinking fountain near the restrooms between one and three inches, and installing ADA signage for the restrooms. Each of these modifications are relatively inexpensive and not time intensive. Therefore, it is recommended that these modifications be made within the first two years of modification implementation. Although there are few modifications, and no major modifications, this facility is recommended as a higher priority within the community as a whole and could possibly be utilized as a model for other facilities to follow if completed within the first few years of modification implementation.

Fortville Memorial Park - Shelter House

(Map on page 28)

The Fortville Memorial Park Shelter House is located along West Church Street, in the western half of Memorial Park in Fortville, Indiana.

The Shelter House is a public amenity that can be rented for events. Although there are a number of areas that are listed for modification, it is important to note that some modifications can also provide the necessary access to mitigate other modifications. For example, there are three doors that could be utilized as entrances for the shelter house, but only one needs to be fully ADA compliant. The first step toward compliance is modifying the ramp from accessible parking to the entry and designating a single entrance to modify. Once inside the shelter house, the major concern for compliance is the restrooms. There is not an accessible restroom within the facility. If neither restroom can be modified for full compliance, it is recommended that the restrooms be combined into a single unisex restroom that meets ADA standards. Although this facility is

within Fortville Memorial Park, it is recommended that to be below the Community Center in terms of priority.

the nature of the facility and the limited public access, it is also recommended that this facility be the lowest priority for the town of Fortville.

Landmark Park

(Map on page 29)

Landmark Park is located north of Staat Street between School Street and North Leland Street. The majority of the park consists of a path system with a central gazebo and a soccer field.

There are no major issues within Landmark Park except for the ramp to the gazebo. By decreasing the slope and ensuring that grade breaks are perpendicular to the ramps, a majority of the park would be fully accessible. There is not a path to every amenity within the park; a path at least 36 inches wide must be installed for access to the park play equipment. Beyond these modifications, the stairs do not have a handrail and the gazebo does not have a handicap accessible picnic table. By providing these additional amenities within the park, it would attain ADA standards and become fully compliant.

Water Treatment Plant

(Map on page 28)


The Water Treatment Plant is located at 400 West Church Street within Fortville Memorial Park.


The facility is largely unavailable to the public; therefore minimal spaces within the facility were assessed for compliance. The only modifications are for the entrance itself. Although the facility needs to increase the door width by one inch, this does not necessarily mean that the doorway must be widened. By increasing the amount that the door can swing open, the doorway can provide more clearance. Furthermore, the door should be switched to open in a different direction. By altering the opening direction of the door, the pull-side wall clearance can be increased. These modifications are fairly simplistic and can be completed with limited time and resources if done correctly. The recommendation for this facility is full ADA compliance within two to three years of modification implementation. Due to

Transition Plan

The following table provides a summary of each public building priority and outlines the overall transition plan schedule for public buildings within the Town of Fortville. The timeline presents both the year that modifications begin at each facility and the projected total number of years that will be required for complete ADA compliance.

Facility		Priority Reasoning	Timeline	
1	Municipal Building	As the central location for public meetings, utility payments, and other governmental services, the Municipal Building has the highest public traffic and is the top priority for modification.	Modifications begin 2013 and 2014	2-3
2	Fortville Me- morial Park	Fortville Memorial Park is the largest recreation area in the Town and provides a majority of event space. Furthermore, it is directly linked with several other public facilities. It is a high priority facility.		2-3
3	Community Center	This facility is utilized year round and thus receives a very high amount of public use. It is recommended as a moderate to high priority.	Modifications	2-3
4	Fortville Me- morial Park – Shelter House	As a facility within Memorial Park, it is recommended as a moderate priority.	begin 2014 and 2015	3-5
5	Landmark Park	There are few amenities within Landmark Park, so it should be considered a low priority.	Modifications	2-3
6	Water Treat- ment Plant	Due to the lack of public access, the Water Treatment Plant is recommended as a low priority.	begin 2015 to 2017	2-3

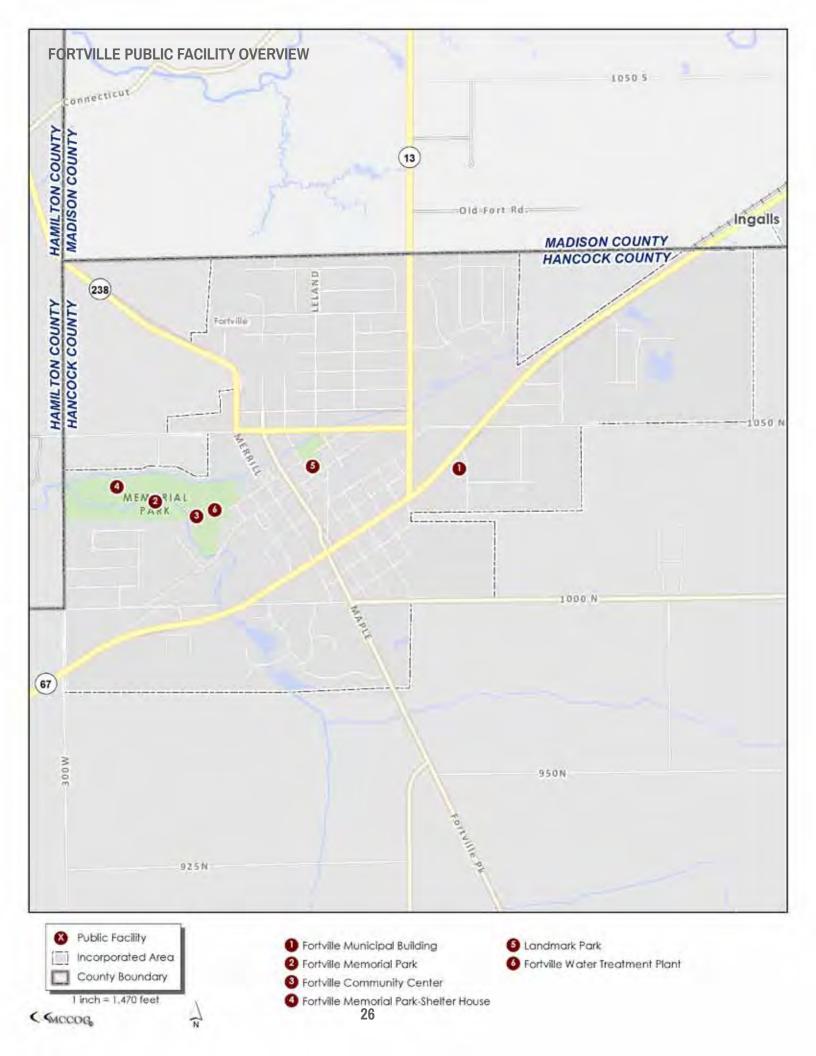

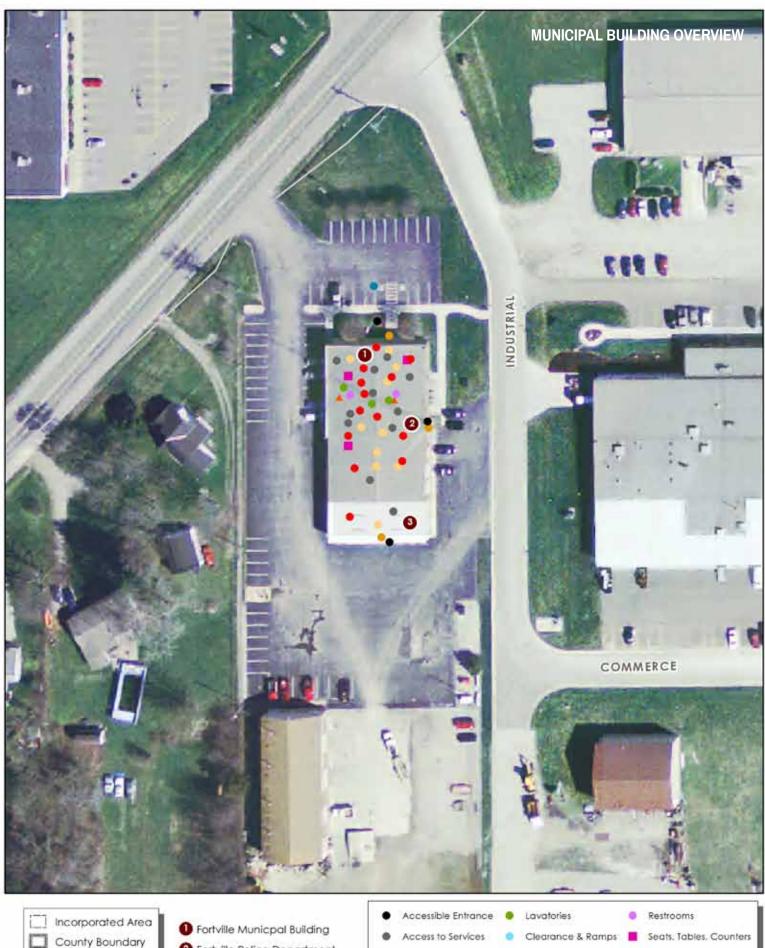



< SACCOG

Parks

- 2 Fortville Police Department
- Fortville Fire Department

See page 48 for specific modifications

Access to Services Doors

Entrance


- Seats, Tables, Counters
- On Street Parking

Parking

Visual Characteristics


Stalls

- 27
- Floors Ramp Rails

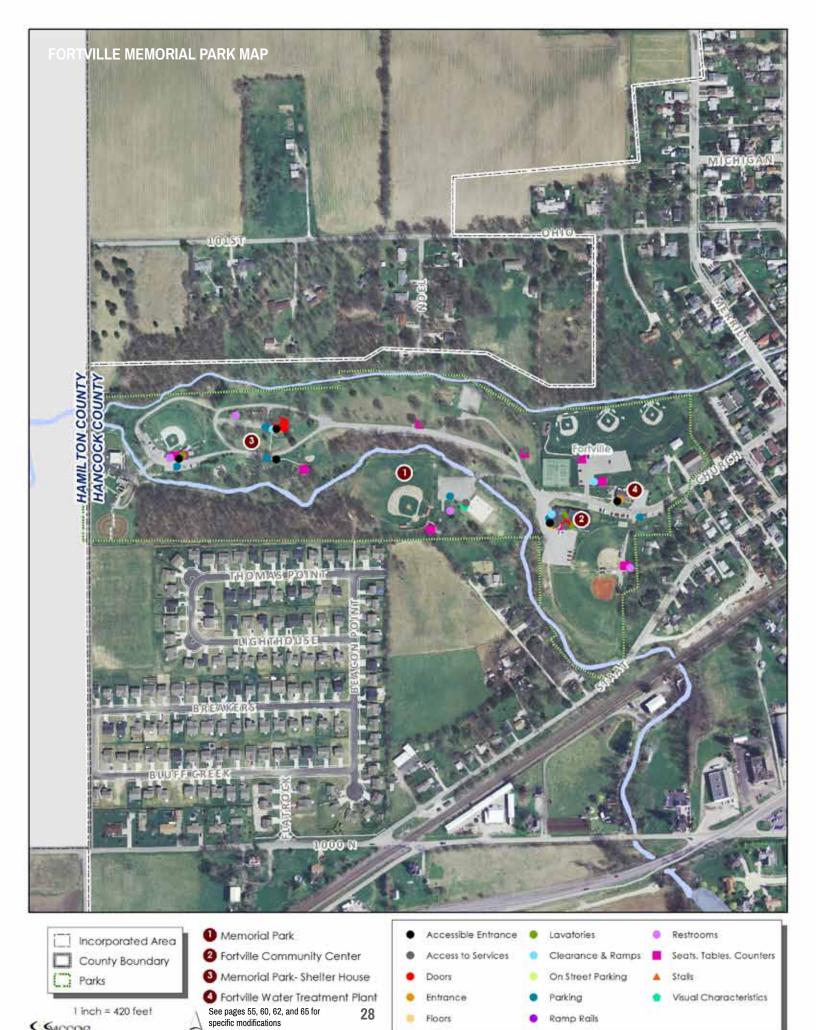

Floors

Ramp Rails

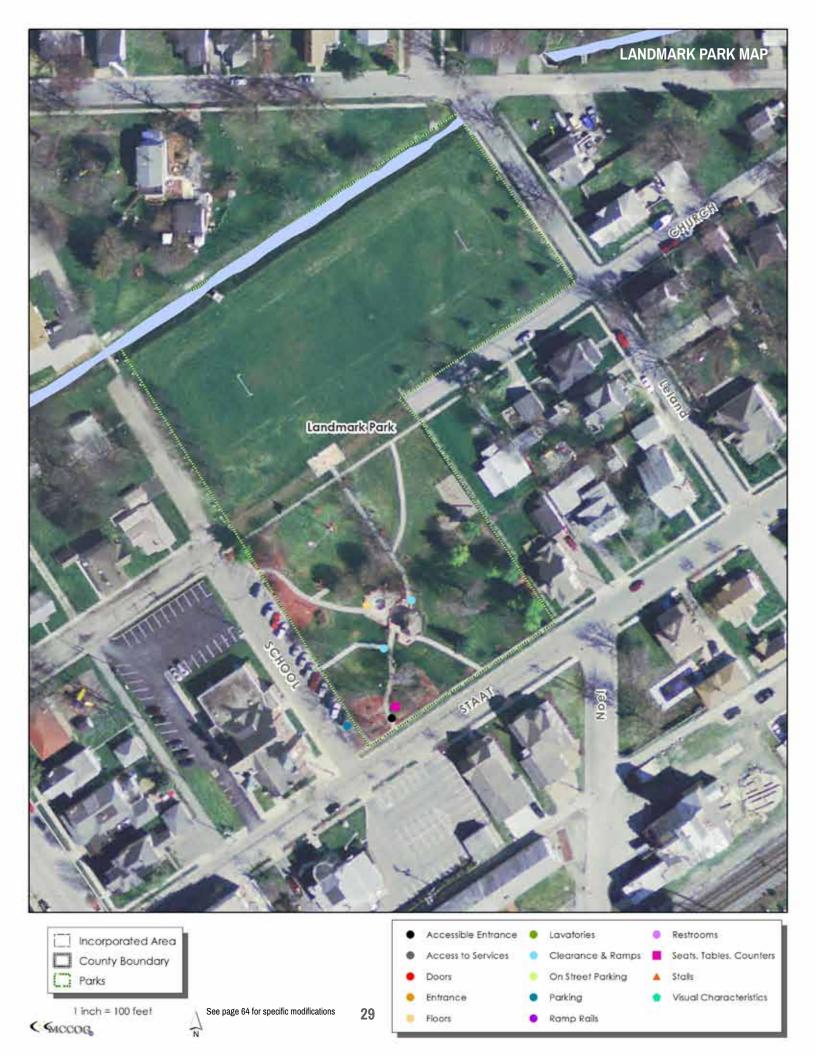

Sidewalks

(Map on page 33)

Fortville has a total of 100,938 feet of sidewalk in place. Fortville has 3,749 (3.7 percent) feet of sidewalk in "excellent" condition. These sidewalks are located primarily along State Road 13 north of Broadway Street, Ohio Street, Michigan Street, and scattered sections on Merrill Street and Staat Street.

Fortville has 37,222 (36.9 percent) feet of sidewalks in "good" condition. These sidewalks are located primarily in the subdivision on County Road 1000 North west of Broadway Street, and newer residential developments north of Hamilton Street.

Fortville has 55,266 (54.8 percent) feet of sidewalks in "fair" condition. These sidewalks make up most of Fortville's sidewalks south of Ohio Street. The housing subdivision east of State Road 13 and north of Hamilton Street also contains sidewalks mostly in "fair" condition. At a rate of \$36.50/linear foot to remove the sidewalks in disrepair and construct new sidewalks, replacing all sidewalks in "poor" condition would cost approximately \$2.02 million.

Fortville has 4,701 (4.7 percent) feet of sidewalks in "poor" condition. These sidewalks can be found scattered throughout Fortville. At a rate of \$36.50/ linear foot to remove the sidewalks in disrepair and construct new sidewalks, replacing all sidewalks in "poor" condition would cost approximately \$171,560. Fortville has no sidewalks in "very poor" condition. There are approximately 59,655 feet of road in Fortville that do have parallel running sidewalks. At a rate of \$27.30/linear foot, it would cost approximately \$1.63 million to install new sidewalks in these areas.

Curb Ramps (ADA Ramps)

(Map on page 34)

There are a total of 57 pedestrian ramps in the Town of Fortville that include colored, tactile strips therefore visually appearing to meet current ADA standards. After measuring the dimensions of the ramps, only 24 (42.1 percent) accurately meet ADA standards. Of the 33 ramps that do not meet ADA standards, 15 (45.5 percent) do not include landings with the proper dimensions. While only one (1) ramp has a running slope that exceeds the maximum, 23 ramps (70 percent) have cross slopes that exceed the maximum slope of 2.0 percent.

There are a total of 232 intersections in the Town of Fortville. Not including the 16 ramps that meet ADA standards, at a cost of \$1,250 per curb ramp, it would cost approximately \$2.3 million to retrofit each intersection with eight (8) curb ramps.

Location	Number of Ramps	Existing Condition	Modification
State Road 13 & Broadway Street	1: NW corner	Ramp meets ADA requirements	No modifications necessary at this time
State Road 13 & Pearl Street	3: NW, SW corners, East of State Road 13	All ramps meet ADA requirements	No modifications necessary at this time
State Road 13 & Mill Street	2: NW, SW corners	SW ramp does not contain landing of proper dimensions; NW, SW ramps have cross slopes of 4.2% and 5.0% respectively	Construct proper landing on SW ramp; Decrease cross slope on NW, SW ramps to 2.0% or less
State Road 13 & Staat Street	6: NE, SE, NW, SW corners, Mid-block (2: North & South)	NE and NW ramps meet ADA standards; Both mid-block ramps do not have landings with proper dimensions; The SE, SW and southern mid-block ramps have cross slopes of 3.0%, 4.0% and 4.3% respectively	Construct proper landings on mid- block ramps; Reduce cross slope of SE, SW, and Southern mid-block ramps to 2.0% or less
State Road 13 & Monroe Street	2: NW, SW corners	SW ramp meets ADA requirements; NW ramp does not have landing with proper dimensions	Construct proper landing on NW ramp
State Road 13 & Il- linois Street	2: NW, SW corners	NW ramp does not have landing with proper dimensions; NW and SW ramps have cross slopes of 4.2% and 3.0% respectively	Construct proper landing on NW ramp; Reduce cross slope on NW and SW ramps to 2.0% or less
State Road 13 & Hamilton Street	4: NW, SW, NE, SE corners	SW, NE, SE ramps all meet ADA requirements; NW ramp has a cross slope of 3.2%	Reduce cross slope of NW ramp to 2.0% or less
State Road 13 between Hamilton Street & Illinois Street	2: East, West	West ramp meets ADA requirements; East ramp has a running slope of 9.7% and a cross slope of 3.1%	Reduce running slope of east ramp to 8.3% or less and its cross slope to 2.0% or less
State Road 13 & Vera Court	2: NW, SW corners	NW ramp does not have landing with proper dimensions; NW, SW ramps have cross slopes of 4.1% and 2.5% respectively	Construct proper landing on NW ramp; Reduce cross slope of both ramps to 2.0% or less
State Road 13 & Delaware Street	2: NW, SW corners	SW ramp meets ADA requirements; NW ramp has cross slope of 4.1%	Reduce cross slope of SW ramp to 2.0% or less
State Road 13 & Alden Drive	2: NE. SE corners	SE ramp meets ADA requirements; NE ramp has cross slope of 2.5%	Reduce cross slope of NE ramp to 2.0% or less
State Road 13 north of Alden Drive	2: East, West	Both ramps meet ADA requirements	No modifications necessary at this time
Leland Street & Michigan Street	6: NW (2), NE (2), SE, SW corners	Both NW ramps and the north-south running NE ramp meet ADA requirements; The east-west running NE ramp as well as the SE and SW running ramps have cross slopes of 2.2%, 3.1%, and 4.0% respectively	Reduce cross slopes of the east-west running NE ramp as well as the SE and SW running ramps to 2.0% or less
School Street & Michigan Street	4: NW, NE, SE, SW corners	NW ramp meets ADA requirements; SE and SW ramps do not have landings with proper dimensions; NE ramp has a cross slope of 3.6%	Construct proper landings on SE and SW ramps; Reduce cross slope on NE ramp to 2.0% or less
Main Street & Michigan Street	4: NW, NE, SE, SW corners	NW, NE ramps meet ADA requirements; SE and SW ramps have cross slopes of 3.0% and 5.5% respectively	Reduce cross slopes on SE, SW ramps to 2.0% or less

Michigan Street &	2: North, South	South ramp meets ADA requirements; North ramp does	Construct proper landing on north
Merrill Street	2: North, South	not contain landing with proper dimensions	ramp
Leland Street & Ohio	3: NW, SW, NE NW, NE ramps meet ADA requirements; SW ramp has		Reduce cross slope on SW ramp to
Street	corners	cross slope of 2.5%	2.0% or less
Main Street & Ohio	4: NW, NE, SE, SW	SE, SW ramps do not contain landings with proper dimen-	Construct proper landings on SE, SW
Street & Onio	' ' ' '	sions; NW, NE ramps have cross slopes of 2.9% and 4.0%	ramps; Reduce cross slopes of NW, NE
Street	corners	respectively	to 2.0% or less


Pedestrian Signals


(Map on page 34)

There is one (1) signalized intersection in the Town of Fortville, Maple Street & Broadway Street. This intersection has pedestrian signals that contain pushbuttons 44 inches high that are not audible. However, these pushbuttons are only in place for pedestrians traveling north-south. Pedestrians must push the button in order for the pedestrian signals to change.

The ADA recommends that the length of time pedestrians require to cross an intersection be no less than 3.5 feet per second. Pedestrians must cross Broadway Street at a pace of approximately 2.9 feet per second.

Location	Signal Type	Existing Condition	Modification
Maple Street & Broad- way Street	Semi-Actu- ated	No crosswalks; ADA ramps north-south east of Maple Street only; Pedestrian signal with non- audible pushbutton 44" high north-south east of Maple Street only; Crossing speed of 2.9 feet/ second required	Install crosswalks; Install ADA ramps north-south east of Maple Street and east-west; Install Pedestrian signals with pushbuttons north-south east of Maple Street and east west

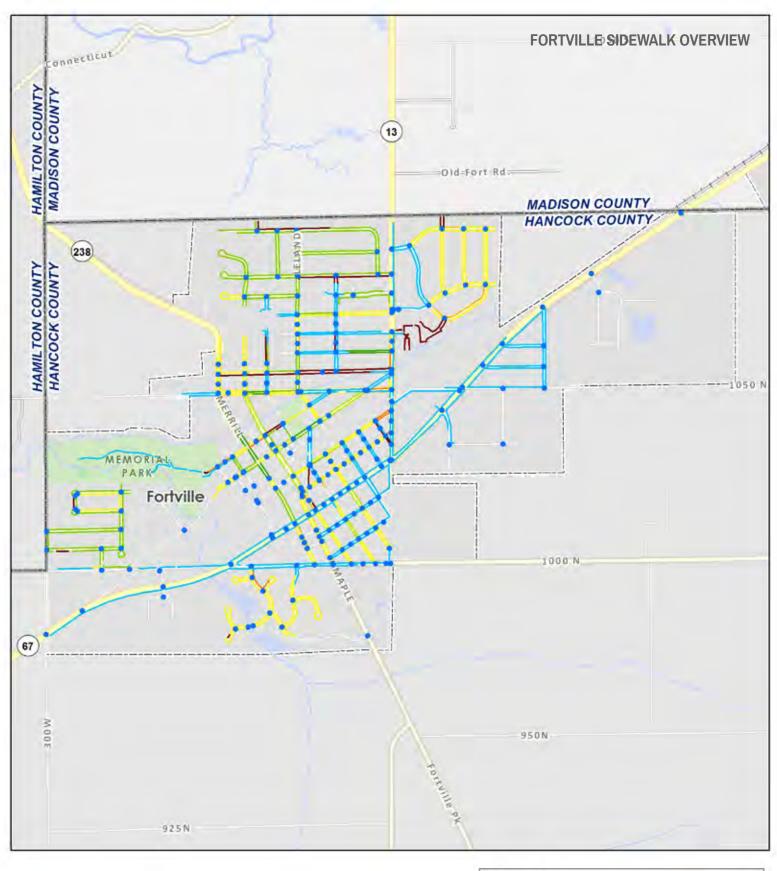


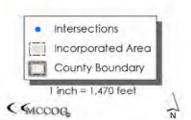







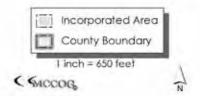





Transition Plan Management

The Fortville Transition Plan is a living document that will receive routine updates. The first update is scheduled to occur one year from the plan's formal adoption and on a four year cycle thereafter. streamline plan updates and keep the document current and relevant, appendices will be updated annually if new regulation are adopted or new information is available that does not alter the intent of the transition plan. When an appendix update is found to alter the intent of the Fortville Transition Plan the appendix and affected section(s) will be opened for public review and comment. The update schedule may be altered at the discretion of Fortville based on changes in guidance from the United States Access Board, Federal Policy, and State Policy. The Fortville Transition Plan is available for continual public comment on the Fortville website at http://www.fortvilleindiana.org.

In order to manage the ADA Transition Plan, it is suggested that the ADA Coordinator designate a field inspector(s). The appointed inspectors will be necessary for ensuring that modifications correctly adhere to ADA Codes and Standards. In many cases, the contractor(s) may not be fully aware of ADA Codes and Standards and it is up to the ADA Coordinator and/or inspectors to provide the guidelines for contractors to follow. For a successful plan, it is recommended that ADA Codes and Standards are discussed with contractors before the project and inspections performed both during and after project completion.

Inspections are recommended during:

1. Curb ramp, sidewalk, or public facility construction or rehabilitation undertaken within the jurisdiction of Fortville or its contractors as

- part of capital improvement projects or other specialized construction projects,
- 2. Curb ramp, sidewalk, or public facility construction or rehabilitation undertaken by other agencies or private parties within Fortville, and
- 3. Curb ramp, sidewalk, or public facility construction or rehabilitation undertaken as part of the ADA Transition Plan.

Special procedures for all field inspections are recommended to be as follows:

- Every modification under the jurisdiction of Fortville is to be personally inspected by an approved inspector within ten days after the completion of construction. All inspectors are to be appropriately trained to know and understand the ADA Codes and Standards and the measurements necessary to inspect modifications as they are constructed.
- 2. The inspector is to review and obtain all dimensions using a tape measure, force pressure gauge, and/or level to verify that all dimensions meet or exceed the ADA Codes and Standards.
- 3. The inspector is to obtain all slopes and gradients using a two-foot to four-foot long Smart-level or equal slope-measurement tool to verify that all slopes and gradients meet or exceed the ADA Codes and Standards.
- 4. The inspector is to review the physical conditions relating to the installation of all facility, curb ramp, sidewalk, and accessible pedestrian signal modifications to verify that all installations meet or exceed the ADA Codes and Standards.
- 5. All dimensions, slopes, and other conditions verified in 3 and 4 above are to be entered on approved Inspection Forms and such forms are

- to be certified as correct and truthful by the Inspector's signature.
- 6. Any exceptions to full compliance with the ADA Codes and Standards are to be described on the Inspection Form, certified as a "Finding for Non-compliance Element(s)" by the inspector, reviewed and approved by the Program Manager, and finally approved by the ADA Coordinator or his/her authorized representative.
- 7. Inspection Forms are to be submitted to the Program Access Coordinator within ten days after the completion of the modification construction.
- 8. Modifications are to be updated in the GIS database once approved by the ADA Coordinator.

The checklist that was utilized to create the GIS database is included in APPENDIX.INSPECTION FORM for use as the on-site inspection form.

Coordination with Public Improvements and Capital Expansion

For the ADA Transition Plan to be successful, it is important to coordinate modifications with both public improvement and capital expansion projects. It is recommended that Fortville utilize improvement projects as an opportunity for ADA compliance and update the Transition Plan accordingly. Improvements should be based on current and future programs including routine curb, gutter, pavement, and sidewalk maintenance; resident requested sidewalk improvements; and private developer construction projects.

Maintaining sidewalk elements in good condition is an essential part of providing access to public rights-of-way. Maintenance problems are usually identified by pedestrians who report the location to the municipal authorities. However, assessing sidewalks for accessibility should be an integral part of a jurisdiction's maintenance survey programs. Some cities survey and repair all sidewalks in regular cycles. Other cities make or enforce repairs only if a complaint is filed. Sidewalk inspectors typically look for conditions that are likely to inhibit access or cause pedestrians to injure themselves. These include: step separation, badly cracked concrete, settled areas that trap water, tree root damage, and noncompliant driveway flares.

Furthermore, coordinating with private developer construction projects will provide the opportunity to require relevant improvements. The Town of Fortville can require construction or improvement of sidewalks, curb ramps, and pedestrian signals as a condition for a building permit on property adjacent to the public right-of-way. Utilizing building permit conditions will increase the amount of modifications that are finished without increasing the financial burden of the community.

Current, as well as future, programs and projects can be addressed in conjunction with ADA modifications to decrease expenses and increase public benefit from resources allotted for barrier removal. Although the Transition Plan sets the schedule for modifications and explains priorities, Fortville should review and adjust the plan to reflect capital improvement projects. If a program and/or project impacts the Transition Plan priorities, it will be necessary to re-prioritize facilities for improvement.

GIS Data Entry

Fortville will be provided with access to each of the four GIS databases in order to monitor modifications. There are separate GIS maps for each of the four main assessment areas: public facilities, sidewalks, curb ramps, and pedestrian signals. By accessing each of

the maps online, Fortville will have the opportunity to assess specific points of interest. Each of the databases was developed as part of the overall ADA Transition Plan process and they contain detailed data for public facilities, sidewalks, curb ramps, and pedestrian signals.

The status of the overall compliance can be tracked and monitored by referencing each database. The final step in the inspection process is to update the GIS databases to indicate approved and completed modifications. This step includes both adjusting current points to updated existing conditions, as well as the creation of new points for areas that were not previously assessed. New points will be necessary for the installation of new curb ramps, sidewalks, pedestrian signals, and public facilities or amenities.

Furthermore, if a modification is inspected and does not meet the ADA Codes and Standards, each database allows recommendations to be submitted. The inspector is to submit the inspection form to the ADA Coordinator and enter the updated information with recommendations for the modifications that are necessary to be compliant. Once the inspection form has been signed by the inspector, the ADA Coordinator can designate who enters the information at his/her discretion.

Updating the databases is an important step in monitoring modifications in specific areas, as well as monitoring the Fortville Transition Plan as a whole. Each database was developed to provide a simple solution to tracking ADA compliance, as inspection form data is entered. The database information can be utilized to reprioritize and monitor modifications consistently. The continual updating of ADA data, as well as ADA Codes and Standards will allow the Transition Plan to be a living document.

APPENDIX

Definitions

Accessible Route

a continuous unobstructed path that connects all accessible elements and spaces of a building or facility; complying with Chapter 4 of ADAAG. Interior accessible routes may include corridors, floors, ramps, elevators, lifts and clear floor space at fixtures. Exterior accessible routes may include parking access aisles, curb ramps, crosswalks at vehicular ways, walks, ramps and lifts.

ADA

means and refers to the Americans with Disabilities Act as contained and explained in Title 42, Chapter 126 of the United States Code.

ADAAG

means and refers to the Americans with Disabilities Act Access Guidelines, codified at Appendix A to 28 Code of Federal Regulations Part 36 and at Appendix A to 49 Code of Federal Regulations part 37. "ADAAG Standards" means and refers to physical conditions that meet the new construction and/or alterations standards set forth in the ADAAG guidelines.

Auxiliary Aids and Services

under Titles II and III of the ADA, includes a wide range of services and devices that promote effective communication or allows access to goods and services. Examples of auxiliary aids and services for individuals who are deaf or hard of hearing include qualified interpreters, notetakers, computer-aided transcription services, written materials, telephone handset amplifiers, assistive listening systems, telephones compatible with hearing aids, closed caption decoders, open and closed captioning, telecommunications devices for deaf persons (TDDs), videotext displays, and exchange of written notes. Examples for individuals with vision impairments include qualified readers, taped texts, audio recordings, Brailled materials, large print materials, and assistance in locating items. Examples for individuals with speech impairments include TDDs, computer terminals, speech synthesizers, and communication boards.

Complaint

Complaints under Title I must be filed with the EEOC within 180 days of the date of the discrimination, or 300 days if the charge is files with a designated State or local fair employment practice agency. Lawsuits can only be filed in Federal court after an individual has received a 'right to sue' letter from the EEOC.

Curb Ramp

a short ramp cutting through a curb or built up to it.

Detectable Warning

means and refers to truncated domes which provide a tactile surface at the transition between the curb and the street or other hazardous vehicular crossings, assisting pedestrians with Vision Disabilities in determining when they enter the street.

Disability

with respect to an individual: a physical or mental impairment that substantially limits one or more of the major life activities of such individual; a record of such an impairment; or being regarded as having such an impairment.

Discrimination on the Basis of Disability

The Americans with Disabilities Act gives civil rights protections to individuals with disabilities similar to those provided to individuals on the basis of race, color, sex, national origin, age, and religion. It guarantees equal opportunity for individuals with disabilities in public accommodations, employment, transportation, State and local government services, and telecommunications.

Essential Functions

The minimum required duties and abilities necessary to perform the tasks of the job. Essential functions of a job can often be determined by writing accurate job descriptions to determine which tasks are a major part of the job and which are not. Factors to consider include the percentage of time spent performing those duties, the qualifications required to do these tasks, and whether the job exists in order to have these duties performed.

Having a Record of Impairment

persons who have a history of, or have been classified or misclassified as having, a physical or mental impairment that substantially limits one or more major life activities. It includes persons who have had a disabling impairment but have recovered in whole or in part and are not now substantially limited. It also includes persons who have been incorrectly classified as having a disability

Impairment

Aphysicalormentalimpairmentmeans any physiological disorder, or condition, cosmetic disfigurement, or anatomical loss affecting one or more of the following body systems: neurological, musculoskeletal, special sense organs, respiratory (including speech organs), cardiovascular, reproductive, digestive, genito-urinary, hemic and lymphatic, skin, and endocrine; or any mental or psychological disorder, such as mental retardation, organic brain syndrome, emotional or mental illness, and specific learning disabilities.

Major Life Activities

functions such as caring for oneself, performing manual tasks, walking, seeing, hearing, speaking, breathing, learning, and working.

Pedestrian Rights-of-Way (PROW)

means and refers to all sidewalks, as well as all curb ramps and crosswalks serving such sidewalks, and any other pathways used by pedestrians along public rights of way, including pedestrian pathways through public parking lots.

Physical or Mental Impairments

term used in the ADA definition of disability. Includes any physiological disorder or condition, cosmetic disfigurement, or anatomical loss affecting one or more body systems, such as neurological, musculoskeletal, special sense organs, respiratory (including speech organs), cardiovascular, reproductive, digestive, genitourinary, immune, circulatory, hemic, lymphatic, skin, and endocrine; or any mental or psychological disorder, such as an intellectual disability (formerly termed "mental retardation"), organic brain syndrome,

emotional or mental illness, and specific learning disabilities.

Program Accessibility

a public entity's services, programs, or activities, when viewed in their entirety, must be readily accessible to and usable by individuals with disabilities. This standard, known as program accessibility, applies to all existing district facilities.

Qualified Individual with a Disability

an individual who satisfies the requisite skill, experience, education and other job-related requirements of the employment position such individual holds or desires, and who, with or without reasonable accommodation, can perform the essential functions of such position. The ADA prohibits discrimination on the basis of disability against a qualified individual.

Reasonable Accommodation

changes or adjustments in a work or school site, program, or job that makes it possible for an otherwise qualified employee or student with a disability to perform the duties or tasks required.

Record of Impairment

persons who have a history of, or have been classified or misclassified as having, a physical or mental impairment that substantially limits one or more major life activities; includes persons who have had a disabling impairment but have recovered in whole or in part and are not now substantially limited. It also includes persons who have been incorrectly classified as having a disability

Substantial Limitations of Major Life Activities

an impairment is substantially limiting when it prevents an individual from performing a major life activity or when it significantly restricts the condition, manner, or duration under which an individual can perform a major life activity.

Undue Burden

with respect to complying with Title II or Title III of the ADA, significant difficulty or expense incurred by a covered entity, when considered in light of certain factors. These factors include: the nature and cost of the action; the overall financial resources of the site or sites involved; the number of persons employed at the site; the effect on expenses and resources; legitimate safety requirements necessary for safe operation, including crime prevention measures; or any other impact of the action on the operation of the site; the geographic separateness, and the administrative or fiscal relationship of the site or sites in question to any parent corporation or entity; if applicable, the overall financial resources of any parent corporation or entity; the overall size of the parent corporation or entity with respect to the number of its employees; the number, type, and location of its facilities; and if applicable, the type of operation or operations of any parent corporation or entity, including the composition, structure, and functions of the workforce of the parent corporation or entity.

Town of Fortville Hancock County, Indiana

Ordinance 2012-6B

Ordinance Adopting Grievance Procedures for Title II of the Americans with Disabilities Act of 1990

WHEREAS, the Town of Fortville ("Town") must comply with the Americans with Disabilities Act of 1990 ("ADA");

WHEREAS, Title II of the ADA provides requirements concerning the filing of grievances; and

WHEREAS, the Town Council finds it necessary to adopt grievance procedures for the Town to comply with Title II of the ADA.

Now, therefore, be it ordained by the Town Council of Fortville as follows:

SECTION 1. The attached Exhibit A is hereby adopted as the procedures for filing grievances under Title II of the ADA for the Town and shall be added to Title IX of the Fortville Town Code as Chapter 96, Sec. 96.01 – ADA Compliance.

SECTION 2. If any provision in this Ordinance is declared invalid, the remaining provisions of the Ordinance shall remain in full force and effect.

<u>SECTION 3</u>. Any ordinances or provisions thereof that are inconsistent with this Ordinance are hereby superseded.

SECTION 4. This Ordinance shall be in full force and effect upon passage and publication as required by law.

SECTION 5. Introduced and filed on the 18th day of 1000 2012. A motion to consider on first reading on the day of introduction was offered and sustained by a vote of 5 in favor and 0 opposed pursuant to Ind. Code § 36-5-2-9.8.

Duly ordained and passed the day of July 2012 by the Town Council of the Town of Fortville, Hancock County, Indiana, having been passed by a vote of 5 in favor and 0 opposed

[Signature Page Follows]

Voting Affirmative:	Voting Opposed:
Ron Stafford	Ron Stafford
Sarah Brown	Sarah Brown
Janet Manship	Janet Manship
Bill Hiday	Bill Hiday
Nancy Sizemore	Nancy Sizemore
Marcie Stafford Clerk-Treasurer	

EXHIBIT A

Title IX, Chapter 96 - ADA Compliance

Sec. 96.01 - Grievance Procedures

In accordance with the requirements of Title II of the Americans with Disabilities Act of 1990 ("ADA"), the Town of Fortville will not discriminate against qualified individuals with disabilities on the basis of disability in its access to services, programs or activities.

Employment: The Town of Fortville does not discriminate on the basis of disability in its hiring or employment practices and complies with all regulations as outlined by the U.S. Equal Employment Opportunity Commission under Title I of the ADA.

Effective Communication: The Town of Fortville will, upon request, provide appropriate aids and services leading to effective participation for people with disabilities to participate equally in the Town of Fortville's programs, services and activities. Anyone who requires an auxiliary aid or service for effective participation or modification of policies or procedures to participate in a service, program, or activity, contact the office of the ADA Coordinator as soon as possible but no later than 48 hours before the scheduled event.

Modifications to Policies and Procedures: The Town of Fortville will make all reasonable modifications to policies and programs to ensure that people with disabilities have an equal opportunity to enjoy all of its programs, services and activities. The Americans with Disabilities Act does not require the Town of Fortville to take any action that would fundamentally alter the nature of its services or programs or impose an undue financial or administrative burden to the Town of Fortville. Complaints regarding a service, program or activity of the Town of Fortville that is not accessible to persons with disabilities should be directed to the ADA Coordinator.

The Town of Fortville will not place a surcharge on a particular individual with a disability or any group of individuals with disabilities to cover the cost of providing auxiliary aids/services or reasonable modifications of policy, such as retrieving items from locations that are open to the public but are not accessible to persons who use wheelchairs.

Procedures: The Town of Fortville has adopted an internal grievance procedure providing for prompt and equitable resolution of complaints alleging any action prohibited by the U.S. Department of Justice regulations implementing Title II of the Americans with Disabilities Act ("ADA"). Title II states, in part, that "no otherwise qualified disabled individual shall, solely by reason of such disability, be excluded from the participation in, be denied the benefits of, or be subjected to discrimination in programs, services or activities sponsored by a public entity".

Step One: File the Grievance

Complete the Town of Fortville Grievance Form. Grievance Form can be found on the Town of Fortville, Indiana website (www.fortvilleindiana.org) or in the ADA Coordinator's office. A grievance may be communicated in writing, by e-mail, by fax or by telephone, but must follow the format of the Town of Fortville Grievance Form.

A grievance concerning the accessibility of the Town of Fortville's services, programs or activities should be addressed to:

ADA Coordinator

714 East Broadway, Fortville, IN. 46040

Step Two: Acknowledgement

A grievance should be filed within 90 days after the grievant party becomes aware of the alleged violation. The ADA Coordinator will send an acknowledgement of receipt of the grievance within 12 working days.

Step Three: Informal Resolution

Following the filing of a grievance, the ADA Coordinator shall determine whether, and to what extent, an investigation of the grievance is warranted. Any resulting investigation shall be conducted by the ADA Coordinator or his/her designee. In the case of a property or access issue, the grievance will also be investigated by the Town of Fortville Property Manager. A thorough investigation affords all interested persons and their representatives an opportunity to submit evidence relevant to a grievance. The ADA Coordinator will complete the investigation within 60 calendar days of receipt of the grievance. If appropriate, the ADA Coordinator will arrange to meet with the grievant to discuss the matter and attempt to reach an informal resolution of the grievance. Any informal resolution of the grievance shall be documented in the ADA Coordinator file and the case will be closed.

Step Four: Written determination

If an informal resolution of the grievance is not reached in Step 3, within 60 calendar days of receipt of the grievance, a written determination as to the validity of the complaint, and description of the resolution, if appropriate, shall be forwarded by the ADA Coordinator to the Executive Officer for approval.

Step Five: Final determination and resolution

The ADA Coordinator shall communicate the determination and resolution to the grievant within 90 calendar days of receipt of the grievance, unless the Executive Officer authorizes additional time for further consideration of the grievance. Any authorized extension of time will be communicated to the grievant. Any request for reconsideration of the response to the grievance shall be at the discretion of the Executive Officer.

If the grievant is not satisfied with the Town of Fortville's handling of the grievance at any stage of the process, or does not wish to file a grievance through the Town of Fortville's ADA Title II Grievance Procedures, the grievant may file a complaint directly with the U. S. Department of Justice or other appropriate state or federal agency. Use of the Town of Fortville's grievance procedure is not a prerequisite to the pursuit of other remedies.

The resolution of any specific grievance will require consideration of varying circumstances, such as the specific nature of the disability; the nature of the access to services, programs, or facilities at issue, the essential eligibility requirements for participation; the health and safety of others; and the degree to which an accommodation would constitute a fundamental alteration to the service, program or facility, or cause an undue hardship to the Town of Fortville. Accordingly, the resolution by the Town of Fortville of any one grievance does not constitute a precedent upon which the Town of Fortville is bound or upon which other complaining parties may rely.

File Maintenance The Town of Fortville's ADA	Coordinator shall mainta	in ADA Grievance files	for three years.	

Program Contacts / ADA Coordinator

Town of Fortville ADA Coordinator: 714 East Broadway Fortville, Indiana 46040 (317) 485.4044

Public Facilities

Analysis Priority and Timeline Methodology Modification Priority



The color coding classification system defines the necessity of each modification. The years define the timeline for completion of such a modification based on the project difficulty. Therefore, although a modification may be defined as a low priority, it could be designated as a project for completion within any range of time from one to five years. Low priorities that can attain compliance with simple adjustments are defined as a short term project, due for completion within one year. However, some modifications are low priority because they are nearly compliant despite the fact that they would be very difficult to complete and may be defined as a long term project for full compliance. For example, if the path from an accessible parking space to the accessible entrance is 45 inches wide and the standard is 48 inches wide, the priority would be low for modification while the timeline for the project would be five plus years. The time allotted is greater than the usual time for modification because the project is a high cost with very little benefit.

Public Facility Modifications

Facility: Municipal Building (Map on page 27)

Item/Location	Standard	Existing Condition	Modification	Years
Parking	At least 1 accessible space	2 accessible spaces, 2 van accessible;	No modifications nec-	
	per 25 standard spaces, and	closest to entryway; marked with	essary at this time.	
	1 van accessible space in all	International Symbol of Accessibil-		
	cases	ity; 50' from entry.		
On-street	Accessible spaces closest to	No on-street parking.	No modifications nec-	
Parking	door; space for unloading		essary at this time.	
Accessible En-	Pathway from accessible	Pathway from accessible space to en-	No modifications nec-	
trance (Front	space to entry free of ob-	try is free of obstructions and stairs,	essary at this time.	
Door)	structions, stairs, and min	firm/sturdy, and 120" wide, width of		
	48" wide	curb cut is 48".		
Accessible En-	Pathway from accessible	Pathway from accessible space to en-	No modifications nec-	
trance (Police	space to entry free of ob-	try is free of obstructions and stairs,	essary at this time.	
Dept. En-	structions, stairs, and min	firm/sturdy, and 68" wide.		
trance)	48" wide			
Accessible	Pathway from accessible	Pathway from accessible space to	No modifications nec-	
Entrance (Fire	space to entry free of ob-	entry is free from obstructions and	essary at this time.	
Dept. Outer	structions, stairs, and min	stairs, firm/sturdy, and 60" wide.		
Entrance)	48" wide			
Entrance	Accessible entry available	No handicap entry; door opening	Reduce threshold;	1-2
(Front)	and marked, including on	width 39", 36" pull-side clearance, 1"	reduce door weight/	
	all inaccessible entries. Min	threshold, 36" high door handle that	resistance.	
	door width 32", max thresh-	is operable with a closed fist; door		
	old 0.5", usable with closed	requires more than 5 lbs. of force to		
	fist.	open.		
Entrance	Accessible entry available	No handicap entry; door opening	Reduce threshold;	1-2
(Police Dept.	and marked, including on	width 34", 18" pull-side clearance,	reduce door weight/	
Entrance)	all inaccessible entries. Min	1.5" threshold, 38" high door handle	resistance.	
	door width 32", max thresh-	that is operable with closed fist; door		
	old 0.5", usable with closed	requires more than 5 lbs. of force to		
	fist.	open.		
Entrance (Out-	Accessible entry available	No handicap entry; door opening	Reduce threshold;	1-2
er entrance;	and marked, including on	width 29", 36" pull-side clearance;	replace handle to be	
Garage bays)	all inaccessible entries. Min	2" threshold, 41" door handle height,	operable with a closed	
	door width 32", max thresh-	not operable with closed fist; 0.25"	fist; reduce door	
	old 0.5 ", usable with closed	door mat; door requires more than 5	weight/resistance.	
	fist.	lbs. of force to open		

Access to Ser-	Access to all public spaces	Directly accessible, with access to all	No modifications nec-
vices (Council	from accessible path of	public spaces, 97" wide path.	essary at this time.
Room)	travel, directly accessible,		
	and min path width of 36".		
Access to Ser-	Access to all public spaces	Directly accessible, with access to all	No modifications nec-
vices (Lobby)	from accessible path of	public spaces, 47" wide path.	essary at this time.
	travel, directly accessible,		
	and min path width of 36".		
Access to Ser-	Access to all public spaces	Directly accessible, with access to all	No modifications nec-
vices (Hallway	from accessible path of	public spaces, 71" wide path.	essary at this time.
to Offices)	travel, directly accessible,		
	and min path width of 36".		
Access to Ser-	Access to all public spaces	Directly accessible, with access to all	No modifications nec-
vices (Utility	from accessible path of	public spaces, 77" wide path.	essary at this time.
Payment)	travel, directly accessible,		
	and min path width of 36".		
Access to Ser-	Access to all public spaces	Directly accessible with access to all	No modifications nec-
vices (Hallway	from accessible path of	public spaces, 66" wide path.	essary at this time.
to Police/Fire)	travel, directly accessible,		
	and min path width of 36".		
Access to Ser-	Access to all public spaces	Directly accessible with access to all	No modifications nec-
vices (Hall-	from accessible path of	public spaces, 54" wide path.	essary at this time.
way to Police	travel, directly accessible,		
Dept.)	and min path width of 36".		
Access to	Access to all public spaces	Directly accessible with access to all	No modifications nec-
Services (Clerk	from accessible path of	public spaces; 41" wide path.	essary at this time.
Treasurer)	travel, directly accessible,		
	and min path width of 36".		
Access to Ser-	Access to all public spaces	Directly accessible with access to all	No modifications nec-
vices (Police	from accessible path of	public spaces; 59" wide path.	essary at this time
Dept.)	travel, directly accessible,		
	and min path width of 36".		
Access to Ser-	Access to all public spaces	Directly accessible with access to all	No modifications nec-
vices (Inter-	from accessible path of	public spaces; 36" wide path.	essary at this time.
view Room;	travel, directly accessible,		
Police Dept.)	and min path width of 36".		
Access to	Access to all public spaces	Directly accessible with access to all	No modifications nec-
Services (Fire	from accessible path of	public spaces; 59" wide path.	essary at this time.
Dept.)	travel, directly accessible,		
	and min path width of 36".		

Access to	Access to all public spaces	Directly accessible with access to all	No modifications nec-
Services (Fire	from accessible path of	public spaces; 59" wide path.	essary at this time.
Dept. Access;	travel, directly accessible,	Fundamental Control of the Control o	
Garage Bays)	and min path width of 36".		
Floors (Lobby)	Flooring must be securely attached at the edges, with thresholds max 0.5", max 48" reach heights, max 7" riser height and 11" step depth.	Securely attached at edge; 0.5" threshold.	No modifications necessary at this time.
Floors (Council Room)	Flooring must be securely attached at the edges, with thresholds max 0.5", max 48" reach heights, max 7" riser height and 11" step depth.	Securely attached at edges; 0.5" threshold.	No modifications necessary at this time.
Floors (Hall- way to Police/ Fire from Utili- ties)	Flooring must be securely attached at the edges, with thresholds max 0.5", max 48" reach heights, max 7" riser height and 11" step depth.	Securely attached at edges; 0.25" threshold.	No modifications necessary at this time.
Floors (Clerk Treasurer's Office)	Flooring must be securely attached at the edges, with thresholds max 0.5", max 48" reach heights, max 7" riser height and 11" step depth.	Securely attached at edges; 0.25" threshold; 48" height of reach to drop box.	No modifications necessary at this time.
Floors (Small Conference Room)	Flooring must be securely attached at the edges, with thresholds max 0.5", max 48" reach heights, max 7" riser height and 11" step depth.	Securely attached at edge; no threshold.	No modifications necessary at this time.
Floors (Police Dept.)	Flooring must be securely attached at the edges, with thresholds max 0.5", max 48" reach heights, max 7" riser height and 11" step depth.	Securely attached at edge; 0.25" threshold.	No modifications necessary at this time.

Floors (Fire Dept.)	Flooring must be securely attached at the edges, with thresholds max 0.5", max 48" reach heights, max 7" riser height and 11" step depth.	Securely attached at edge; 0.25" threshold.	No modifications necessary at this time.	
Floors (MS4 Operator Of- fice)	Flooring must be securely attached at the edges, with thresholds max 0.5", max 48" reach heights, max 7" riser height and 11" step depth.	Securely attached at edge; 0.25" threshold.	No modifications necessary at this time.	
Floors (Fire Dept. Garage Bays)	Flooring must be securely attached at the edges, with thresholds max 0.5", max 48" reach heights, max 7" riser height and 11" step depth.	Securely attached at edge; 43" height of reach; no threshold.	No modifications necessary at this time.	
Doors (Council Room Front Entry)	Max 5 lbs. force to open and 48" door handle, min 32" door opening, 18" wall space on pull-side of door, and door handle operable with closed fist.	Requires more than 5 lbs. of force to open; door width 33"; 18"+ of wall clearance; door handle 31" high and operable with closed fist.	Reduce weight/resistance.	1
Doors (To Utility Payments)	Max 5 lbs. force to open and 48" door handle, min 32" door opening, 18" wall space on pull-side of door, and door handle operable with closed fist.	Requires more than 5 lbs. of force to open; door width 32", 18"+ of wall clearance; door handle 45" high and operable with closed fist	Reduce weight/resistance.	1
Doors (Small Conference Room)	Max 5 lbs. force to open and 48" door handle, min 32" door opening, 18" wall space on pull-side of door, and door handle operable with closed fist.	Requires less than 5 lbs. of force to open; door width 35", 18"+ of wall clearance; door handle 40" high and operable with closed fist.	No modifications necessary at this time.	
Doors (Door in Small Confer- ence Room)	Max 5 lbs. force to open and 48" door handle, min 32" door opening, 18" wall space on pull-side of door, and door handle operable with closed fist.	Requires less than 5 lbs. of force to open; door width 30", 18"+ of wall clearance; door handle 40" high, not operable with closed fist.	Increase door width; replace handle to be operable with a closed fist.	2-3

Doors (Utility Payments Door to Offices)	Max 5 lbs. force to open and 48" door handle, min 32" door opening, 18" wall space on pull-side of door, and door handle operable with closed fist.	Requires more than 5 lbs. of force to open; door width 32", 18"+ of wall clearance; door handle 40" high and operable with closed fist.	Reduce weight/resistance	1
Doors (Council Room)	Max 5 lbs. force to open and 48" door handle, min 32" door opening, 18" wall space on pull-side of door, and door handle operable with closed fist.	Requires less than 5 lbs. of force to open; door width 34", 36" of wall clearance; door handle 41" high, not operable with closed fist.	Replace handle to be operable with a closed fist.	1
Doors (Clerk Treasurer's Office)	Max 5 lbs. force to open and 48" door handle, min 32" door opening, 18" wall space on pull-side of door, and door handle operable with closed fist.	Requires less than 5 lbs. of force to open; door width 33", 36" of wall clearance; door handle 41" high, not operable with closed fist.	Replace handle to be operable with a closed fist.	1
Doors (Clerk Treasurer's Office)	Max 5 lbs. force to open and 48" door handle, min 32" door opening, 18" wall space on pull-side of door, and door handle operable with closed fist.	Requires less than 5 lbs. of force to open; door width 33", 9" of wall clearance; door handle 42" high; not operable with closed fist.	Increase pull-side wall clearance (switch opening direction); replace handle to be operable with a closed fist.	1-2
Doors (Police Dept.)	Max 5 lbs. force to open and 48" door handle, min 32" door opening, 18" wall space on pull-side of door, and door handle operable with closed fist.	Requires less than 5 lbs. of force to open; door width 33", 13" of wall clearance; door handle 40" high; not operable with closed fist.	Increase pull-side wall clearance (switch opening direction); replace handle to be operable with a closed fist.	1-2
Doors (MS4 operator door)	Max 5 lbs. force to open and 48" door handle, min 32" door opening, 18" wall space on pull-side of door, and door handle operable with closed fist.	Requires less than 5 lbs. of force to open; door width 33", 36" of wall clearance; door handle 40" high, operable with closed fist.	No modifications necessary at this time.	
Doors (Fire Dept. Door to Garage)	Max 5 lbs. force to open and 48" door handle, min 32" door opening, 18" wall space on pull-side of door, and door handle operable with closed fist.	Requires less than 5 lbs. of force to open; door width 33", 36" of wall clearance; door handle 40" high, not operable with closed fist.	Replace handle to be operable with a closed fist.	1

Doors (Police Dept. Inter- view Room)	Max 5 lbs. force to open and 48" door handle, min 32" door opening, 18" wall space on pull-side of door, and door handle operable with closed fist.	Requires less than 5 lbs. of force to open; door width 33", 9" of wall clearance; door handle 40" high, not operable with closed fist.	Increase pull-side wall clearance (switch opening direction); replace handle to be operable with a closed fist.	1-2
Doors (Fire Dept.)	Max 5 lbs. force to open and 48" door handle, min 32" door opening, 18" wall space on pull-side of door, and door handle operable with closed fist.	Requires more than 5 lbs. of force to open; door width 33", 36" of wall clearance; door handle 40" high; not operable with closed fist.	Reduce weight/resistance; replace handle to be operable with a closed fist.	1-2
Seats, Tables, Counters (Util- ity Payment Counter)	Space available for wheel- chair seating, counter and table height 28-34", knee height min 27"	39" counter height.	Provide 28-34" high counter or alternative programmatic function.	2-3
Seats, Tables, Counters (Council Room)	Space available for wheel- chair seating, counter and table height 28-34", knee height min 27"	Space available for seating.	No modifications necessary at this time.	
Seats, Tables, Counters (Police Dept. counter)	Space available for wheel- chair seating, counter and table height 28-34", knee height min 27"	41" counter height.	Provide 28-34" high counter or alternative programmatic function.	2-3
Drinking Fountain (Police/Fire Hallway)	Clear space 30x48", max sink depth 19", max fountain height 36", min 27" apron, min 8" knee depth, operable with closed fist.	No clear space; drinking fountain 40" high; 26" high fountain apron; operable with a closed fist; knee depth 11".	Replace fountain to attain ADA compliance (current fountain unable to accomplish standards).	2-3
Restrooms (Men's)	Accessible bathroom available and marked with International Handicapped Symbol, min 32" door opening, 48" max door handle, min 36" path to fixtures, max 5 lbs. door force, 5x5' stall, grab bars, 17-19" toilet seat height. Sinks have clear space 30x48", max depth 19", max height 34", min 29" apron, min 17" knee depth, max 48" high soap/dryer, max 40" high mirror.	Accessible restroom not available; 29" door width; door requires more than 5 lbs. force to open; door handle 41" high and operable with closed fist; 34" wide path to fixtures; no 5x5' clearance; grab bars not installed; toilet seat 18" high. Sink clearance greater than 30x48"; 15" sink depth; 0" knee depth; 32" sink height; 0" sink apron; soap/dryer not reachable; mirror 41" high.	Increase door width; reduce door weight/ resistance; increase width of path to fixtures; increase stall to 5x5'; remove sink cabinetry to provide knee clearance; lower soap/dryer to be within 48" height of reach; lower mirror at least 1".	2-3

Restrooms	Accessible bathroom avail-	Accessible restroom not available;	Increase door width;	2-3
(Women's)	able and marked with	29" door width; door requires more	reduce door weight/re-	
	International Handicapped	than 5 lbs. force to open; door	sistance; increase stall	
	Symbol, min 32" door open-	handle 41" high and operable with	to 5x5'; raise toilet	
	ing, 48" max door handle,	closed fist; 56" wide path to fix-	2-4"; remove sink cab-	
	min 36" path to fixtures,	tures; no 5x5' clearance; grab bars	inetry to provide knee	
	max 5 lbs. door force, 5x5'	installed; toilet seat 15" high. Sink	clearance; lower soap/	
	stall, grab bars, 17-19" toilet	clearance greater than 30x48"; 17"	dryer to be within 48"	
	seat height. Sinks have clear	sink depth; o" knee depth; 31" sink	height of reach; lower	
	space 30x48", max depth	height; o" sink apron; soap/dryer	mirror at least 2".	
	19", max height 34", min 29"	not reachable; mirror 42" high.		
	apron, min 17" knee depth,			
	max 48" high soap/dryer,			
	max 40" high mirror.			

Facility: Memorial Park (Map on page 28)

Item/Location	Standard	Existing Condition	Modification	Years
Parking (Far West Lot)	At least 1 accessible space per 25 standard spaces, and 1 van accessible space in all cases	2 accessible spaces, 2 van accessible; closest to entryway; marked with International Symbol of Accessibility; only 50' from entry.	No modifications necessary at this time.	
Parking (Lot South of Shel- ter House)	At least 1 accessible space per 25 standard spaces, and 1 van accessible space in all cases	2 accessible spaces, 1 van accessible; closest to entryway; marked with International Symbol of Accessibility; 140' from entry.	No modifications necessary at this time.	
Parking (By Skate Park)	At least 1 accessible space per 25 standard spaces, and 1 van accessible space in all cases	2 accessible spaces, 2 van accessible; closest to entryway; marked with International Symbol of Accessibility; 110' from entry.	No modifications necessary at this time.	
Parking (East end of Park)	At least 1 accessible space per 25 standard spaces, and 1 van accessible space in all cases	3 accessible spaces, 2 van accessible; closest to entryway; marked with International Symbol of Accessibility; 200' from entry.	No modifications necessary at this time.	
On-street Parking	Accessible spaces closest to door; space for unloading	No on-street parking.	No modifications necessary at this time.	
Accessible Entrance (Far West Lot)	Pathway from accessible space to entry free of obstructions, stairs, and min 48" wide	Pathway from accessible space to entry is free of obstructions and stairs, firm/sturdy, and 73" wide	No modifications necessary at this time.	
Accessible Entrance (Lot South of Shel- ter House to shelter)	Pathway from accessible space to entry free of obstructions, stairs, and min 48" wide	Pathway from accessible space to entry is free of obstructions and stairs, firm/sturdy, and 46" wide.	Increase width of pathway to at least 48".	5+
Access to Services (Far West Play Equipment)	Access to all public spaces from accessible path of travel, directly accessible, and min path width of 36".	Not directly accessible.	Install path at least 36" wide to all facilities.	2-3
Access to Services (Small Shelter on North side of Drive)	Access to all public spaces from accessible path of travel, directly accessible, and min path width of 36".	Not directly accessible.	Install path at least 36" wide to all facilities.	2-3
Access to Services (Pathway to Skate Park)	Access to all public spaces from accessible path of travel, directly accessible, and min path width of 36".	Direct accessibility; All public spaces accessible from path of travel; 38" route width.	No modifications necessary at this time.	

Access to Services (Pathway to Concessions)	Access to all public spaces from accessible path of travel, directly accessible, and min path width of 36".	Direct accessibility; All public spaces accessible from path of travel; 135" route width	No modifications necessary at this time.	
Access to Services (Small Shelter House)	Access to all public spaces from accessible path of travel, directly accessible, and min path width of 36".	Not directly accessible.	Install path at least 36" wide to all facilities.	2-3
Access to Services (Path to Playground)	Access to all public spaces from accessible path of travel, directly accessible, and min path width of 36".	Directly accessible; 56" route width	No modifications necessary at this time.	
Access to Services (Pathway to Softball Field)	Access to all public spaces from accessible path of travel, directly accessible, and min path width of 36".	Direct accessibility; All public spaces accessible from path of travel; 126" route width	No modifications necessary at this time.	
Floors	Flooring must be securely attached at the edges, with thresholds max 0.5", max 48" reach heights, max 7" riser height and 11" step depth.	Step risers 5", handrail 6" perimeter.	No modifications necessary at this time.	
Visual Characteristics (Skate Park Signage)	Contrasting background and lettering, non-script type-face, non-glare finish, with Braille	Non glare finish on signs; Letters and background contrast; No braille	Include braille for signage	3-5
Seats, Tables, Counters (Francis Clark Field Concessions)	Space available for wheel- chair seating, counter and table height 28-34", knee height min 27"	38" counter height.	Provide 28-34" high counter or alternative programmatic function.	2-3
Seats, Tables, Counters (Francis Clark Field Conces- sion Tables)	Space available for wheel- chair seating, counter and table height 28-34", knee height min 27"	No space for wheelchair seating; 30" table height; 28" knee height; 42" knee width; 11" knee depth	Provide at least 1 handicap acces- sible picnic table with wheelchair seating space per shelter.	2-3
Seats, Tables, Counters (Shelter House Tables south of drive)	Space available for wheel- chair seating, counter and table height 28-34", knee height min 27"	No space for wheelchair seating; 33" table height; 31" knee height; 41" knee width; 6" knee depth	Provide at least 1 handicap accessible picnic table with wheelchair seating space per shelter.	2-3

Seats, Tables,	Chase evailable for wheel	No space for whoolsheir seating: 20"	Provide at least 1	2-3
Seats, Tables,	Space available for wheel- chair seating, counter and	No space for wheelchair seating; 29" table height; 28" knee height; 46"	handicap acces-	2-3
(Shelter north	table height 28-34", knee	knee width; 11" knee depth	sible picnic table with	
•		knee width; 11 knee depth	•	
of Drive)	height min 27"		wheelchair seating	
~ 11			space per shelter.	
Seats, Tables,	Space available for wheel-	No space for wheelchair seating; 28"	Provide at least 1	2-3
Counters	chair seating, counter and	table height; 26" knee height; 45"	handicap acces-	
(Skate Park	table height 28-34", knee	knee width; 11" knee depth	sible picnic table with	
Refreshment	height min 27"		wheelchair seating	
Stand)			space per shelter.	
Seats, Tables,	Space available for wheel-	No space for wheelchair seating; 31"	Provide at least 1	2-3
Counters	chair seating, counter and	table height; 30" knee height; 42"	handicap acces-	
(Shelter north	table height 28-34", knee	knee width; 9" knee depth	sible picnic table with	
of Drive)	height min 27"		wheelchair seating	
			space per shelter.	
Seats, Tables,	Space available for wheel-	Space for wheelchair seating; 30"	No modifications nec-	
Counters	chair seating, counter and	table height; 39" knee height; 42"	essary at this time.	
(Shelter Picnic	table height 28-34", knee	knee width; 28" knee depth	, and the second	
Tables)	height min 27"	, ,		
Seats, Tables,	Space available for wheel-	No space for wheelchair seating; 29"	Provide at least 1	2-3
Counters	chair seating, counter and	Table height; 28" knee height"; 46"	handicap acces-	
(Concession	table height 28-34", knee	knee width; 11" knee depth	sible picnic table with	
Stand Picnic	height min 27"		wheelchair seating	
Tables)			space per shelter.	
Seats, Tables,	Space available for wheel-	41" counter height.	Provide 28-34" high	2-3
Counters	chair seating, counter and	41 counter neight.	counter or alternative	2 0
(Counter at	table height 28-34", knee		programmatic func-	
Concession	height min 27"		tion.	
Stand)	11018111 11111 2/		tion.	
-	Clear grees gov 49" may	Drinking fountain 30" high; 24" high	Daiga fauntain ha	0.5
Drinking	Clear space 30x48", max		Raise fountain be-	2-5
Fountain (Far	sink depth 19", max fountain	fountain apron; not operable with a	tween 3 and 6";	
West Park-	height 36", min 27" apron,	closed fist; knee depth 13"	provide handle that is	
ing Lot Water	min8" knee depth, operable		operable with a closed	
Fountain)	with closed fist.		fist (may require foun-	
			tain to be replaced).	

Restrooms	Accessible bathroom avail-	No accessible restroom available.	Provide/mark acces-	2-3
(Far West	able and marked with		sible restroom with	
Restroom)	International Handicapped		International Symbol	
	Symbol, min 32" door open-		of Accessibility.	
	ing, 48" max door handle,			
	min 36" path to fixtures,			
	max 5 lbs. door force, 5x5'			
	stall, grab bars, 17-19" toilet			
	seat height. Sinks have clear			
	space 30x48", max depth			
	19", max height 34", min 29"			
	apron, min 17" knee depth,			
	max 48" high soap/dryer,			
	max 40" high mirror.			
Restrooms (By	Accessible bathroom avail-	No accessible restroom available.	Provide/mark acces-	2-3
Shelter)	able and marked with		sible restroom with	
	International Handicapped		International Symbol	
	Symbol, min 32" door open-		of Accessibility.	
	ing, 48" max door handle,			
	min 36" path to fixtures,			
	max 5 lbs. door force, 5x5'			
	stall, grab bars, 17-19" toilet			
	seat height. Sinks have clear			
	space 30x48", max depth			
	19", max height 34", min 29"			
	apron, min 17" knee depth,			
	max 48" high soap/dryer,			
	max 40" high mirror.			
Restrooms (By	Accessible bathroom avail-	No ADA restroom available; No ADA	Provide/mark acces-	2-3
Skate Park)	able and marked with	signage; 32" doorway opening; 40"	sible restroom with In-	
	International Handicapped	high door handle, not operable with	ternational Symbol of	
	Symbol, min 32" door open-	closed fist	Accessibility; replace	
	ing, 48" max door handle,		handle to be operable	
	min 36" path to fixtures,		with a closed fist.	
	max 5 lbs. door force, 5x5'			
	stall, grab bars, 17-19" toilet			
	seat height. Sinks have clear			
	space 30x48", max depth			
	19", max height 34", min 29"			
	apron, min 17" knee depth,			
	max 48" high soap/dryer,			
	max 40" high mirror.			

Restrooms (By	Accessible bathroom avail-	No accessible restroom available.	Provide/mark acces-	2-3
Softball Fields)	able and marked with		sible restroom with	
	International Handicapped		International Symbol	
	Symbol, min 32" door open-		of Accessibility.	
	ing, 48" max door handle,			
	min 36" path to fixtures,			
	max 5 lbs. door force, 5x5'			
	stall, grab bars, 17-19" toilet			
	seat height. Sinks have clear			
	space 30x48", max depth			
	19", max height 34", min 29"			
	apron, min 17" knee depth,			
	max 48" high soap/dryer,			
	max 40" high mirror.			

Facility: Community Center (Map on page 28)

Item/Location	Standard	Existing Condition	Modification	Years
Parking	At least 1 accessible space per 25 standard spaces, and 1 van accessible space in all cases	2 accessible spaces, 2 van accessible; not closest to entryway; marked with International Symbol of Accessibil- ity; only 30' from entry.	No modifications necessary at this time.	
On-street Parking	Accessible spaces closest to door; space for unloading	No on-street parking	No modifications necessary at this time.	
Accessible Entrance	Pathway from accessible space to entry free of obstructions, stairs, and min 48" wide	Pathway from accessible space to entry is free of obstructions and stairs, firm/sturdy, and 115" wide.	No modifications necessary at this time.	
Clearance and Ramps	8.3% max slope, tactile strip, 5x5' top landing, 4x4' bottom landing, and level, contigu- ous grade break	6.2% slope; 5x5' landing; perpendicular and contiguous grade break without tactile strip; necessary for access to building.	Install tactile strip.	2-3
Entrance	Accessible entry available and marked, including on all inaccessible entries. Min door width 32", max threshold 0.5", usable with closed fist.	No accessible entry marked; door opening width 34", 34" pull side clearance, 0.5" threshold, 35" high door handle that is operable with a closed fist; door requires more than 5 lbs of force to open; 0.25" doormat.	Reduce door weight/resistance.	1
Access to Services (Hall to Restroom)	Access to all public spaces from accessible path of travel, directly accessible, and min path width of 36".	Directly accessible, with access to all public spaces, 66" wide path.	No modifications necessary at this time.	
Access to Services (Entry)	Access to all public spaces from accessible path of travel, directly accessible, and min path width of 36".	Directly accessible, with access to all public spaces, 103" wide path	No modifications necessary at this time.	
Access to Services	Access to all public spaces from accessible path of travel, directly accessible, and min path width of 36".	Directly accessible, with access to all public spaces, 32" wide path but center table can be moved.	No modifications necessary at this time	
Floors	Flooring must be securely attached at the edges, with thresholds max 0.5", max 48" reach heights, max 7" riser height and 11" step depth.	Securely attached at the edges; threshold 0.25".	No modifications necessary at this time	

Doors (Kitchen Door)	Max 5 lbs force to open and 48" door handle, min 32" door opening, 18" wall space on pull side of door, and door handle operable with closed fist.	Requires less than 5 lbs of force to open; door width 35"; 18"+ of wall clearance; door handle 40" high and operable with closed fist.	No modifications necessary at this time.	
Doors (To Gymnasium)	Max 5 lbs force to open and 48" door handle, min 32" door opening, 18" wall space on pull side of door, and door handle operable with closed fist.	Requires more than 5 lbs of force to open; door width 35"; 18"+ wall clearance; door handle 38" high and operable with closed fist	Reduce weight/resistance.	1
Seats, Tables, Counters (En- try Counter)	Space available for wheel- chair seating, counter and table height 28-34", knee height min 27"	42" counter height.	Provide 28-34" high counter or alternative programmatic function.	2-3
Seats, Tables, Counters (Kitchen Counter)	Space available for wheel- chair seating, counter and table height 28-34", knee height min 27"	36" counter height.	Provide 28-34" high counter or alternative programmatic function.	2-3
Drinking Fountain (hallway near restrooms)	Clear space 30x48", max sink depth 19", max fountain height 36", min 27" apron, min 8" knee depth, operable with closed fist.	Drinking fountain 31" high; 26" high fountain apron; operable with a closed fist; knee depth 9".	Raise fountain between 1 and 3".	1-2
Drinking Fountain (gymnasium)	Clear space 30x48", max sink depth 19", max fountain height 36", min 27" apron, min 8" knee depth, operable with closed fist.	Drinking fountain 34" high; 27" high fountain apron; operable with a closed fist; knee depth 19".	No modifications necessary at this time.	
Restrooms	Accessible bathroom available and marked with International Handicapped Symbol, min 32" door opening, 48" max door handle, min 36" path to fixtures, max 5 lbs door force, 5x5' stall, grab bars, 17-19" toilet seat height. Sinks have clear space 30x48", max depth 19", max height 34", min 29" apron, min 17" knee depth, max 48" high soap/dryer, max 40" high mirror.	Accessible restroom available but not marked with International Symbol of Accessibility; 34" door width; door requires less than 5 lbs. force to open; door handle 40" high and operable with closed fist; 54" wide path to fixtures; 5x5' clearance; grab bars installed; toilet seat 18" high. Sink clearance greater than 30x48"; 9" sink depth; 18" knee depth; 34" sink height; 30" sink apron; soap/dryer reachable; mirror 40" high.	Install ADA signage∎	1-2

Facility: Shelter House (Map on page 28)

Item/Location	Standard	Existing Condition	Modification	Years
Parking	At least 1 accessible space per 25 standard spaces, and 1 van accessible space in all cases	2 accessible spaces, 2 van accessible; closest to entryway; marked with International Symbol of Accessibility; 45' from entry.	No modifications necessary at this time.	
On-street Parking	Accessible spaces closest to door; space for unloading	No on-street parking available.	No modifications necessary at this time	
Accessible Entrance	Pathway from accessible space to entry free of obstructions, stairs, and min 48" wide	Pathway from accessible space to entry is free of obstructions and stairs, firm/sturdy, and 111" wide.	No modifications necessary at this time.	
Clearance and Ramps	8.3% max slope, tactile strip, 5x5' top landing, 4x4' bottom landing, and level, contigu- ous grade break	11.2% slope; 5x5' landing; perpendicular and contiguous grade break without tactile strip; necessary for access to building.	Decrease ramp slope; install tactile strip.	2-3
Entrance	Accessible entry available and marked, including on all inaccessible entries. Min door width 32", max threshold 0.5", usable with closed fist.	No handicap entry; door opening width 34", 36" pull side clearance, 3" threshold, 34" high door handle that is not operable with a closed fist	Reduce threshold or install ramp with 5x5' top platform adjacent to door; replace handle to be operable with a closed fist.	2-3
Access to Services (Restroom Hall)	Access to all public spaces from accessible path of travel, directly accessible, and min path width of 36".	Directly accessible, with access to all public spaces, 50" wide path.	No modifications necessary at this time.	
Doors (To Restroom Hall)	Max 5 lbs force to open and 48" door handle, min 32" door opening, 18" wall space on pull side of door, and door handle operable with closed fist.	Requires less than 5 lbs of force to open; door width 35"; 18"+ of wall clearance; door handle 36" high and not operable with closed fist.	Replace handle to be operable with a closed fist.	1
Doors (Shelter House Door No. 2)	Max 5 lbs force to open and 48" door handle, min 32" door opening, 18" wall space on pull side of door, and door handle operable with closed fist.	Requires more than 5 lbs of force to open; door width 33", 18"+ of wall clearance; Door handle 34" high and not operable with closed fist; 3" threshold.	Reduce weight/resistance; reduce threshold or install ramp with 5x5' top platform adjacent to door; replace handle to be operable with a closed fist.	3-5

Doors (To Liv- ing Area From Kitchen)	Max 5 lbs force to open and 48" door handle, min 32" door opening, 18" wall space on pull side of door, and door handle operable with closed fist.	Does not require more than 5 lbs of force to open; Door width 31"; 10" wall clearance; Door handle 33" high and not operable with closed fist.	Increase door width; increase wall clearance switch opening direction; replace handle to be operable with a closed fist.	3-5
Doors (Shelter House Door No. 1)	Max 5 lbs force to open and 48" door handle, min 32" door opening, 18" wall space on pull side of door, and door handle operable with closed fist.	Requires more than 5 lbs of force to open; Door width 33"; 36" wall clearance; Door handle 34" high and not operable with closed fist; 3" threshold	Reduce threshold or install ramp with 5x5' top platform adjacent to door; replace handle to be operable with a closed fist.	2-3
Seats, Tables, Counters (Kitchen Counter)	Space available for wheel- chair seating, counter and table height 28-34", knee height min 27"	35" counter height	Provide 28-34" high counter or alternative programmatic function.	5+
Seats, Tables, Counters (Shelter House Tables)	Space available for wheel- chair seating, counter and table height 28-34", knee height min 27"	No space for wheelchair seating; Table height 30"; Knee height 27", Knee width 43", Knee depth 9".	Provide 1 handicap accessible table with wheelchair seating space.	1-2
Restrooms	Accessible bathroom available and marked with International Handicapped Symbol, min 32" door opening, 48" max door handle, min 36" path to fixtures, max 5 lbs door force, 5x5' stall, grab bars, 17-19" toilet seat height. Sinks have clear space 30x48", max depth 19", max height 34", min 29" apron, min 17" knee depth, max 48" high soap/dryer, max 40" high mirror.	No accessible restroom available; not marked with International Symbol of Accessibility; 30" door width; door requires less than 5 lbs force to open; door handle 32" high and not operable with closed fist; 50" wide path to fixtures; No 5x5' clearance; grab bars installed; toilet seat 17" high. Sink clearance greater than 30x48"; 10" sink depth; 17" knee depth; 32" sink height; No sink apron; soap/dryer not reachable; mirror 55" high	Increase door width; replace handle to be operable with a closed fist; provide 5x5' stall; lower soap/dryer to be within 48" height of reach; lower mirror at least 15".	3-5

Facility: Landmark Park (Map on page 29)

Item/Location	Standard	Existing Condition	Modification	Years
Parking	At least 1 accessible space per 25 standard spaces, and 1 van accessible space in all cases.	1 accessible spaces, 1 van accessible; closest to entryway; marked with International Symbol of Accessibility; 50' from entry.	No modifications necessary at this time.	
On-street Parking	Accessible spaces closest to door; space for unloading	No on-street parking available.	No modifications necessary at this time.	
Accessible Entrance	Pathway from accessible space to entry free of obstructions, stairs, and min 48" wide	Pathway from accessible space to entry is free of obstructions and stairs, firm/sturdy, and 58" wide; curb cut 52" wide	No modifications necessary at this time.	
Clearance and Ramps (Ramp to Gazebo)	8.3% max slope, 5x5' top landing, 4x4' bottom land- ing, and level, contiguous grade break	13.0% slope; 5x5' landing; no perpendicular grade break, no 4x4' bottom grade break; necessary for access to gazebo.	Decrease ramp slope; create bottom grade brake perpendicular to ramp.	2-3
Clearance and Ramps	8.3% max slope, 5x5' top landing, 4x4' bottom land- ing, and level, contiguous grade break	5.0% slope; 5x5' landing; no perpendicular grade break, no 4x4' bottom grade break.	Create bottom grade brake perpendicular to ramp.	1-2
Access to Services (Path From Soccer Field)	Access to all public spaces from accessible path of travel, directly accessible, and min path width of 36".	Directly accessible, 46" wide path.	No modifications necessary at this time.	
Access to Services (Path to Play Equip- ment)	Access to all public spaces from accessible path of travel, directly accessible, and min path width of 36".	No path to play equipment.	Install path at least 36" wide to all equipment within facility.	2-3
Access to Services (Sidewalk from Parking)	Access to all public spaces from accessible path of travel, directly accessible, and min path width of 36".	Directly accessible, all public spaces accessible from path of travel, 47" wide	No modifications necessary at this time.	
Floors (Stairs in Park)	Flooring must be securely attached at the edges, with thresholds max 0.5", max 48" reach heights, max 7" riser height and 11" step depth.	Step risers 5" tall; No handrail	Install handrail.	2-3
Seats, Tables, Counters (Pic- nic Table by Gazebo)	Space available for wheel- chair seating, counter and table height 28-34", knee height min 27"	No spaces for wheelchair seating; Table height 28", Knee height 27", Knee width 46", Knee depth 11"	Provide at least 1 handicap acces- sible picnic table with wheelchair seating space per shelter.	1-2

Facility: Water Treatment Plant (Map on page 28)

Item/Location	Standard	Existing Condition	Modification	Years
Parking	At least 1 accessible space	3 accessible spaces, 2 van accessible;	No modifications nec-	
	per 25 standard spaces, and	closest to entryway; marked with	essary at this time.	
	1 van accessible space in all	International Symbol of Accessibil-		
	cases.	ity; 200' from entry∎		
On-street	Accessible spaces closest to	No on-street parking available.	No modifications nec-	
Parking	door; space for unloading		essary at this time.	
Accessible	Pathway from accessible	Pathway from accessible space to en-	No modifications nec-	
Entrance	space to entry free of ob-	try is free of obstructions and stairs,	essary at this time.	
	structions, stairs, and min	firm/sturdy, and 48" wide.		
	48" wide			
Entrance (No	Accessible entry available	Accessible entry not marked; door	Increase door width;	2-3
Public Access)	and marked, including on	opening width 31", 12" pull side	increase pull-side	
	all inaccessible entries. Min	clearance, 0.5" threshold, 40" high	wall clearance (switch	
	door width 32", max thresh-	door handle that is operable with a	opening direction);	
	old 0.5", usable with closed	closed fist; door requires more than	reduce weight/resis-	
	fist.	5 lbs. of force to open; 0.25" door-	tance.	
		mat.		

Public Facility Inspection

Selected sections applicable to specific modifications being assessed/re-assessed must be filled out and submitted within ten days of modification completion.

Parking Facility	1	<u> </u>	3 	<u>4</u>		
Number of Accessible Spaces						
Number of Van Accessible Spaces						
Are the accessible spaces closest						
to the entrance?					(Yes/No)	
Are accessible spaces marked?					(Yes/No)	
Distance from accessible parking						
to entrance						
Is there a pull-up space?					(Yes/No)	
Are accessible aisles marked?					(Yes/No)	
Notes	1					
	2					
	3					
	4					
On-Street Parking Facility	1	2	3	4		
On-street accessible spaces						
available?					(Yes/No)	
Is on-street parking clear of						
obstacles for van lifts?					(Yes/No)	
Notes	1					
	2					
	3					
	4					

Accessible Entrance Facility	1	2	3	4	
Path to entrance without stairs?					(Yes/No)
Path firm/sturdy?					(Yes/No)
Width of Path (w/o curb)					(inches)
Width of Median					(inches)
Width of Curb cut					(inches)
Notes	4				
	2				
Entrance Facility	1	2	3	4	
Is there a handicap entrance?					(Yes/No)
Do inaccessible entries have signs					
directing to handicap entrance?					(Yes/No)
Independent handicap entrance?					(Yes/No)
Door opening width					(inches)
Pull-side wall space					(inches)
Threshold height					(inches)
Height of door handle					(inches)
Handle usable with a closed fist?					(Yes/No)
Doormat					/· 1)
Door force <5 lbs.					(Yes/No)
Notes	1				
	2				
	3				
	/4				

Access to Services Facility	1	2	3	<u>4</u>	
Main floor, lobby, or elevator					
directly accessible?					(Yes/No)
All public spaces on accessible					
path of travel?					(Yes/No)
Width of accessible route					
Notes					
Doors Facility	1	2	3	4	
Door opening width					(inches)
Pull-side wall space					
Door force <5 lbs.					
Height of door handle					(inches)
Handle usable with a closed fist?					
Notes					
	2				
	3				
	4				
Floors Facility	1	2	3	4	
Securely attached at edges?					(Yes/No)
Height of reach					(inches)
Height of step risers					(inches)
Handrail perimeter					(inches)
Threshold height					(inches)
Notes	1				
	2				
	3				
	//				

1	2	3	4	
				(Yes/No)
1				
4				
1	2	3	4	
				(inches)
				(Yes/No)
				(inches)
				(inches)
4				
2				
0				
	111111111121212	1 2 1 2 1 2 1 2 1 2 2 2 2 2 2 2 2 2 2 2	1 2 3 1 2 3 1 2 1 2 2 3 1 2 2 2 2 2 2 2	

APPENDIX.INSPECTION FORM

Restrooms Facility	1	2	3	4	
Customer restroom available?					(Yes/No)
ADA Restroom available?					(Yes/No)
ADA Signage for restrooms?					(Yes/No)
Door opening width					(inches)
Height of door handle					(inches)
Handle usable with a closed fist?					(Yes/No)
Wheelchair maneuvering space					
in entry?					(Yes/No)
Width of path to fixtures					(inches)
Door force <5 lbs.					(Yes/No)
Notes	1				
	2				
	3				
	4				
Stalls Handle usable with a closed fist?	1	2	3	4	(Yes/No)
Stall clearance 5x5 feet?					(Yes/No)
Grab bars installed?					(Yes/No)
Height of toilet seat					(inches)
Notes	1				
	2				
	3				
	4				

Lavatories (sinks) Facility	1	2	3	4	
Clear space 30x48 inches?					(Yes/No)
Depth of sink					(inches)
Height of sink rim					(inches)
Height to bottom of apron					(inches)
Knee depth					(inches)
Operable with closed fist					(Yes/No)
Soap/dryer within 48 inch height of reach?					(Yes/No)
Height to bottom edge of mirror					
Notes					
Lavatories (drinking				4.	
fountains) Facility	1	2	3	<u>4</u>	
Clear space 30x48 inches?					(Yes/No)
Depth of sink					(inches)
Height of sink rim					(inches)
Height to bottom of apron					(inches)
Knee depth					(inches)
Operable with closed fist					(Yes/No)
Soap/dryer within 48 inch height					
of reach?					(Yes/No)
Height to bottom edge of mirror					(inches)
Notes	1				
	2				
	3				
	# .				

Curb Ramp Inspection

Every ramp being constructed and/or modified must be assessed/re-assessed and this form filled out and submitted within ten days of project completion.

Curb Ramps Intersection	1	2	3	4				
Location					(NE, SE, SW, NW)			
Type					(Perp, Diag)			
5 foot landing?					(Yes/No)			
Tactile strip installed?					(Yes/No)			
Colored tactile strip?					(Yes/No)			
Slope run					(%)			
Cross slope								
Flare slope (if applicable)					()			
Approach slope					(%)			
Ramp width					(inches)			
Notes	1							
	2							
	4							
	5	6	7	8				
Intersection								
Location					(NE, SE, SW, NW)			
Type					(Perp, Diag)			
5 foot landing?					(Yes/No)			
Tactile strip installed?					(Yes/No)			
Colored tactile strip?					(Yes/No)			
Slope run					(%)			
Cross slope					(%)			
Flare slope (if applicable)					(%)			
Approach slope					(%)			
Ramp width					(inches)			
Notes	5							
	6							
	7							
	8							

Sidewalk Inspection

Every sidewalk being constructed and/or modified must be assessed/re-assessed and this form filled out and submitted within ten days of project completion.

Sidewalks Street	1	2	3 	<u>4</u>	
Section(intersection to intersection)					
Side of street					(N, S, E, W)
Speed limit					(mph)
Sidewalk width					(inches)
Is there a buffer between sidewalk					
and street?					(Yes/No)
Quality					
Are curb ramps installed?					
Notes	1				
	3				
	4				
	5	6	7	8	
Street					
Section(intersection to intersection)					
Side of street					(N, S, E, W)
Speed limit					(mph)
Sidewalk width					(inches)
Is there a buffer between sidewalk					
and street?					(Yes/No)
Quality					(1 to 5 rating)
Are curb ramps installed?					(Yes/No)
Notes	5				
	6				
	7				

Accessible Pedestrian Signal Inspection

Every pedestrian signal being installed and/or modified must be assessed/re-assessed and this form filled out and submitted within ten days of project completion.

Pedestrian Signals Primary road	1	2	3	4	
Intersecting road					
Type of timing (time, actuated,					
semi-actuated, flashing red)					
Ped signal E/W					(Yes/No)
Ped signal N/S					(Yes/No)
Pushbutton E/W					(Yes/No)
Pushbutton N/S					(Yes/No)
Height of pushbutton					(inches)
Length of walking man					(seconds)
Length of flashing hand					(seconds)
Length of solid hand					(seconds)
Is there an audible tone?					(Yes/No)
Crosswalk E/W					(Yes/No)
Crosswalk N/S					(Yes/No)
Ramp E/W					(Yes/No)
Ramp N/S					(Yes/No)
Notes	1				
	2				
	3				
	4				