

INDEPENDENT BATTERY CERTIFICATE



CERTIFICATE NUMBER: BFB26A21-C9C6-4ECE-8E69-7A592F5A9913

VEHICLE

BRAND: Kia
MODEL: EV6 - 77,4 kWh

MILEAGE: 40,307 km
VIN: KNAC381AFN5069617
DATE AND TIME:
22.08.2025, 12:46:26

EXECUTED BY: Carla AB

RESULTS

STATE OF HEALTH (SOH)

97.7 %

ENERGY

76kWh | 77kWh




WLTP RANGE

516km | 528km

RATING

BENCHMARKING

How does your vehicle compare to comparable vehicles?

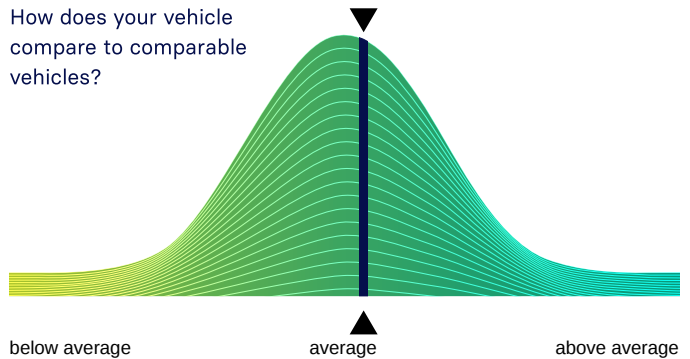

CHECKS

Battery Management System (BMS) ✓

Battery Sensor ✓

Battery Measurements ✓

Battery Cell Voltages ✓

Vehicle Communication ✓



SCAN FOR DETAILS

EVALUATION

EXCELLENT HEALTH - NO ABNORMALITIES DETECTED

Based on the detailed battery diagnostics performed with the AVILOO FLASH Test, we hereby certify that the drive battery of this vehicle is in excellent condition.

The drive battery is therefore officially AVILOO Certified.

Marcus Berger

Dr. Marcus Berger, CEO



ENERGY

	Gross	Net (Nominal)	Usable
Current:	78.2kWh	75.6kWh	71.7kWh
New:	80.0kWh	77.4kWh	73.4kWh

RANGE

	WLTP	Typical
Current:	414-516km	351km
New:	424-528km	359km

EXECUTION PROTOCOL

AVILOO Box connected. 12:46:22

FLASH Test started.	✓
Vehicle detected.	✓
Starting data acquisition.	✓
Finished data acquisition.	✓
Analyzing data.	✓
Analysis completed.	✓

SENSORS

Voltage Sensor	✓
Current Sensor	✓
Temperature Sensors	✓
Cell Voltage Sensors	✓

BMS


	Value	Status
BMS State of Charge (SoC)*:	55%	
SoC calculation accuracy:		✓
BMS State of Health (SoH)*:	100%	
SoH calculation accuracy:		✓

MEASUREMENTS

	Min	Max	Delta	Status
Battery Temperature	20.0°C	20.0°C	0.0°C	✓
Cell Voltage	3.740V	3.760V	20mV	✓
Pack Voltage	721.8V			
Average Current	-0.3A			

CELL VOLTAGES DIAGRAM

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20
1 - 20	3.760	3.740	3.759	3.755	3.760	3.760	3.759	3.760	3.740	3.760	3.760	3.759	3.759	3.759	3.760	3.760	3.740	3.755	3.760	3.760
21 - 40	3.759	3.740	3.748	3.760	3.754	3.755	3.760	3.754	3.759	3.740	3.760	3.760	3.740	3.760	3.740	3.740	3.760	3.760	3.759	3.752
41 - 60	3.760	3.760	3.760	3.760	3.760	3.760	3.740	3.760	3.760	3.740	3.740	3.760	3.760	3.760	3.759	3.740	3.740	3.740	3.740	3.760
61 - 80	3.740	3.760	3.740	3.760	3.759	3.746	3.759	3.760	3.746	3.749	3.748	3.751	3.760	3.740	3.760	3.740	3.760	3.760	3.752	3.753
81 - 100	3.740	3.760	3.740	3.760	3.760	3.751	3.759	3.752	3.760	3.740	3.745	3.748	3.740	3.740	3.759	3.740	3.760	3.760	3.740	3.740
101 - 120	3.760	3.740	3.740	3.760	3.760	3.760	3.740	3.740	3.760	3.760	3.760	3.752	3.752	3.740	3.754	3.760	3.759	3.760	3.760	3.760
121 - 140	3.740	3.760	3.740	3.740	3.760	3.740	3.740	3.740	3.740	3.760	3.749	3.740	3.759	3.760	3.740	3.759	3.755	3.760	3.760	3.760
141 - 160	3.760	3.740	3.754	3.759	3.760	3.760	3.750	3.754	3.746	3.760	3.745	3.760	3.760	3.745	3.760	3.760	3.760	3.760	3.760	3.760
161 - 180	3.760	3.760	3.760	3.760	3.760	3.760	3.760	3.760	3.760	3.746	3.760	3.740	3.759	3.760	3.760	3.740	3.760	3.740	3.740	3.759
181 - 192	3.760	3.760	3.760	3.760	3.760	3.760	3.760	3.760	3.759	3.760	3.760	3.760	3.760	3.759	3.760	3.760	3.740	3.760	3.740	3.759

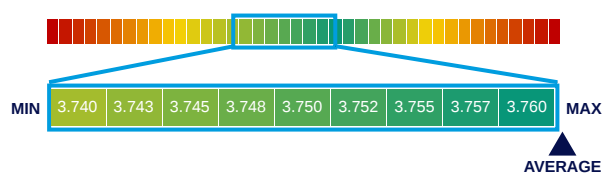

*The values shown here were not calculated by AVILOO but correspond to the values read out from the battery management system (BMS) and were calculated by the manufacturer. AVILOO therefore assumes no liability for their accuracy.

DISCLAIMER: The test result includes the currently calculated state of health (SoH) of the drive battery. The determination is based on data provided by the vehicle. These are evaluated by AVILOO's algorithms using statistical and analytical models. Manipulation of the data in the control unit leads to an incorrect result. The indicated SoH has a technically induced fluctuation range (deviation) of no more than 3% in at least 95% of reference measurements. It should be noted that this tolerance applies to the SoH determination at the cell level and not to the SoH of the entire battery. This is because the state of charge of individual cells may vary, which can negatively affect the current SoH of the battery. However, this can be compensated by the Battery Management System (BMS) or during a calibration. The result reflects the condition of the battery at the time of the test. No conclusions can be drawn about the future state of health of the battery from this. Statements about mechanical damage or external influences are not part of this diagnosis.