

**MUV MARKETPLACE SDN BHD** (253263-U)Lot 3, Jalan 6/3, Kawasan Perindustrian Seri Kembangan, 43300 Seri Kembangan, Selangor.
Tel: 03-8947 6888 Fax No: 03-8947 6880**VEHICLE INSPECTION REPORT**


Registration Number	WYR1258	Vehicle Location	-
Vehicle Model	VIOS E 1.5 (A)	Colour	Black
Engine Type	Petrol	Year Made	2013
Engine Capacity (C.C.)	1497	Mileage (KM)	94857
Gearbox Type	Automatic	Assessment Date	27/06/2020
Type of Usage	Individual Private	Body Type	Sedan
Engine Number	1NZY807496	Chassis Number	PN153HY9307179887
Key Set	2		

INSPECTION SUMMARY


Inspection area	Rating	Page	Inspection area	Rating	Page
Exterior	C	2	Gearbox	-	4
Structure	-	-	Undercarriage	-	4
Interior	B	3	Electrical	A	4
Engine	-	3	Flooded Rating	-	-

VEHICLE HISTORY**Comments:**

Structure (Bottom View)

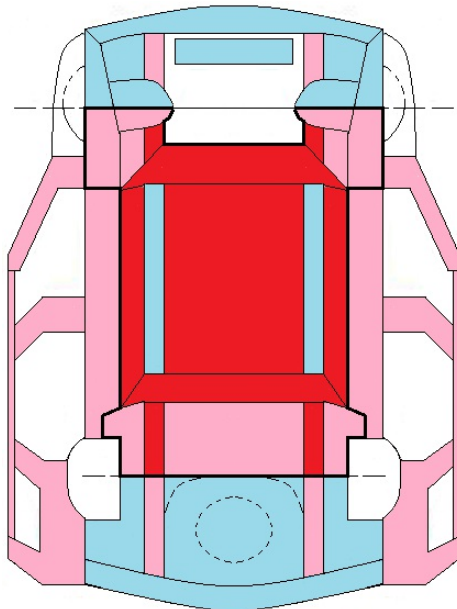

Exterior (Top View)

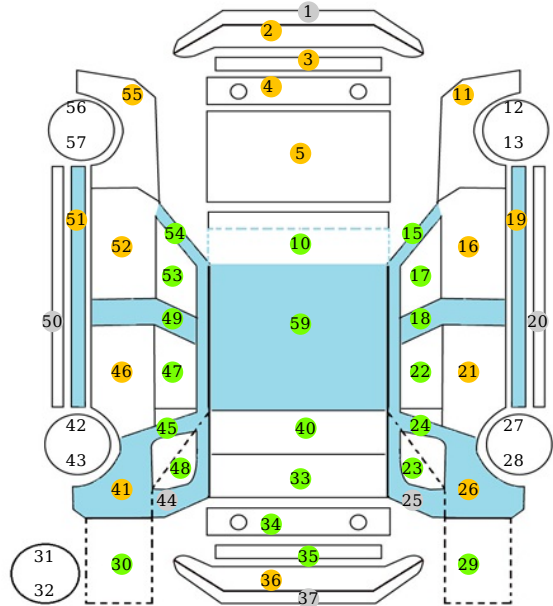**Legend:** ● NA ● Defect ● Normal

Disclaimer: Our inspection report are based on what is seen and heard by our inspectors at the time of inspection. We do not guarantee or warranty any physical deterioration or mechanical/technical failures or defects which arise after the date of inspection. No judgement is made to the internal components of engine, transmission, driveline, electrical or any other systems that require dismantling to diagnose. Our inspection report does not cover the authentication of the components or specification of the vehicle. The mileage is reported as per the readings on the odometer and MUV provides no guarantee to the actual mileage of the vehicle.

EXTERIOR

1	Front Skirt	N/A	32	Spare Tyre Brand, Size and Year Make	STANDARD SIZE
2	Front Bumper	Scratched (above 6cm)	33	Rear Trunk	Normal
3	Front Reinforcement	Scratched (below 3cm)	34	Rear Lighting Panel	Normal
4	Front Grille	Scratched (below 3cm)	35	Rear Reinforcement	Normal
5	Front Bonnet	Scratched (3cm - 6cm)	36	Rear Bumper	Re-sprayed, Replaced
6	Headlamp (Right)	Normal	37	Rear Skirt	N/A
7	Hazard/Signal Lamp (Right)	Normal	38	Rear Combination Lamp (Right)	Normal
8	Headlamp (Left)	Yellowish	39	Rear Combination Lamp (Left)	Normal
9	Hazard/Signal Lamp (Left)	Normal	40	Rear Windscreen	Normal
10	Front Windscreen	Normal	41	Rear Left Fender	Scratched (3cm - 6cm)
11	Front Right Fender	Scratched (below 3cm)	42	Rear Left Tyre Tread	5 mm
12	Front Right Tyre Tread	5 mm	43	Rear Left Tyre Brand, Size and Year Make	MICHELIN 185/60/R15
13	Front Right Tyre Brand, Size and Year Make	MICHELIN 185/60/R15	44	Left D-pillar	N/A
14	Side Mirror (Right)	Scratched	45	Left C-pillar	Normal
15	Right A-pillar	Normal	46	Rear Left Door	Scratched (below 3cm)
16	Front Right Door	Scratched (3cm - 6cm)	47	Rear Left Door Window	Normal
17	Front Right Door Window	Normal	48	Left Quarter Glass	Normal
18	Right B-pillar	Normal	49	Left B-pillar	Normal
19	Right Side Sill	Scratched (3cm - 6cm)	50	Left Side Skirt	N/A
20	Right Side Skirt	N/A	51	Left Side Sill	Scratched (3cm - 6cm)
21	Rear Right Door	Scratched (3cm - 6cm)	52	Front Left Door	Scratched (3cm - 6cm)
22	Rear Right Door Window	Normal	53	Front Left Door Window	Normal
23	Right Quarter Glass	Normal	54	Left A-pillar	Normal
24	Right C-pillar	Normal	55	Front Left Fender	Scratched (3cm - 6cm)
25	Right D-pillar	N/A	56	Front Left Tyre Tread	6 mm
26	Rear Right Fender	Scratched (3cm - 6cm)	57	Front Left Tyre Brand, Size and Year Make	MICHELIN 185/65/R15
27	Rear Right Tyre Tread	5 mm	58	Side Mirror (Left)	Normal
28	Rear Right Tyre Brand, Size and Year Make	MICHELIN 185/60/R15	59	Roof Top	Normal
29	Rear Right Cargo Panel	Normal	60	Antenna	Normal
30	Rear Left Cargo Panel	Normal	61	Vehicle Paint Condition	1 Layer Paint
31	Spare Tyre Tread	6 mm			

Additional comments:

Rear bonnet impact before

Exterior rating

INTERIOR

1	Dashboard	Normal	18	Seat Belt (Rear Left)	Normal
2	Audio System	Normal	19	Seat Adjustment (Right)	Manual
3	Navigation	N/A	20	Seat Adjustment (Left)	Manual
4	Speaker (Right)	Normal	21	Seat (Front Right)	Fabric
5	Speaker (Left)	Normal	22	Seat (Front Left)	Fabric
6	Front Console Box	Normal	23	Seat (Rear Right)	Leather
7	Floor Console Box	Normal	24	Seat (Rear Left)	Fabric
8	Armrest	Normal	25	Steering Wheel	Normal
9	Door Panels (Front)	Normal	26	Gear Knob / Lever	Normal
10	Door Panels (Rear)	Normal	27	Central Door Lock (Front Right)	Normal
11	Headrest (Front Right)	Normal	28	Central Door Lock (Front Left)	Normal
12	Headrest (Front Left)	Normal	29	Central Door Lock (Rear Right)	Normal
13	Headrest (Rear Right)	Normal	30	Central Door Lock (Rear Left)	Normal
14	Headrest (Rear Left)	Normal	31	Tonneau Cover	Normal
15	Seat Belt (Front Right)	Normal	32	Sunroof / Moonroof / Convertible Top / Hard Top	Normal
16	Seat Belt (Rear Right)	Normal	33	Immobilizer	N/A
17	Seat Belt (Front Left)	Normal			

Additional comments:

-

Interior rating

B

ENGINE

1	Battery	Normal	4	Engine Idle Condition	Normal
2	Engine Belting	Normal	5	Engine Running / Temperature	Normal
3	Engine Starting	Normal			

Additional comments:

-

Engine rating

-

GEARBOX

1	Gearbox Shifting (A/T)	Normal	4	Paddle Shifter / Sport Mode	N/A
2	Gearbox Shifting (M/T)	Normal	5	4WD Operation	N/A
3	Clutch Operation (M/T)	N/A			

Additional comments:

-

Gearbox rating

-

UNDERCARRIAGE

1	Shock Absorber /Absorber Mounting (Front)	Normal	3	Brake Operation	Normal
2	Shock Absorber /Absorber Mounting (Rear)	Normal			

Additional comments:

-

Chassis rating

-

ELECTRICAL

1	Power Windows (Front Right)	Normal	9	Boot	Manual
2	Power Windows (Rear Right)	Normal	10	Parking Sensor	Normal
3	Power Windows (Rear Left)	Normal	11	Camera - Front & Rear	N/A
4	Power Windows (Front Left)	Normal	12	Meters & Gauges	Normal
5	A/C System	Normal	13	Warning light (Gearbox)	Normal
6	Washer	Normal	14	Warning light (Chassis)	Normal
7	Wiper	Normal	15	Warning light (Engine)	Normal
8	Sliding Door	N/A			

Additional comments:

-

Electrical rating

A

Test drive comments:

-