


Unoccupied Warehouse Property  
50 Kirby Avenue  
Somerville, Somerset County, NJ

SCALE: AS NOTED DATE: 11/2/2021  
DRAWN BY: KNG CHKD BY: RLG  
JOB: Figure 2  
DWG. NO.

-  HISTORIC TEST PIT SAMPLE LOCATION
-  SOIL SAMPLE LOCATION

[ ENVIRONMENTAL MANAGEMENT GROUP (EMG) ]


Date	Samples Collected	Notes
3/22/2019	B16 through B19	Transformer Pad Area Samples
5/7/2019	50-1/1a through 50-5/5a	"
6/12/2019	50-5b through 50-9	"
7/2/2019	50-9a & 50-10	"
8/28/2019	50-R1a/R1b through 50-R15a	Transformer Pad Area Excavation Samples
10/2/2019	50-R6b through 50-R15b-1	Transformer Pad Area Post Ex Delin. Samples
10/29/2019	50-R14A-2 through 50-R17	"
11/8/2019	50-B1 through 50-B5	Historic Fill / PCB Delineation
12/5/2020	50-B6 through 50-B10	"
1/8/2020	50-B11 through 50-B15	"
5/6/2020	50-B16 through 50-B22	"
6/15/2020	50-B23a/23b through 50-B33a/33b	"
1/22/2021	50-B34a/34b, 50-B35a/35b, 50-B15b, 50-B7b	Historic Fill / PCB Delineation

**PCB Conc. Above NJDEP NRSRS (1.0 mg/Kg)**

50-R17	3.0
50-B1	4.7
50-B3	7.1
50-B7	8.1
50-B14	1.2
50-B18	3.2

**PCB Conc. Above NJDEP RSRs/DIGWSSL (0.2 mg/Kg)**

50-R1A	0.24
50-R16	0.66
50-B5	0.29
50-B6	0.46
50-B8	1.0
50-B11	0.49
50-B12	0.21
50-B15	0.70

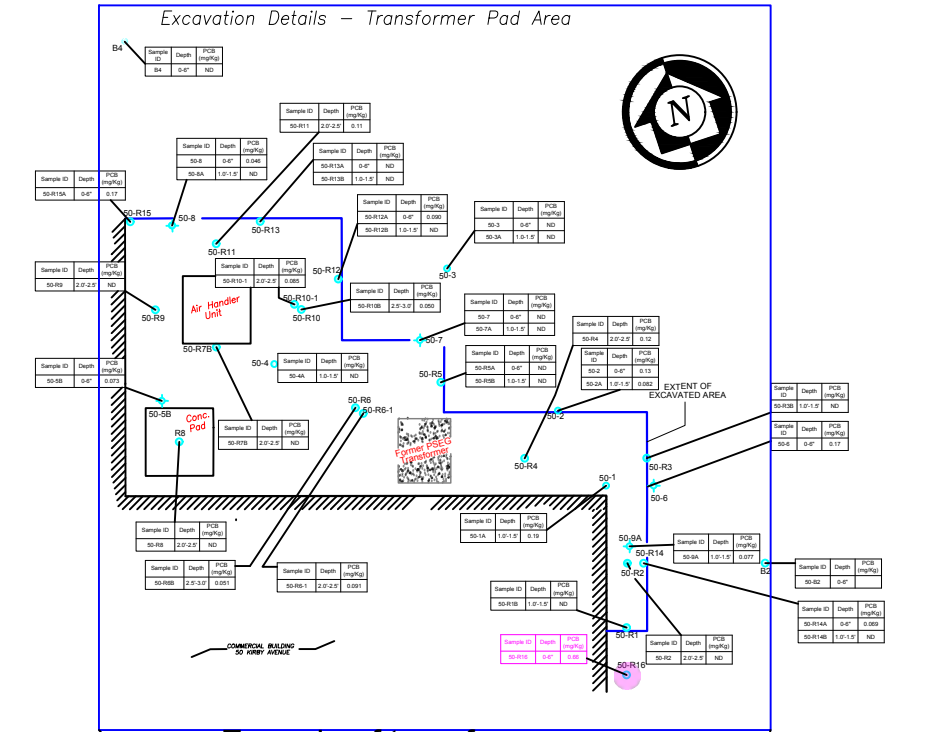

Zoom in of transformer area

